Vision System FH series

Industry's Fastest Compact Vision System

The Fastest FH

» Easy to Integrate in Machines

» Increase Machine Speed

» Perform High-precision Machine Operation

sysmac
always in control

Industry's Fastest* Compact Vision System
A New Concept in Image Processing That Considers

It's time to move beyond simply increasing the speed of image processing and start seriously shortening Machine cycle time. This is the concept that gave birth to OMRON's FH-series Vision System and its best-in-the-industry speed.

Manufacturing Machines are operated through the interaction of sensors, PLCs, servomotors, and other devices. Vision Systems measure positions and perform inspections, and the results are used to control the operation of Machines. The demand for faster, more precise Vision System operation is the primary requirement. The FH-series Vision System provides higher speed and precision for Machine cycle time and is loaded with all of the performance required to move Machines quickly and at high precision into a compact Controller for embedding into Machine. And even though the Camera/communications interfaces, image processing algorithms, and other features of this complete image processing system are built into one housing, the flexibility of a PC-based image processing system is also provided to help increase efficiency in the frequent reuse of Machine designs and in design changes.

*Based on OMRON investigation in May 2013.

Input

FH Series

EtherCAT.

EtherNet/IP

Think & See

HDR

Real Color

Shorter Machine Cycle Times

Logic control

- Sysmac is a trademark or registered trademark of OMRON corporation in Japan and other countries for OMRON factory automation products.
- EtherCAT® is registered trademark and patented technology, licensed by Beckhoff Automation GmbH, Germany.
- Windows is a registered trademark of Microsoft Corporation in the USA and other countries.
- The Microsoft .NET software is used to connect users, information, systems, and devices.
- Other company names and product names in this document are the trademarks or registered trademarks of their respective companies.
- The product photographs and figures that are used in this catalog may vary somewhat from the actual products.
  Microsoft product screen shot(s) reprinted with permission from Microsoft Corporation.

Machine Cycle Time

Increase Machine Speed ≫ p4

· **High-speed Response to Execution Instructions from a PLC**
A high-speed image bus and 4-core processing increase the speed at every step, from image input to data output.
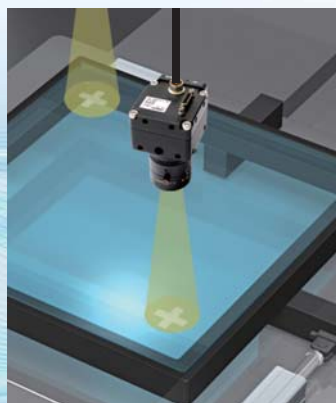
· **Multiple camera inspections provide total judgement results**
Calculations are easy to set for the results from four parallel tasks.

· **Quickly Outputting Measurement Results to a PLC**
You can output results to an NJ-series Machine Automation Controller on an EtherCAT communications cycle of 500 μs.

Perform High-precision Machine Operation ≫ p8

· **Measurements for Out-of-focus or Rotated Images**
The new Shape Search III processing item provides superior stability.

· **No Worker-dependance in Calibration Accuracy**
Vision master calibration is provided.

Easy to Integrate in Machines ≫ p10

Positioning

· **Shared Machine Interface**
Microsoft® .NET is supported.

· **Display Only Required Menu Commands on the Operation Interface**
User interface customization is supported.

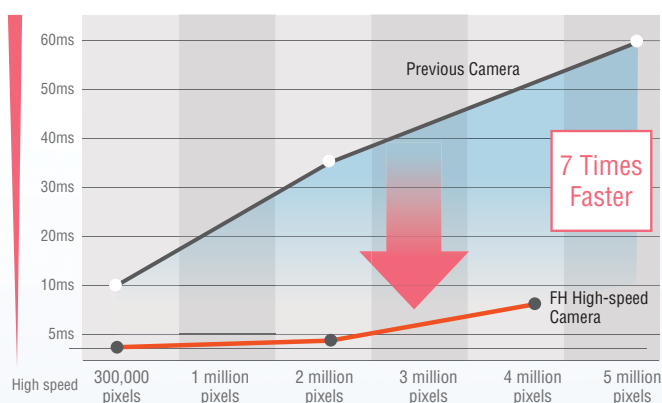· **Fast Support for Additional Measurement Needs**
Complete processing item libraries are provided.

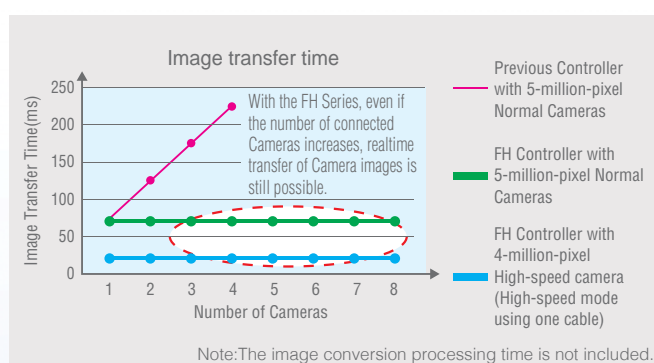# Process Higher-resolution Images without Increasing the Machine Cycle Time

High-speed Image Input **Fastest: 3.3 ms**

Camera resolution, driven by higher expectations for quality, continues to increase. OMRON has greatly reduced the input time and image transfer time to provide high-speed processing to match the speed of Machine applications for high-resolution images. Even with more Cameras and higher resolution, high-speed image input will contribute to increasing throughput.

[Graph: High-speed Image Input]

- 60ms, 50ms, 40ms, 30ms, 20ms, 10ms, 5ms
- Previous Camera
- 7 Times Faster
- FH High-speed Camera
- High speed: 300,000 pixels, 1 million pixels, 2 million pixels, 3 million pixels, 4 million pixels, 5 million pixels

Ultra-high-speed Searching **Shape Search III** Think &See

New technology makes search algorithms nine times faster than before. Even for unstable image conditions, including light interference, overlapping shapes, gloss, and incomplete images, stable searching is possible without reducing speed, resulting in a increased stability.

Super-fast Search Processing

- Time (ms): 30, 25, 20, 15, 10, 5, 0
- Up to 9 Times Faster
- Input Image Size: 300,000 pixels, 2,000,000 pixels, 5,000,000 pixels
- ■ Previous search processing items
- ■ Shape Search III in Normal Mode
- ■ Shape Search III in Fast Alignment Mode

Note:The image conversion processing time is not included.
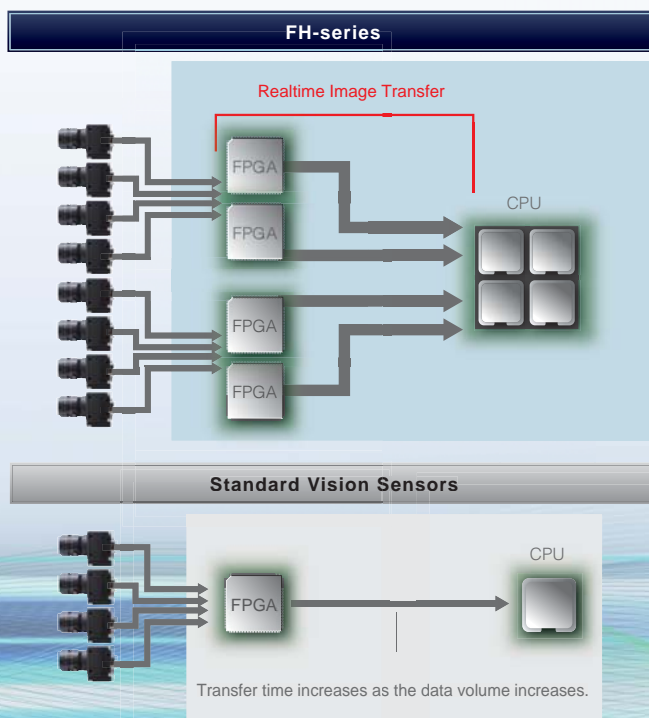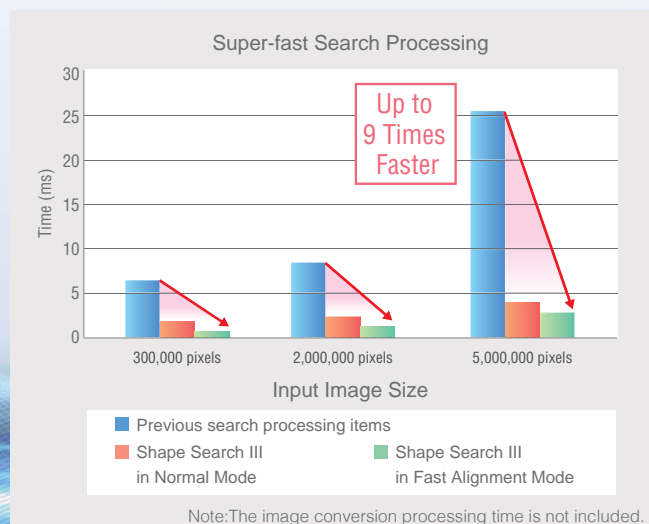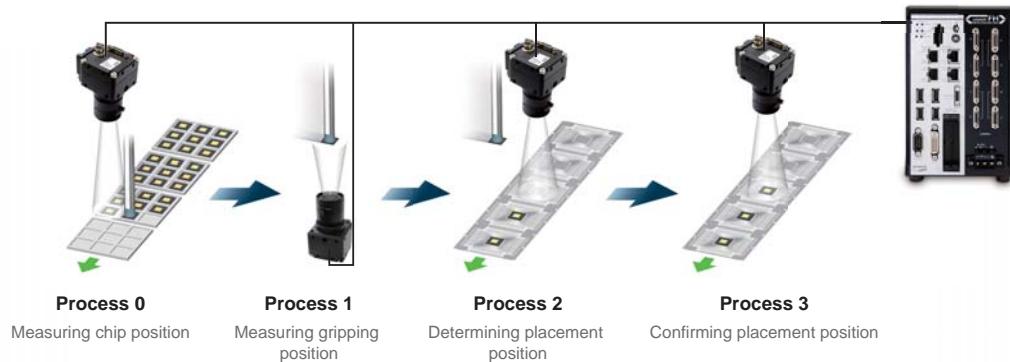
Realtime Image Transfer

High-resolution Cameras capture large amounts of data, which can make a bottleneck out of the transfer speed time in addition to the image input time bottleneck. An FH-series Controller provides a faster, multi-line image bus to enable realtime transfer of large amounts of image data for high-resolution Cameras or multiple Cameras. If high-precision measurements were sacrificed due to speed, the FH Series returns your precision without increasing cycle time.

Image transfer time

- Image Transfer Time(ms): 250, 200, 150, 100, 50, 0
- With the FH Series, even if the number of connected Cameras increases, realtime transfer of Camera images is still possible.
- Number of Cameras: 1, 2, 3, 4, 5, 6, 7, 8
- —— Previous Controller with 5-million-pixel Normal Cameras
- —— FH Controller with 5-million-pixel Normal Cameras
- —— FH Controller with 4-million-pixel High-speed camera (High-speed mode using one cable)

Note:The image conversion processing time is not included.

FH-series

Realtime Image Transfer

FPGA, FPGA, FPGA, FPGA → CPU

Standard Vision Sensors

FPGA → CPU

Transfer time increases as the data volume increases.

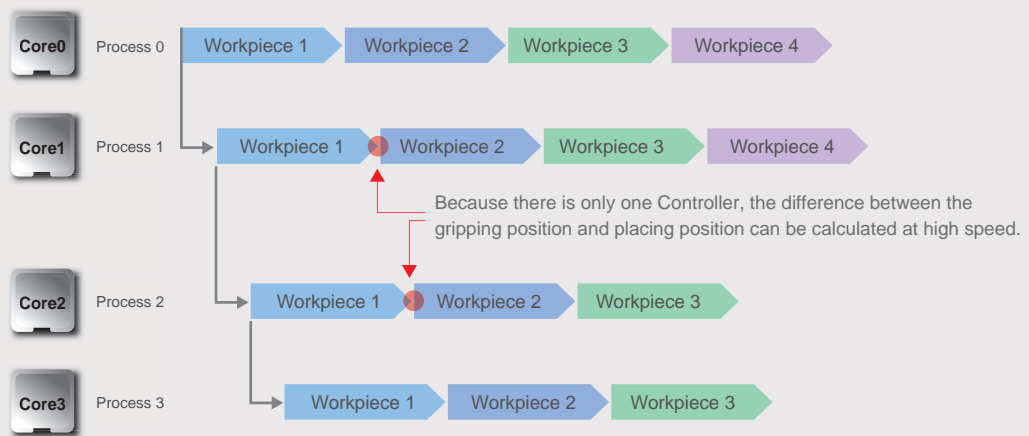# Four-core CPU* to Meet High-speed Demands for Different Machines

*for high speed controllers only

Case1 Perform Calculations for Multiple Cameras without Delay

Even when the measurement results of sequential operations are dependent on the speed of the independent action, parallel processing allows high speed performance without any dwell time. The measurement results from four cores can be easily calculated on one Controller to achieve continuous interaction without any special programming.

Process 0
Measuring chip position

Process 1
Measuring gripping position

Process 2
Determining placement position

Process 3
Confirming placement position

Measuring the Next Workpiece without Waiting Time

Core0 Process 0 | Workpiece 1 → Workpiece 2 → Workpiece 3 → Workpiece 4

Core1 Process 1 | Workpiece 1 → Workpiece 2 → Workpiece 3 → Workpiece 4

Because there is only one Controller, the difference between the gripping position and placing position can be calculated at high speed.

Core2 Process 2 | Workpiece 1 → Workpiece 2 → Workpiece 3

Core3 Process 3 | Workpiece 1 → Workpiece 2 → Workpiece 3

Frequently Waiting for Processing with a Standard Vision Sensor

The lack of the ability for standard Vision Sensors to handle parallel processing creates waiting time everywhere. If the Machine cycle time cannot be increased, a Controller must be added for each process to perform parallel processing, increasing costs.
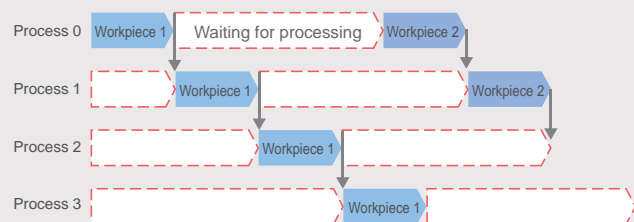
Process 0 | Workpiece 1 | Waiting for processing | Workpiece 2

Process 1 | Workpiece 1 | Workpiece 2

Process 2 | Workpiece 1

Process 3 | Workpiece 1

FH

Four-core CPU* to Meet High-speed Demands for Different Machines

*for high speed controllers only

Case2 Machine Cycle Time Reduced to 1/4* of Previous Time

Four cores process triggers, so the trigger interval can be 1/4th* of previous models.

*In-house comparison.

Standard Vision Sensors

Process 1 | Process 2 | Process 3 | Process 4

Trigger | Trigger

Reduced to 1/4

FH

Core0 Process 1 | Core2 Process 3
Core1 Process 2 | Core3 Process 4

Trigger

Core0 Process 1 | Core2 Process 3
Core1 Process 2 | Core3 Process 4

Trigger

Core0 Process 1 | Core2 Process 3
Core1 Process 2 | Core3 Process 4

Trigger
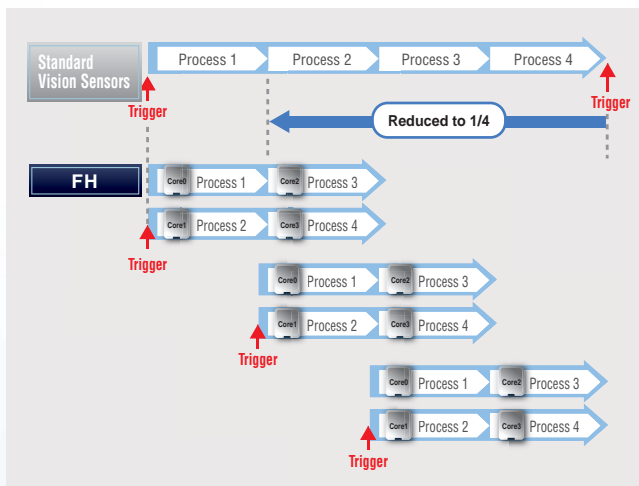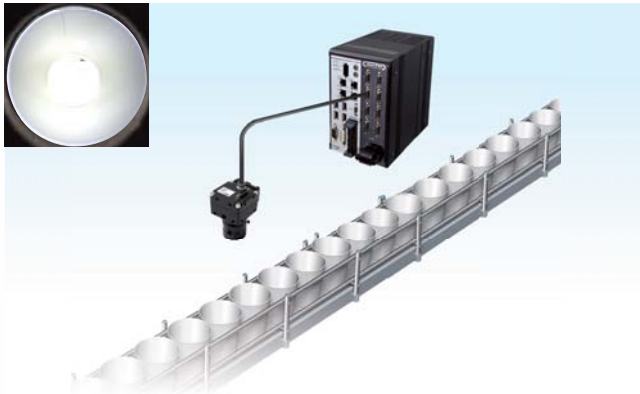
Multi-input Function Continuous High-speed Image Capture

Higher Speed from Advanced Image Capture and Parallel Measurements

Each camera has its own image buffer for storing image data that is separate from the main memory used for measurement processing. This allows for up to 256 frames of continuous high-speed image capture even while the main memory is processing measurement data.

Image input: 1st | 2nd | 3rd | 4th   Movement of workpiece

Measurement processing: 1st | 2nd | 3rd | 4th
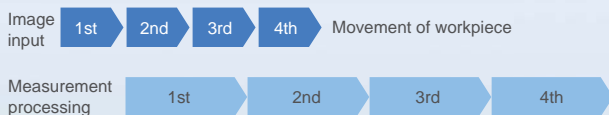
*The number of images that can be captured depends on the Controller and the Camera that is connected to it. Refer to the user's manual for details.

Case3 Process Multiple Lines in Parallel without Any Waiting Time

Four controllers are compressed into one without increasing the line cycle time. You can greatly reduce costs for processes that involve many lines.

FH-series

Core0 — Line 0 — Image input | Measurement processing | Output
Core1 — Line 1 — Image input | Measurement processing | Output
Core2 — Line 2 — Image input | Measurement processing | Output
Core3 — Line 3 — Image input | Measurement processing | Output

Eliminate the 'Waiting Time' Bottleneck

Standard Vision Sensors

When multiple triggers are input to a standard vision sensor, only image input is performed in parallel, and waiting time occurs when starting measurement processing. This time becomes a bottleneck in terms of the Machine cycle time.

Line 0 — Image input | Measurement processing | Output
Line 1 — Image input | Waiting Time | Measurement processing | Output
Line 2 — Image input | Waiting Time | Measurement processing | Output
Line 3 — Image input | Waiting Time | Measurement processing | Output

Fast Output of Measurement Results to Reduce Machine Cycle Time

EtherCAT Machine Control Network

EtherCAT is a high-speed open network that is ideal for Machine control. You can use EtherCAT to connect to NJ-series Machine Automation Controllers and motion control G5-series Servomotors and Servo Drives to increase the control speed over everyday communications protocols from workpiece detection to starting axis motion.

Communications Cycle

Conventional communications standard — 4 ms

EtherCAT — 0.5 ms

Reduced to 1/8

■ **Features**

・**Communications cycle as low as 500 μs**

・**Motion control that is synchronized with the communications cycle**
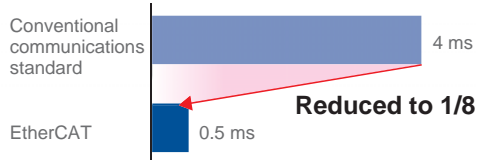
Time from Trigger Input to Producing Measurement Results

Trigger input → Measurement results

Conventional communications standard

EtherCAT

Shortened by approx. 6 ms.

Note:The times given above are typical times. They depend on parameter settings.

Positioning Solution That Eliminates Workpiece Dwell Time: Continuous Alignment Patent Pending

For a Machine that requires micron precision, one alignment is not always enough to obtain an acceptable error level, but executing multiple alignments greatly increases the processing time. OMRON provides control methods that eliminate workpiece dwell time, the main cause of increased processing time. Our Sysmac Automation Platform achieves high-speed, high-precision control that continuously detects workpiece positions and successively updates the travel distance to quickly approach the target position.

NJ-series Machine Automation Controller

EtherCAT

sysmac
always in control

G5-series Servomotors and Servo Drives

[Previous Vision Sensors]

Measurement → Stage movement → Measurement → Stage movement → Measurement → Stage movement → Measurement

Stage moving speed

This graph indicates the speed changes in one specific axis (the X axis).

Alignment

Y
1st
2nd
3rd
X
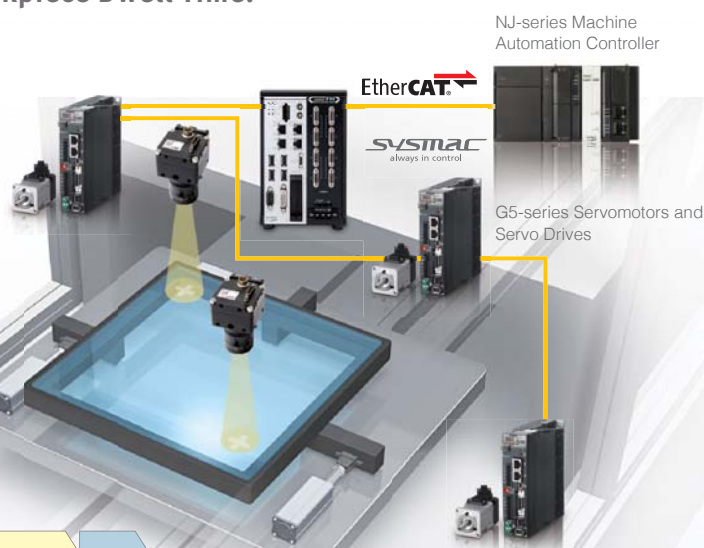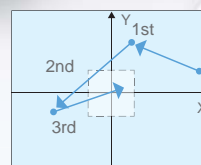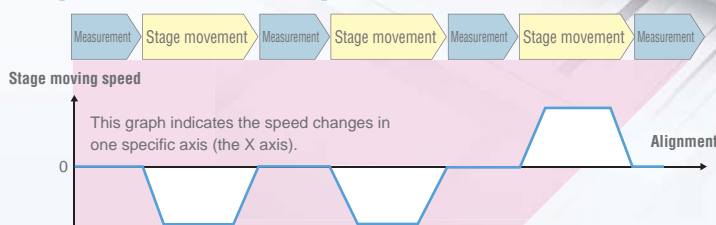
The dotted box indicates the target precision range.

[Sysmac]

Measurement → Stage movement → Measurement → Measurement → Measurement

Stage moving speed

This graph indicates the speed changes in one specific axis (the X axis).

Alignment

The workpiece quickly approaches the target position without stopping.

Y
1st
X
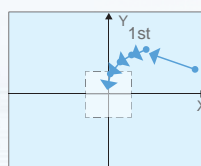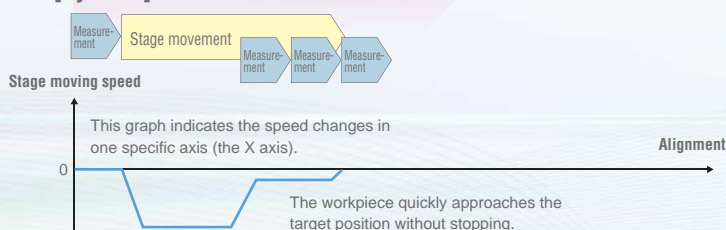
The dotted box indicates the target precision range.

Note:Please ask your OMRON representative for details.

FH FZ5

The High-precision Image Processing Required for Positioning Shape Search III *Think & See*

Low-error Position Detection Even with Blurry Images

Over the years, OMRON has perfected techniques to search for and match templates at high speed. From these techniques Shape Search III provides advanced robustness, which is critical on FA sites. When measuring lamination of glass or other processes where the distance to the workpiece from the Camera varies, size differences and focal shifts can occur. Even in cases like this, the new Shape Search III algorithm detects positions with limited error.

Camera
Glass 1
Glass 2

Error (pixels)

— Previous search processing items

— Shape Search III

Error

Close ← Z-axis travel amount [mm] → Far
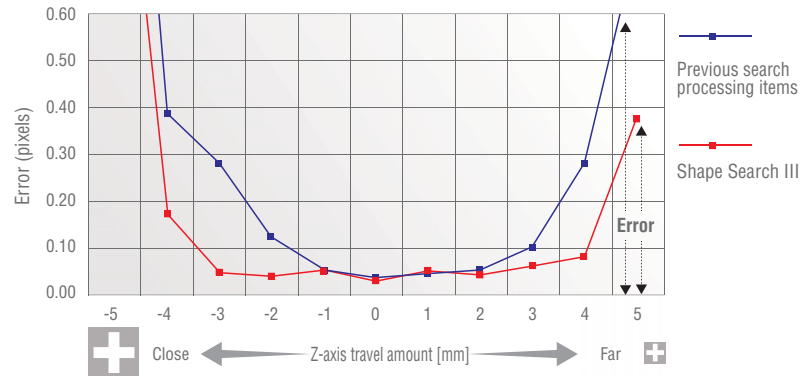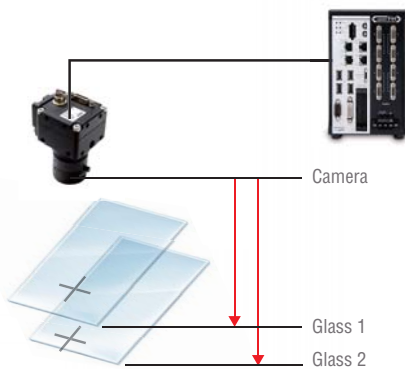
Stable Searching with Limited Error Even under Adverse Conditions

Stable searching is possible even under the following adverse conditions, which occur far too often in actual measurement applications.

■ Previous Search ■ Shape Search III

Error (pixels)

Focal shift | Contrast | Chips | Hidden | Overlapping | Thinning and thickening

Focal shift | Contrast | Chips

Hidden | Overlapping | Thinning and thickening
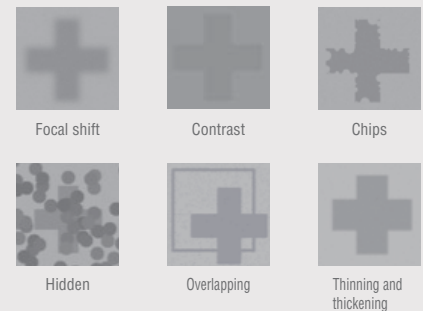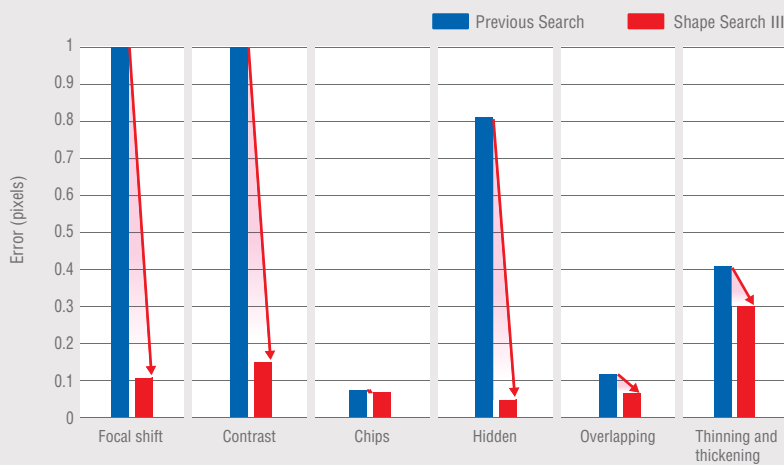
Visualization of Comparisons Enables Easy Setup of High-precision Searching

Patent Pending

Advanced searching is accompanied by many parameters that must be tuned to match the application. However, it is difficult for the person making the settings to see the internal process. Extensive time is required to make the most of tool performance. With Shape Search III, you can visualize comparisons between the model data and a part of the measurement object to easily see when comparisons are not matched well for the inspection. Visualization of the comparison level, allows for parameters to be adjusted simply to obtain the best performance.

Registered model

Measurement image

Deformation

Chip

You can see at a glance the difference between the registered model and measurement image.

Reduction in correlation

No reduction

You can adjust a parameter called the Acceptable Distortion Level to enable measurements without reducing the correlation even if there is distortion. You can easily adjust this parameter while monitoring the comparison.

Converting Measurement Results to Output User Units

Support for the Main Stages and Robots Used for 2D Positioning

The FH Controllers contain special setup displays for the stages and robots that are commonly used on FA sites. You just fill in the settings to easily output axis travel amounts for stages and robots.

User Interface Example

Application Examples

Robots	Stages
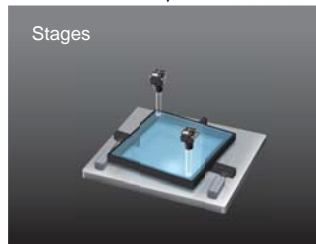
Item			
Stages	XY		
	XYθ	θ axis: Direct drive	Camera axis movement: None
			Camera axis movement: X axis
			Camera axis movement: Y axis
			Camera axis movement: XY axes
		θ axis: Linear drive	Camera axis movement: None
			Camera axis movement: X axis
			Camera axis movement: Y axis
			Camera axis movement: XY axes
	θXY	θ axis: Direct drive	Camera axis movement: None
			Camera axis movement: X axis
			Camera axis movement: Y axis
			Camera axis movement: XY axes
		θ axis: Linear drive	Camera axis movement: None
			Camera axis movement: X axis
			Camera axis movement: Y axis
			Camera axis movement: XY axes
	UVW	Direct fulcrum motion	
		Rotary fulcrum motion	
	UVWR	Direct fulcrum motion	
		Rotary fulcrum motion	
Robots	3 axes		
	4 axes	Control method: Fixed positions	
		Control method: Measured positions	

Vision Master Calibration for High-precision Positioning Even with Normal Lenses

To perform high-precision positioning, the coordinate system must be accurately aligned between image processing and the stage or robot. Calibration is used to achieve this. Normally trial and error in the actual application environment is necessary, which requires experience in moving sampling points and a experience with the influence of minor tilt in the Camera installation, the influence of lens distortion, and other factors. With an FH Controller, all you need to do is set a minimum number of conditions. Movement patterns for the sampling points are automatically calculated to optimize the stage/robot axis travel ranges, imaging processing field of view, and other factors, and the required axis travel amounts are sent to the PLC. By moving the system according to the instructions, optimum sampling is achieved and the coordinate systems for image processing and the stage/robot are accurately aligned. Correction coefficients are simultaneously calculated for Camera tilt and lens distortion. If you use the calibration conversion parameters that are made with this function, you can easily achieve high-precision positioning even for normal lenses with high distortion rates.

Distortion Caused by Camera angle

Coordinate System

Different X and Y magnifications cause distortion.

The installation can cause trapezoidal distortion. This distortion is even greater with a normal lens.

Three Types of Automatic Calibration

Affine transformation

Trapezoidal distortion correction

Converted to a coordinate system with correct X and Y factors.

Distortion due to lens performance

The influence of distortion increases towards the edges of the field of view.

If sampling is performed away from the center of the field of view, distortion reduces the calibration accuracy.

Lens distortion correction

Conversion is made to the coordinate system even at the edges of the field of view.

FH FZ5
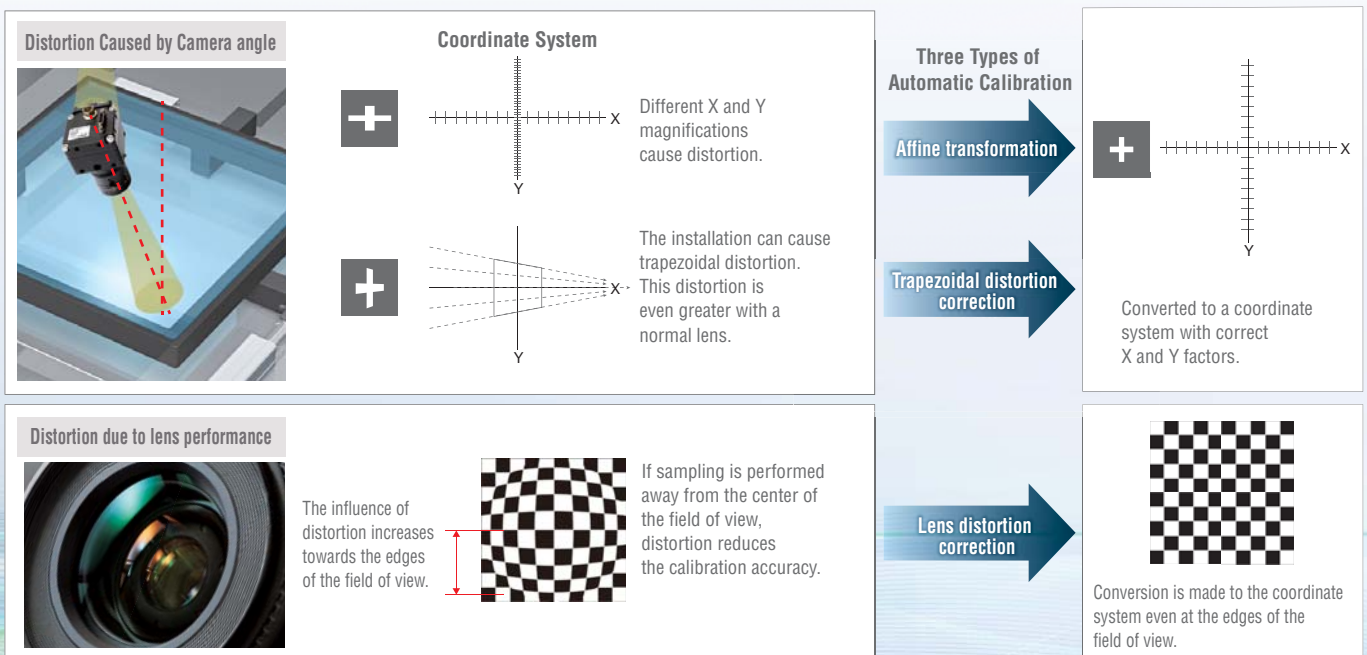
Easily Connect the Components That Configure the Machine

Easy Integration into an Machine Monitor Support for .NET User Interface Controls

Custom .NET controls are supported so that you can easily display FH Controller measurement images and measurement results on a Machine PC.

Integrated Machine Monitor

FH
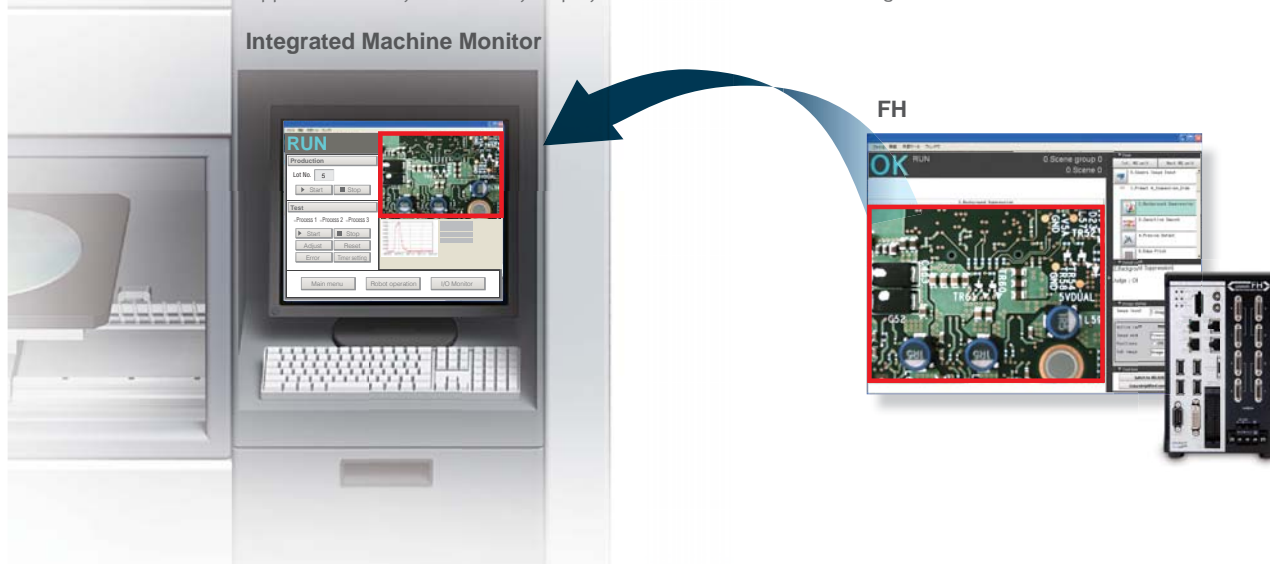
Easy Customization

① **Custom controls for FH measurement images and measurement results are laid out on Microsoft Visual Studio®.**

② **Instead of writing the program code from scratch to build interfaces, you can easily build the interfaces simply by pasting custom controls.**

Pasting custom controls
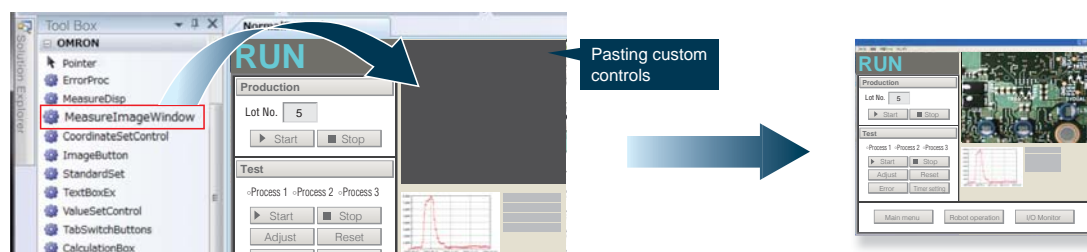
Output to HMI or High-resolution Monitor

Microsoft® Visual Studio® is a registered trademark of Microsoft Corporation.

Design the Connected Components with One Software Application

Develop Machine Control Programs with One Software Application: Sysmac Studio

Use the Automation Software Sysmac Studio to set up all of the slaves connected via EtherCAT. Simulate and debug motion control, logic, drives, and sensing on an integrated platform to reduce the work required for Machine design.

One Software

Sysmac Studio version 1.07 or higher supports the FH Series.

NJ-series
Machine Automation Controller

FH-series
Vision System

G5-series
Servomotors and Servo Drives
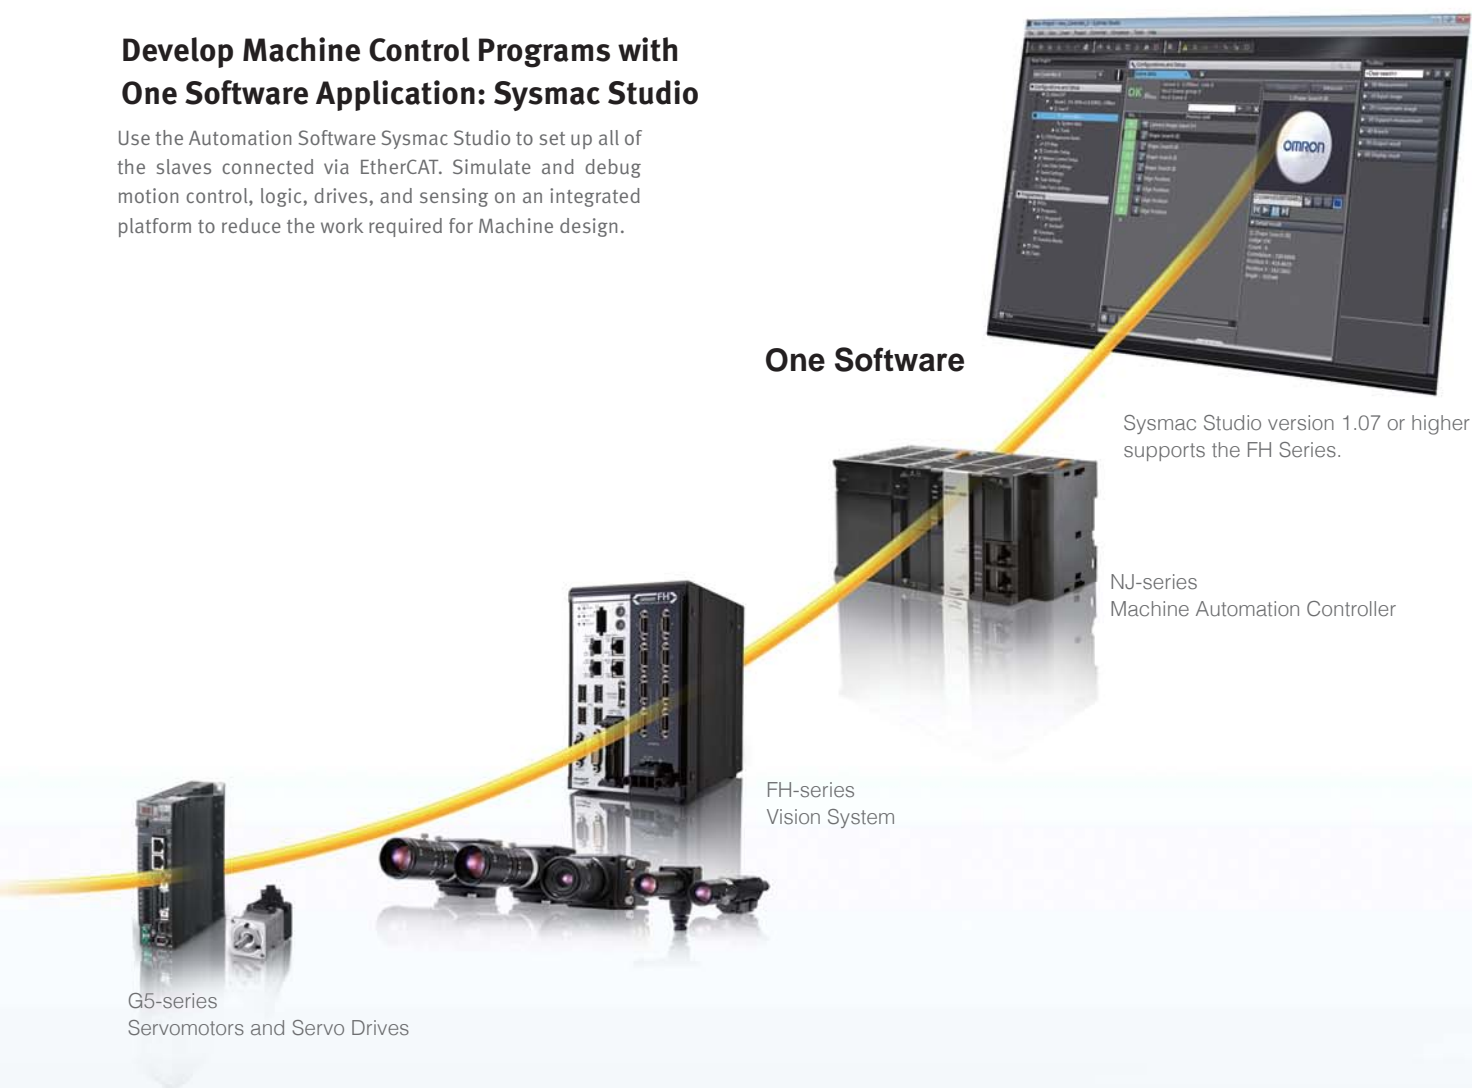
Minimize Commissioning and Adjustment Work with Simulations

Integrated simulations linked to an NJ-series Machine Automation Controller lets you verify the NJ-series program logic.
You can directly edit the EtherCAT I/O map to send measurement commands to FH-series Vision Sensors.

FH FZ5
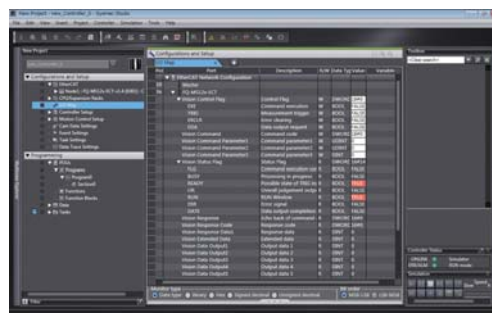
Easy Setup with Program Scalability

Customize Original Operation Interfaces

Show only the buttons you need

Choose from our library of buttons and position them anywhere on-screen to best support your daily operation, without 'screen clutter".

Arrange the Interface Elements Flexibly

You can flexibly change the image display composition to display an entire image, enlarge part of an image, or display images from different Cameras.

Move windows freely

Drag and drop windows where you want. You can also change the box size and delete.

Nine screen layout

Up to 9 screens can be stored depending on the application or user classification.
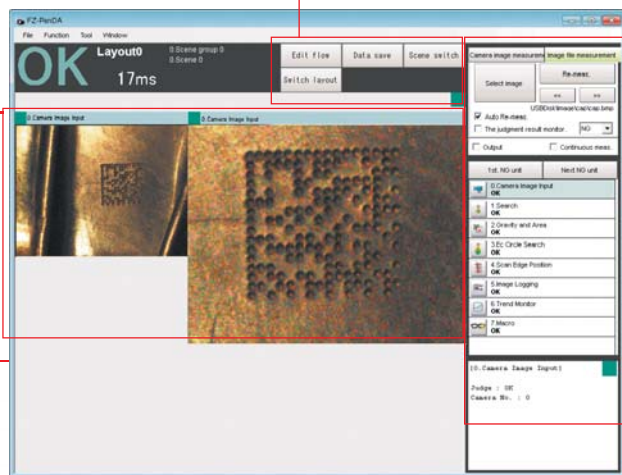
Hide Unnecessary Adjustment Commands

With only menu operations on the Controller, you can customize the setting displays in dialog boxes for processing items. For example, you can set up the interface to hide any parameters from the operator.

Freely Lay Out Dialog Box Contents

Completed

Only a parameter required for daily operation can be displayed.

Completely Different Operation Interfaces for the Designer and Operator

Accounts can be used to keep completely different operation interfaces for the designer and the operator. You can set up to eight levels of security for up to 50 items for each account. You can record operation logs for each account to enable smoothly isolating problems when troubleshooting.

Operating time   Operating user   Operation
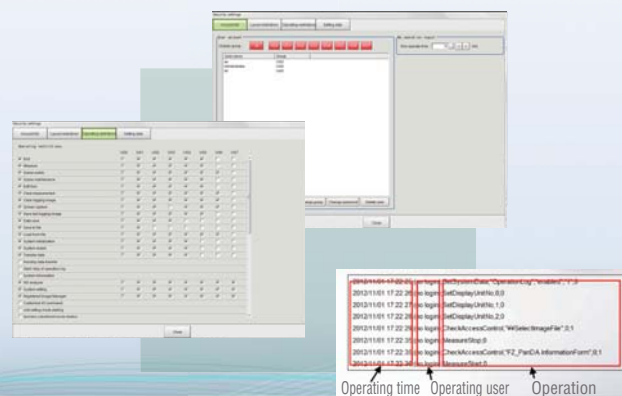
Flow Viewer Builds the Measurement Process with Flow Chart Programming

Just add any of the large variety of processing items to the measurement flow to build the basic program for image processing.

All processing items have menus for easy setup and adjustment.

Easily build the best imaging processing for each application to smoothly complete testing and adjustments without programming.

Flowchart
Just add processing items from the processing item list to visually edit the flow.

Processing Item List

Folders

You can group processing units into named folders. By managing related processing together and hiding lower levels, you can display even long measurement flows in a way that easily shows the overall flow.

Flowchart Output

You can save the flowchart as an image file.

Branching

You can use conditional branching to branch according to the execution results of the previous processing units or you can use branching controls with external commands through parallel I/O, PLC Links, or no-protocol communications.

Easy Multi-language Support: Change between 9 Languages

You can change display messages between nine different languages: English, Chinese (traditional or simplified), German, French, Italian, Spanish, Korean, and Japanese. You can display the best language for the user for applications in other countries.

English

Simplified Chinese

Traditional Chinese

Korean
German
French
Italian
Spanish
Japanese

High-precision Alignment Library

Alignment Calculations

Movement Single Position

Movement Multi Points

Position Data Calculation

Convert Position Data
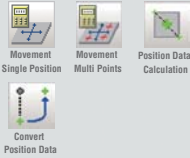
Four specialized types of alignment calculations are supported. These can be combined to easily execute alignments that require complex calculations on previous systems models or computers.

Movement Single Position
The axis movement that is required to match the measured position angle to the reference position angle is calculated.

Convert Position Data
The position angle after the specified axis movement is calculated.

Movement Multi Points
The axis movements that are required to match the measured position angles to the corresponding reference position angles are calculated.

Position Data Calculation
The specified position angle is calculated from the measured position.

Available Alignment Methods

Position Angle Alignment

Offsets are suitable for aligning the positions of workpieces with different sizes.
Position angle alignment allows the use of offsets to achieve flexible positioning.
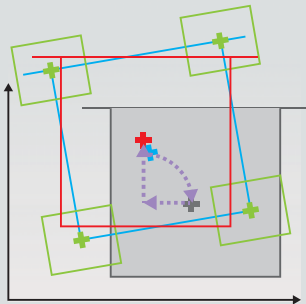
1 The Position Data Calculation processing item is used to calculate the position and angle to use in the axis movement based on measurement results (shown in green).

2 The rotational movement on the θ axis is calculated as the reference angle minus the measured angle.

3 The measurement position is rotated by the rotational movement for the θ axis (gray).

4 The reference positions X and Y minus the measured positions X and Y after rotation are used as the X-axis movement and Y-axis movement.

Alignment with Side Measurements

This alignment method measures the sides of the workpiece. You can even use it without alignment marks and when workpiece corners cannot be measured. This method is suitable for positioning workpieces with round corners.

Enlarged

Measurement on Y Axis | Measurement on X Axis

Enlarged

④ ③

④

③
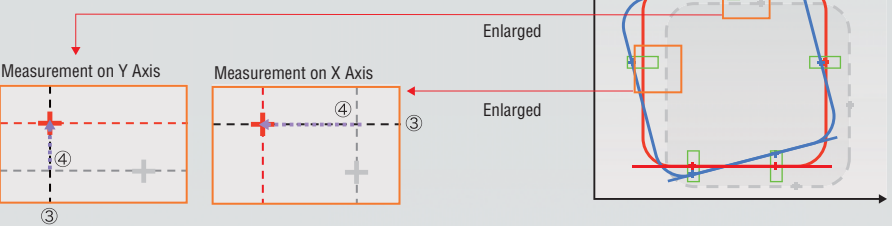
1 The angle is calculated from the side where two points are measured. The rotational movement on the θ axis is calculated as the reference angle minus the measured angle.

2 The measurement position is rotated by the rotational movement for the θ axis (gray).

3 A straight line that goes through the positions calculated in step 2 and that has the same direction as the reference angle (for the X axis) is calculated. (The direction on the Y axis is the reference angle plus 90°.)

4 The intersecting point between the straight line calculated in step 3 and the same axis as the measure direction that goes through the reference position is calculated.

5 The difference between the reference point and the intersecting point calculated in step 4 is the movement in the measurement direction. The above calculations are performed for each point and the average values are used as the X-axis movement and Y-axis movement.

Corresponding Point Alignment

The axis movements from the measured positions to the reference positions are calculated based on relational position information. This method is suitable for aligning all points within certain distances so that small deviations in the distances do not result in continuity failures, such as they can when aligning electronic substrates.

Reference positions | Measured positions | Maximum error ranges

Corrected
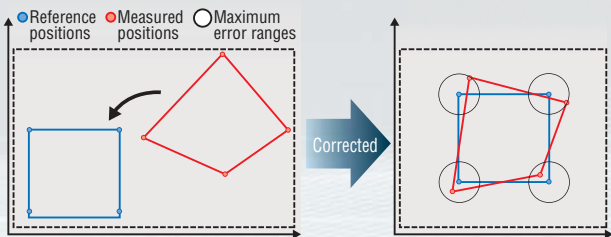
Setup Aids

Iris Focus
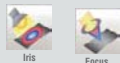
Optimum Focus and Aperture Settings

Until now, focus and brightness settings were adjusted according to experience and intuition. But now they can be evaluated numerically and visually on graphs. This allows quick verification of optimum focus and aperture settings to eliminate inconsistencies in settings caused by worker differences so that you can achieve even higher levels of measurement accuracy.

Out of focus

Optimal focus
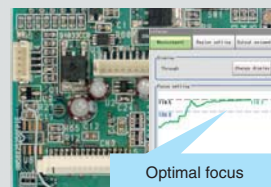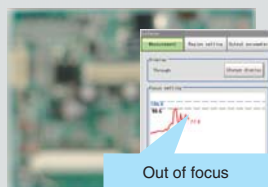
· Camera installation and setup are easy.
· Errors can be generated when the focus or aperture changes.
· You can determine the numerical values for the focus and aperture for the master workpiece so that essentially anyone can reproduce the same conditions.

Calibration

Vision Master Calibration   PLC Master Calibration   Precise Calibration

Camera Calibration
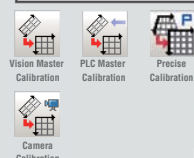
Vision Master Calibration

With Vision Master Calibration, the FH-series Vision System automatically calculates the movement patterns for sampling points to optimize the stage/robot axis travel ranges, imaging processing field of view, and other factors, and the required axis movements are sent to the PLC. By moving the system accordingly, optimum sampling is achieved and the coordinate systems for image processing and the stage/robot are accurately aligned. Correction coefficients are simultaneously calculated for Camera tilt and lens distortion. If you use the calibration conversion parameters that are made with this function, you can easily achieve high-precision positioning even for normal lenses with high distortion rates.

Measurement request

Movement request
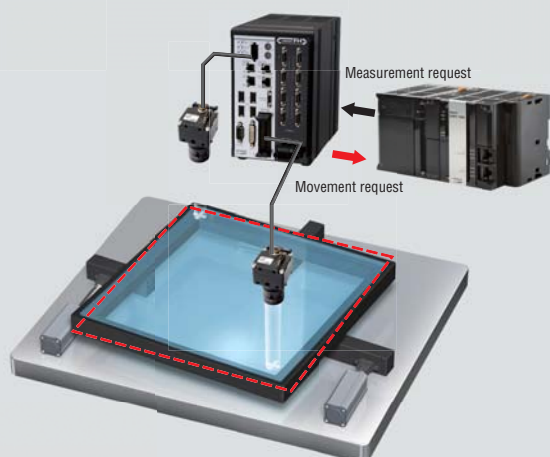
Precise Rotational Position Estimation

Previous Methods	FH Series
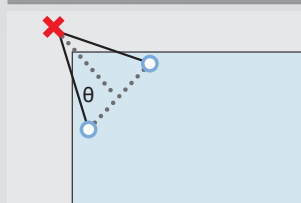
The sampling points are picked at random, so the rotational range is not sufficient.
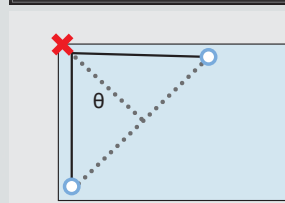
The FH-series Vision System automatically extracts sampling points in the field of view to ensure a large rotational angle in the θ direction on the stage and sends movement requests to the PLC. Parallel movement and rotational movement are combined to achieve the optimum calculations from information on many rotational sampling points.

Automatically Calculated Calibration Data

Both affine transformation parameters and distortion correction parameters are calculated at the same time.

Affine Transformation

Camera and stage magnification

Stage axis perpendicularity

Camera and stage rotation

Distortion Correction

Distortion Correction

Lens distortion correction

Inspection and Measurement Process Library

FH FZ5

Search

A complete array of search tools are provided to meet an array of requirements.
Minute difference detection is supported without false detection.

Shape Search III   Flexible Search   Search

Sensitive Search   Shape Search II
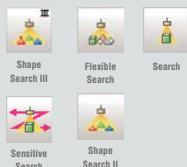
Sensitive Search

This allows the recognition of very subtle differences that cannot be detected through ordinary search processes, by dividing the registered model image into several regions and carefully matching them. Delicate threshold setting is not required saving time in the registration process.
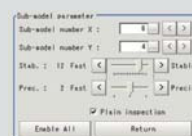
Different conditions for dividing the model image can be set.

Flexible Search

When inspecting workpieces with some variations in shape, these characteristics are sometimes recognized erroneously as defects. Flexible Search ensures accurate searches regardless of some variations in print quality or shape, by registering several images of non-defective products as models. It helps you decrease your inspection failure rate by rejecting defective products only.

Inspection of characters on IC chips

Before multiple model registration

OK   NG   NG   NG

Register non-defective product as additional model

After multiple model registration

OK   OK   OK   NG

Avoiding inspection failures
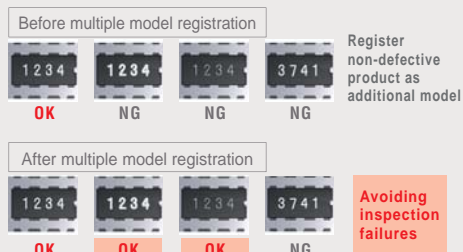
EC
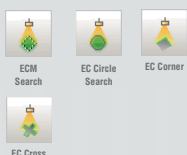
These processing items use EC (edge codes) for superior performance even under poor conditions.

ECM Search   EC Circle Search   EC Corner

EC Cross

EC Cross, EC Circle Search

The alignment marks commonly used in manufacturing of LCD panels and PCBs can be precisely detected. Accurate detection is possible even if the marks are dirty or partially hidden. The output coordinates give the center of the cross or circle. There is no need to set the output coordinates, so inconsistent precision caused by worker differences is eliminated.

EC Cross   EC Circle Search
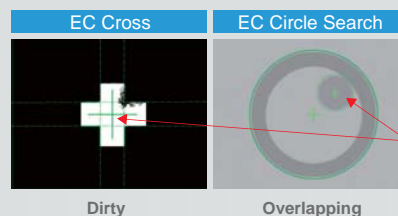
The center coordinates of the marks are output.

Dirty   Overlapping

EC Corner

Two straight lines are detected to output the point of intersection between them as the corner. Stable detection is possible even for rounded corners or when the edge is broken. This is ideal for glass plates, LCDs and other objects on which alignment marks cannot be printed.
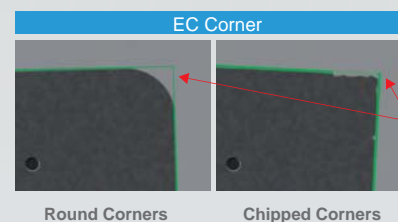
EC Corner

The intersection of two lines is output as the corner.

Round Corners   Chipped Corners

Edges

These processing items let you measure positions, widths, and the number of edges from edge extraction.

Edge Position   Edge Pitch   Circular Scan Edge Position

Circular Scan Edge Width   Intersection   Scan Edge Position

Scan Edge Width

Circular Scan Edge Position

You can measure the center coordinates, diameter, and radius of a round workpiece without performing any calculations simply by drawing one measurement region.

Center coordinates   Radius
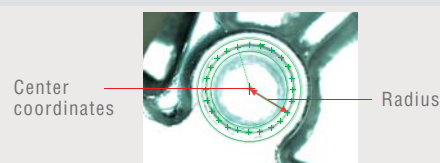
Circular Scan Edge Width

You can measure the center coordinates, width, and thickness of a ring-shaped workpiece without requiring additional calculation.

Width and thickness   Center coordinates
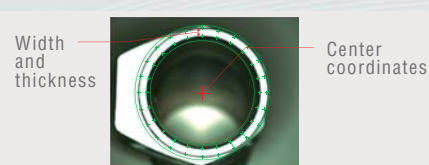
Areas

These processing items let you measure sizes, center of gravity positions, and the number of objects.

Gravity and Area   Labeling
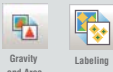
Defects

These processing items are ideal for external appearance inspections for damage, foreign matter, etc.

Defect   Precise Defect   Fine Matching

Inspections of Scratches and Dirt

Subtle scratches and dirt can be detected with more fine-tuned conditions compared to conventional inspections. Since you can clearly distinguish defects to be detected from the background, the failure detection rate can be decreased. Profiles of defects and comparison elements can be displayed on the screen in real time. You can adjust by confirming the settings and detection results on the image. Fine parameters for defect detection allow fine settings at the pixel level.

Fine Matching / Defect

With our Real Color Sensing technology, FH-series Vision System can accurately recognize and process subtle variations in color. This feature helps you detect unpredictable scratches and dirt. High precision defect inspections are possible by using both Fine Matching and Defect flexibly according to the background of each image.
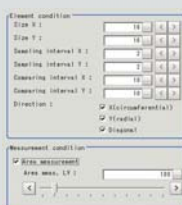
Scratch detection profile displayed on the screen [Patent Pending]
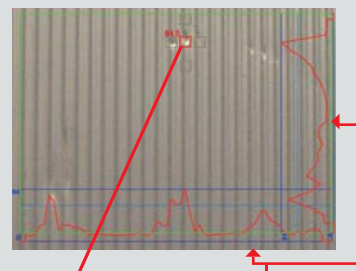
Comparison element display
Intervals and sizes of comparing elements are displayed.

Profile display
Defects of each direction for detection are displayed as wave profiles.

Fine Matching
It is useful for detecting scratches, chipped edges or subtle dirt in complex backgrounds.
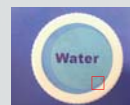
Defect
It is useful for detecting scratches and dirt in plain backgrounds.

Water

Character Inspections/OCR

These processing items provide the functions that are required for character inspections of dates, lot numbers, etc.

Character Inspection   Date Verification

Codes

These processing items can read bar codes and 2D codes from Camera images.

Printing quality evaluation based on ISO standards is supported.
Applicable standards: ISO/IEC 15415 (The data matrix standard in ECC 200 is supported) and ISO/IEC 15416
You can output judgements of the code quality according the the printing quality standards that are defined in the standard.

Barcode   2D Code

Special Processing

Custom functions are also provided in these convenient processing items.

Classification   Color Data   Circle Angle

Glue Bead Inspection
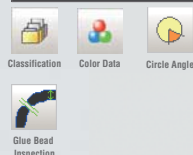
Automatic Extraction of Complex Measurement Region Shapes

Measurement regions are no longer restricted to combinations of rectangles and circles. You can freely set the shape according to the outline of the workpiece. It's easy to set the measurement regions. Just specify one portion of the region to extract, and a continuous region with a similar color is extracted automatically. You can set precise regions for measurements even for scratch inspections or labeling on workpieces with complex shapes. This method to set measurement regions can be used for Gravity and Area, Color Data, Labeling, Defect, and Precise Defect processing items.

Specify part of the area to extract as the measurement region.

The region with a similar color to the specified area is extracted automatically.
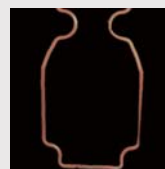
Image Filter Library

Compensate Images

Color Gray Filter

Anti Color Shading

Extract Color Filter

Backgrond Suppression

Filtering

Stripe Removal Filter II

Brightness Correct Filter

Position Compensation

Polar Transformation

Trapezoidal Correction+

Panorama

Advanced Filter

Calculations between Images

You can perform arithmetic operations, bit operations, averaging, or maximum/minimum operations between two images.
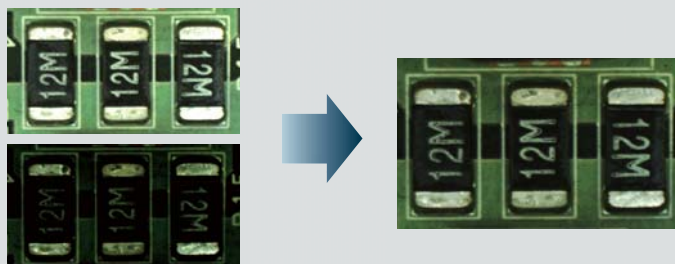
Example: You can get the average of two images that were taken under different imaging conditions.

Labeling Filter

This filter uses label processing to output an extracted image that contains only the specified characteristic labels.

External Appearance of Electronic Components

Previous Vision Sensors	Labeling Filter Image
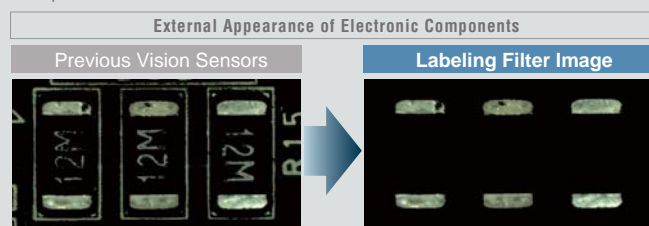
Extraction is possible only with color or brightness information.

Extraction of labels with specified areas or shapes is possible.

Custom Filter

You can set the mask coefficients as required for these filters. The mask size can be up to 21 × 21. You can more flexibly set image smoothing, edge extractions, dilation, and erosion.

Example:
Dilation/Erosion in One Direction

Filter Coefficients
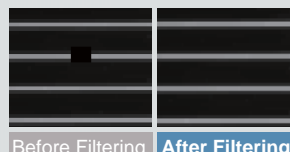
Before Filtering	After Filtering
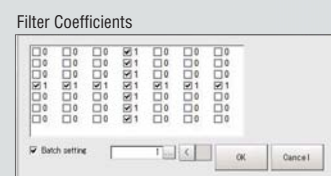
You can set the filter coefficients as required.

Brightness Correct Filter

These filter cut out uneven lighting and changes in brightness caused by workpiece surface irregularities to make characteristic features stand out clearly.

External Appearance of Battery Pack

Before Filtering	Image after Brightness Correct Filter

Reflection
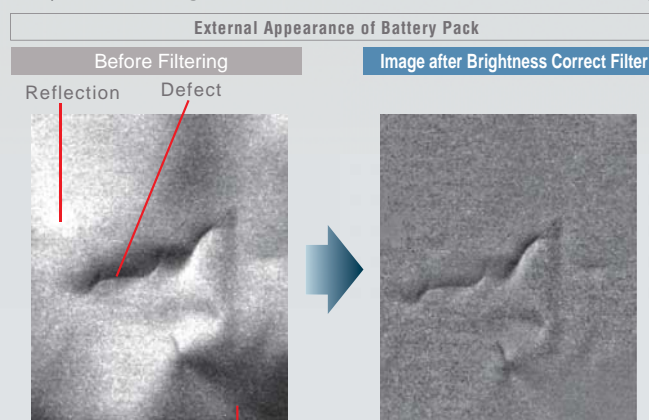
Defect

Shadow

The wavy inconsistencies are judged as defects.

Uneven areas are removed so that only the defect appears in the inspection.

Stripe Removal Filter II

The stripped pattern is filtered out so that only required aspects are shown clearly. Vertical, horizontal, and diagonal stripes can be removed.

External Appearance of Bottle Cap

Unfiltered Image	Image after Stripe Removal Filter
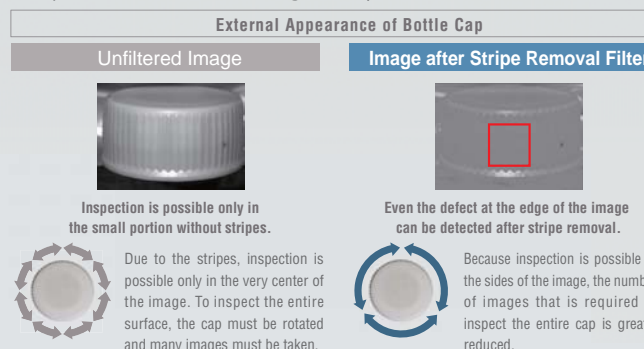
Inspection is possible only in the small portion without stripes.

Due to the stripes, inspection is possible only in the very center of the image. To inspect the entire surface, the cap must be rotated and many images must be taken.

Even the defect at the edge of the image can be detected after stripe removal.

Because inspection is possible to the sides of the image, the number of images that is required to inspect the entire cap is greatly reduced.

Advanced Filter

The image filter library has been condensed into one processing item. This allows you to easily set complex filtering as required for external inspections.

Filter setting list
No.	Name
0	Weak smoothing
1	Strong smoothing
2	Dilate
3	Erosion
4	Median
5	Extract horizontal edges
6	Enhance edges
7	Background Suppression
8	Brightness Correct Filter
9	Stripes Removal Filter II
10	Labeling Filter
11	Custom Linear Filter
12	Custom Rank Filter
13	Image operation
14	2 images operation
15	Anti-Color Shading
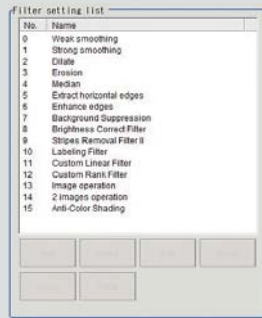
You set up to 16 of the 24 different filters.

Previous Vision Sensors

1. Background Suppression
2. Filtering
3. Filtering
4. Filtering
5. Filtering
6. Color Gray Filter
7. Stripes Removal Filter II

Units were added for each filter.

Advanced Filter

1. Advanced filter
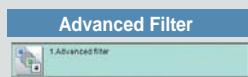
Many different filter functions can be set with just one processing unit.

The average image is obtained from multiple images.

Application Flow Example

Camera Image Input
↓
Precise Defect
↓
Camera Image Input
↓
Precise Defect
↓
Advanced Filter
◄ Calculation between Images: Averaging
↓
Precise Defect

Camera Image Input
↓
Advanced Filter
  Labeling Filter
  Erosion × 2
↓
Precise Defect

Measurement image
Mask Image

The filtered image is used as the mask.
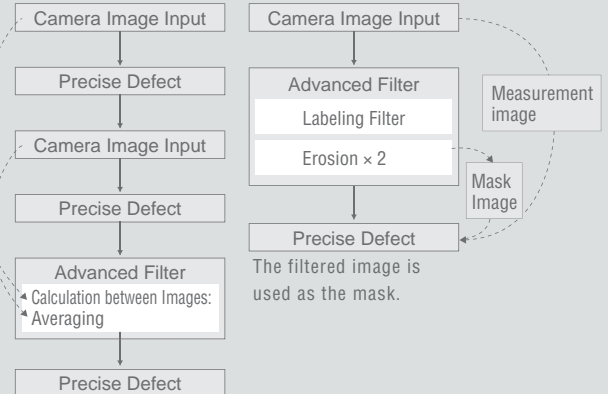
High Dynamic Range to Easily Combine Images

HDR

To simply combine images, you must set the imaging conditions and create the images that you want to obtain. With OMRON's high dynamic range function, all you need to do is to set the upper and lower brightness images on a graph of the image brightness distribution to make the adjustments.

Dynamic range after HDR processing

Industry's highest dynamic range

Max. 5000 times higher than previous models
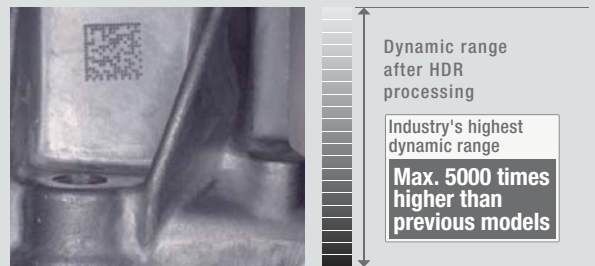
What is Real Color Sensing?

Real Color

Patented

In order to secure stable measurements in different inspection environments, FH Series feature Omron's proprietary Real Color Sensing processing, in addition to the conventional color image processing.

Edges are detected reliably even when the contrast between the background and subject is low.

Color Segmentation Processing

Black   White   Black

Color images taken by the camera are processed after being converted into black and white pixels. The color extracted is represented as white, and the other colors as black. Based on minimum information, high speed processing is possible. Since color data is limited only to brightness, however, it takes a long time to make optical adjustments for extracting color features.

Color Image Processing

Dark   Bright   Dark

Color images are converted into 256 levels of black-and-white brightness and the contrasts of specific colors is enhanced. More precise, stable results can be produced compared to color segmentation. However, this method has difficulty in capturing subtle variations in color because all colors are converted into black-and-white brightness levels. Therefore, it is difficult to detect subtle changes in images with low contrast.

Real Color Sensing

1677 It allows the recognition of 16,770,000 colors.
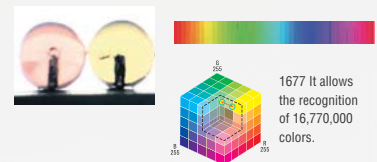
Different colors are represented as different positions in the 3D RGB space. Subtle variations in color can be recognized by representing them as distances between different color pixels comprising this space. Thus, scratches and dir t can be detected accurately even in images with low contrast.

Previous image processing

OMRON FH series

Utility Library

**Macro/
Macro Calculaction**

Macro

Macro Calculation

Macro

Macros let you easily achieve flow control that normally requires complex programming from the user interface.
Improvements to the setup from the user interface provides ease of selection and modification of the programming process.

① Select the process to use

③ Insert the process

② Set the parameters

Registered images

Reference Variable List

Function Guidance

Variables can be used in macros to access processing item data and system data.

For example, it would previously have been long and complicated to change the set parameters of a processing item for each product model. With a Macro Calculation processing item, the flow is shorter and setting changes are easy to achieve.

Previous Vision Sensors

FH/FZ5-series Macros

Easy to change

1.Macro Calculation

2.Labeling

Just enter the values of the variables to update the parameters.

```
' Branching for each product model
Select INDEX@
Case 0
  ExtCond0@ = 1      ' Area
  ExtParam0@ = 0
  ExtParam1@ = 10000
Case 1
  ExtCond0@ = 4      ' Elliptic major axis
  ExtParam0@ = 0
  ExtParam1@ = 100
Case 2
  ExtCond0@ = 7      ' Rectangle width
  ExtParam0@ = 0
  ExtParam1@ = 200
End Select
```

Macro Calculaction

You can create expressions that require multiple lines in one processing item.
In addition to making calculations, you can also make judgements based on the calculation results of the processing items.

Example 1: Multiline Expression

```
DET# = A0@ * B1@ - A1@ * B0@              ' Calculates intersection
CX# = (B0@ * C1@ - B1@ * C0@) / DET#      ' X coordinate of intersection
CY# = (A1@ * C0@ - A0@ * C1@) / DET#      ' Y coordinate of intersection
```

Example 2: Calculations to Drive Branching or Loops

```
Max# = 0
For i& = 0 To 10
  If (Max # < value#(I&)) Then
    Max# = value#(I&)
  EndIf
Next
RESULTDATA#(0) = Max#
```

Judgement condition for calculation results

User Data

Ideal for Managing Inspection Standards and for Statistical Analysis of Inspection Results

Shared data used within scene groups as constants and variables in the measurement flow can be set as user data. With the shared data, you can use the measurement flow in many new ways, including standard values, conditional branching flags, and counters.

Application Example 1 — Unified Management of Judgment Values

When setting up complex scene data, such as the data required for inspection of many different models, you can unify management of important judgment values for inspections to easily manage and then adjust them later. Also, if you isolate in advance the settings that are critical to inspection performance (and normally known only to the designer) as user data, the locations that require adjustment can be clarified so that the user can more easily make adjustments.

Adjustment of All User Data in a List

No.	Data	Comment
0	60.0000	Mark 1-A Seach Judgement
1	60.0000	Mark 1-B Seach Judgement
2	80.0000	Mark 2-A Seach Judgement
3	80.0000	Mark 2-B Seach Judgement
4	0.0000	NG Counter
5	0.0000	
6	0.0000	
7	0.0000	
8	0.0000	
9	0.0000	

Application Example 2 — Statistical Information on Productivity Indices

User data can be used as variables that can be read and written in the inspection flow. It can also be used for counters for the number of inspected workpieces or the number of NG workpieces. Math functions can be use to calculate failure rates and display them onscreen so that productivity can be checked at any time.

Indices Displayed Onscreen with the Result Display Function

Inspection 19480510 pcs
Failure 10 pcs
Percent Defective 0.51 %

Application Method

All you have to do is set a User Data processing item in the inspection flow.
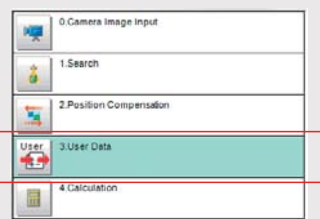
The data that is set as user data is used as shared constants and variables in different scenes.
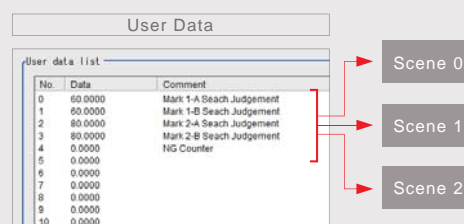
Trend Monitor

Results Analysis with Trend Monitors

You can graph trends in measurement values to output warnings before failures occur. This helps provide feedback to earlier processes to prevent NGs in advance and to analyze the causes of NGs.

Prevent High Defect Rates in Advance

Judgement upper limit
Warning range (upper limit)
Warning range (lower limit)
Judgement lower limit
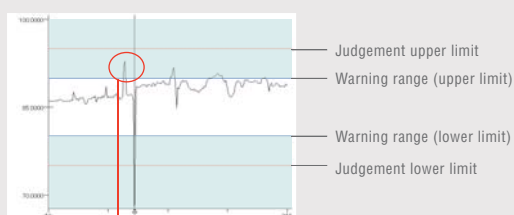
You can set the warning range to output warnings before NGs become frequent to provide feedback to earlier processes.

Cause Analysis when Defects Occur

Time
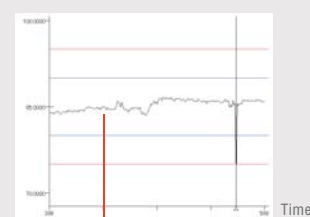
The 100,000 most recent measurement values are stored.

Operation and Analysis

Optimum Operation both Online and Offline

Connections to a network hard disk drive or network computer enables a wide range of operation possibilities.

You can log measurement images longterm, or you can perform verifications and adjustments on a computer without stopping the FH-series Vision System.

Online	Onsite Operator

Network HDD   FH

Log images via Ethernet

HUB

Remote Operation

Check NG images on a computer at any time

PC

Offline	Designer

Offline Setting Changes and Simulation

PC   Simulation Software

Ask your OMRON representative about obtaining simulation software.
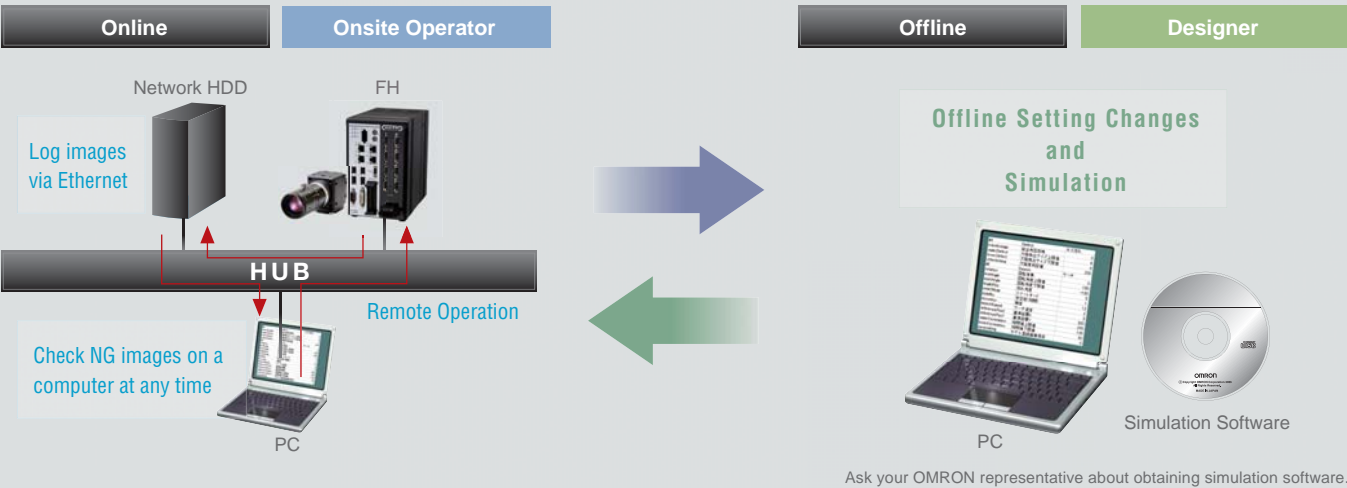
New Operation Schemes through Network Applications

1 | Daily Monitoring

You can store NG image in a network HDD to check the NG images every day on a computer without reducing measurement performance. Or you can start simulation software on your computer to remeasure and analyze NG images.

2 | Periodic Adjustments and Inspection Adjustments

The non-stop adjustment function lets you change Controller settings without stopping the production line. With remote operation, you can perform operations without going onsite.

3 | Handling Unstable Inspections or Measurement Failure

The user sends the programmer the image data, setting data, and parameter settings. The programmer can use the simulation software on the computer to check the process and change the settings with the simulation software. The altered scene data can be returned to the user and loaded to the system to complete the adjustments. This enables modifications without requiring the programmer to be on site.

4 | Adding Inspections or Making Changes for New Models

Based on the images to be inspected, settings are made on the simulation software on a PC running simulation software. The scene data is sent to the user to easily add the new settings.

Ideal for History Management

CSV files allow you to easily understand the parameter settings. Also, you can easily change any of the settings.

1 | Comparisons

If you save the basic settings, you can easily extract any differences in settings caused by changes made incorrectly.

Standard settings	Current parameter settings

2 | Remote Adjustment

You can attach CSV files to email and upload settings to the FH-series Vision System to easily make adjustments from remote locations when problems occur.

Upload

Setting changes

Remote Operation Centralizes Monitoring and Adjustment of multiple controllers

You can check the status and adjust the settings of multiple units on one computer.

This enables efficient adjustment of Camera images when commissioning a system and application of test adjustment results.
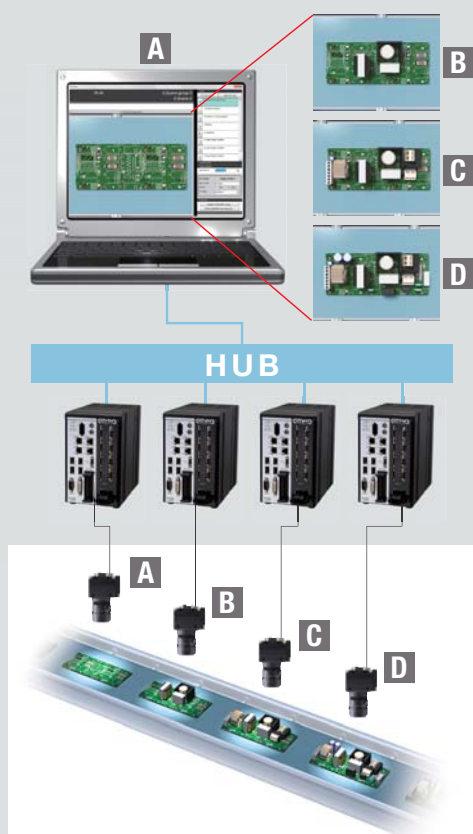
Application Example 1 | Operating Several FH from One Location

1 When commissioning an installation from one location you can adjust the camera for all the controllers located along the line. There's no need to go to and from each Controllers, and you can compare Camera images under various conditions to adjust them.

2 If setting changes are necessary to add a new model, you can do all the required work at the same time without making trips to all of the Controllers.

3 You can easily balance the thresholds between Controllers when increasing inspection stability through testing at the production line.

Application Example 2 | Display images from multiple controllers

1 Space savings with a single monitor installation.

2 Single location programming for multiple controllers facilitates adjustments and reduces programmer movement.

Note: Ask your OMRON representative about obtaining simulation software for a computer.

Saving and Using Measurement Images

Save Images Directly in JPEG or BMP Format

You can easily view images on a computer or attach them to reports. With BMP files, you can measure them again on the Vision controller.

Restricting the Areas of Saved Images

By restricting the areas that are saved, file sizes are smaller so you can continue to log even more files.

Save Both Filtered and Unfiltered Images

You can save both the filtered images that were actually measured and the raw images taken directly from the Camera. You can therefore tell if an NG was caused by the input image or by the filter settings.

Filtered Images	Unfiltered Images
2008.04.24	2008.04.24

FH

Utilities That Don't Stop Your Machines

Making Confirmations and Adjustments without Stopping Production   Non-stop adjustment

Parallel processing on Four-core CPU not only speeds up measurements, but it enables parallel processing of measurements and adjustments. Automatic distributed processing means that measurements are not delayed when adjustments are applied.

Measurements continue

core **1**

Measure-ments

NG occurs

core **2**

Adjust-ments

NG analyzed → Settings changed → Tests performed

Adjustment results applied.

New settings used for measurements from the next trigger.

Automatic linking of the Four-core CPU enables applying new settings without delaying measurements.
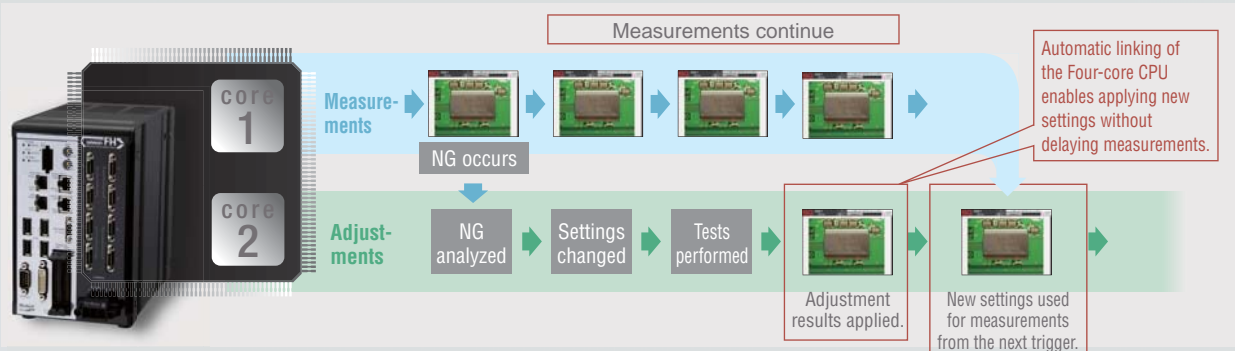
Doubly effective when combined with the Non-stop adjustment mode NG analyzer

You can display in a structured manner a graph showing the results measured at once on logging images. This lets you identify the cause of a given NG much more quickly. You can also measure all images again after changing a given setting, to check the reliability of the new setting. Adjustment and troubleshooting has never been so quick, simple and reliable.

Processed items and parameters that generated an erroneous judgment can be identified at a glance.

You can check the detailed results of parameters to identify the cause of the NG.
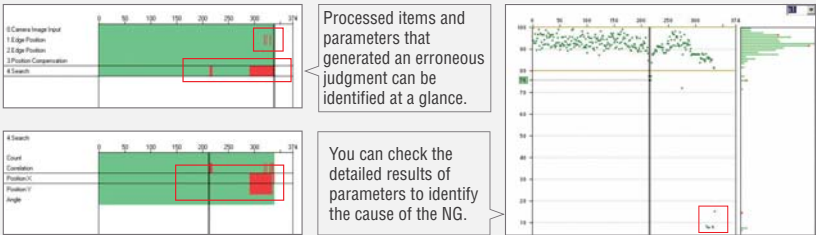
Save All Images Even during Measurements   High speed logging

The Four-core CPU can also perform parallel processing of measurements and image logging, with high-speed connection to a high-capacity hard disk (2terabytes). Trend analysis of saved images, quickly isolates NG's and facilitates countermeasures.
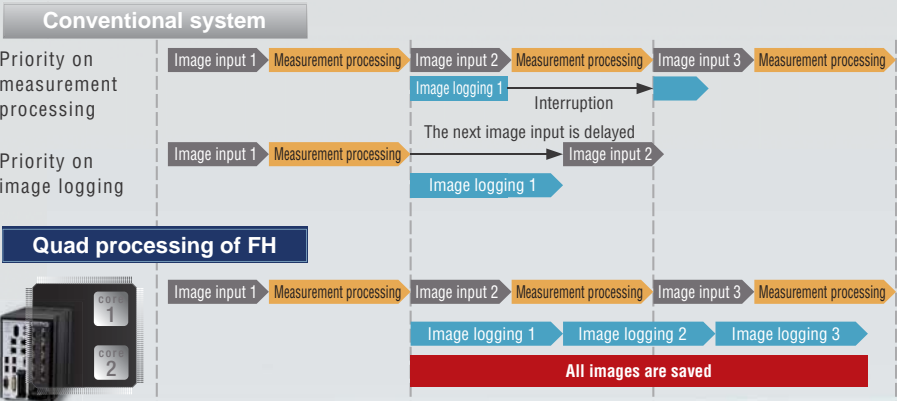
*1 All images can be saved under the following conditions:
• 300,000-pixel camera x 1 unit . Measurement time: 33 ms
• Images can be saved continuously for approx. one week when a 2-terabyte HDD is used (based on 8 hours of operation a day).

Conventional system

Priority on measurement processing

Image input 1 → Measurement processing → Image input 2 → Measurement processing → Image input 3 → Measurement processing
Image logging 1
Interruption

Priority on image logging

Image input 1 → Measurement processing
The next image input is delayed → Image input 2
Image logging 1

Quad processing of FH

core **1**
core **2**

Image input 1 → Measurement processing → Image input 2 → Measurement processing → Image input 3 → Measurement processing
Image logging 1 → Image logging 2 → Image logging 3
All images are saved

Issues

Since logging was not possible during measurement, the user had to choose either measurement or logging. Accordingly, not all images could be saved or image input triggers had to be delayed depending on the measurement trigger intervals.

Resolution

Measurement and image logging are processed completely in parallel. As a result, you can save all images.

Seamless Communications with Peripheral Devices

Complete Interfaces for All Connected Devices   FH

PLC

PLC Link
(OMRON, Mitsubishi Electric: Q Series,
Yaskawa Electric: MP Series)

EtherNet/IP

SD Card   SD

Camera

PC

EtherNet

USB
(4port)

EtherCAT

Machine Automation Controller
NJ-Series

RS-232C
• no-protocol
• PLC Link
(OMRON, Mitsubishi Electric: Q Series)

Encoder input
 (with line driver output,
support for up to two channels)

Parallel I/O

DVI-I monitor output
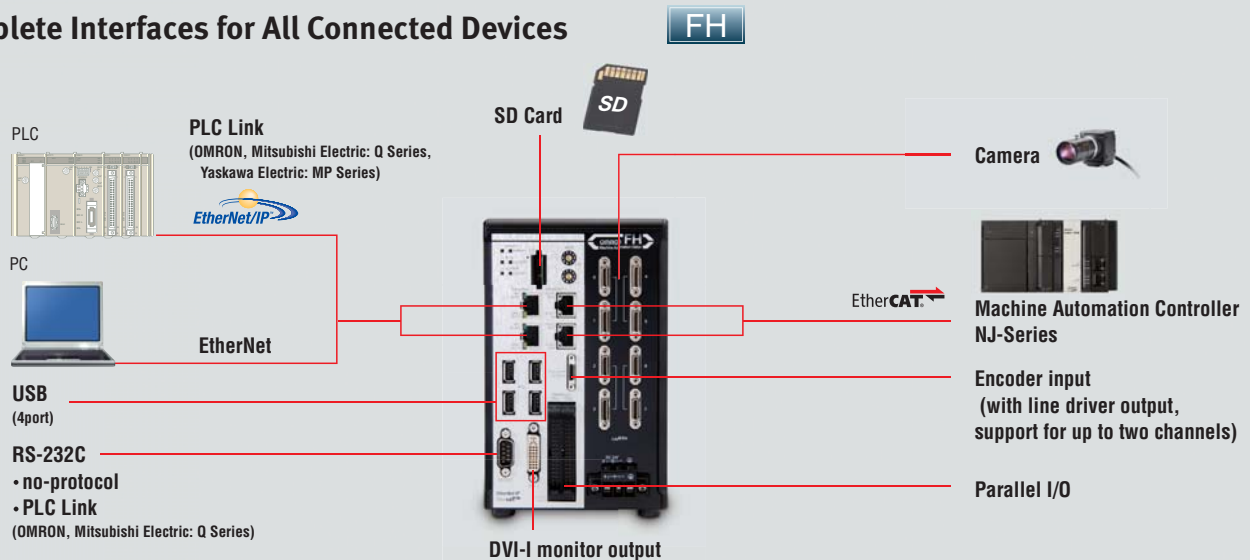
Controlling Flow Branching Conditions from an External Device   FH FZ5

You can control branching by using commands and signal inputs from external devices as branching conditions for the measurement flow.

• Control Flow Normal
• Control Flow PLC Link
• Control Flow Parallel
• Control Flow Fieldbus

Camera Image Input

Shape Search III

Control Flow Normal

Edge Position

Parallel Judgement Output

End

Bar Code

Data Output

End
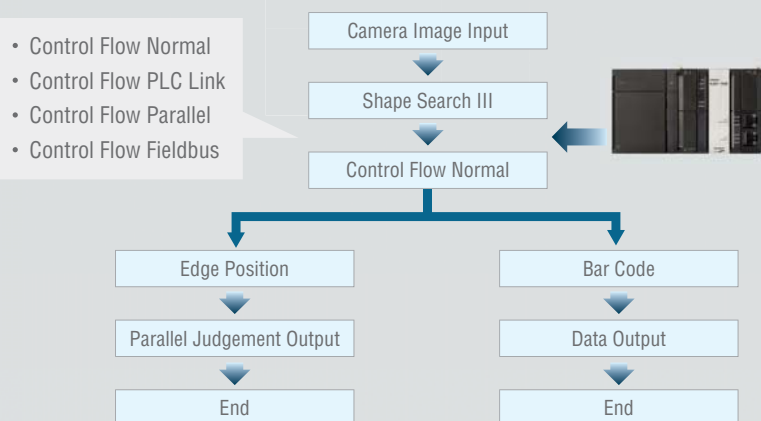
Customized   FH FZ5
Communications Commands

You can shorten the communications time by using commands for complex controls or by shortening multiple commands. You can also define how the Vision System responds to the communications commands. For example, you can define one command to change both a scene and perform measurements.

You can define up to 256 commands

Combining command processing

① Select the command

③ Insert the command

② Set the parameters

Command Guidance
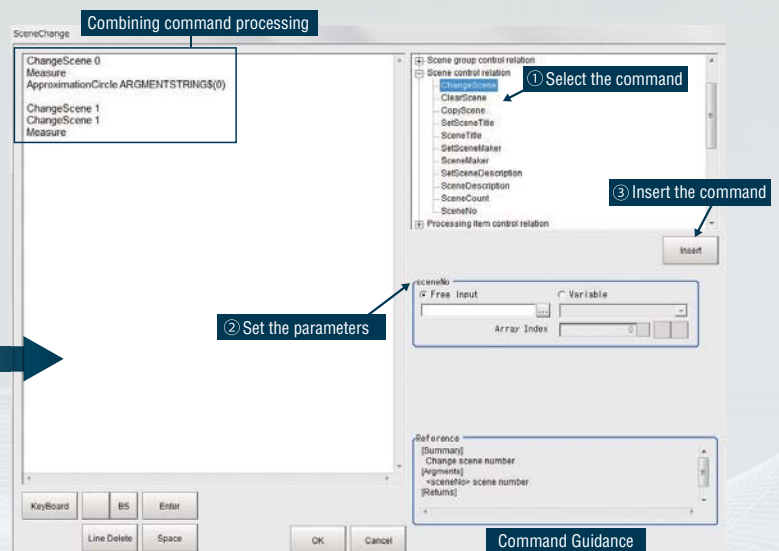
Options for More Power Customization

Application Producer provides a Development Environment to Build and Simulate Applications

You can further customize the standard controller features of the FH-series Vision System. In Application Producer custom control units allow development of original interfaces with Microsoft® Visual Studio®. The software command reference helps create original processing items, and more.

Application Producer Main Window
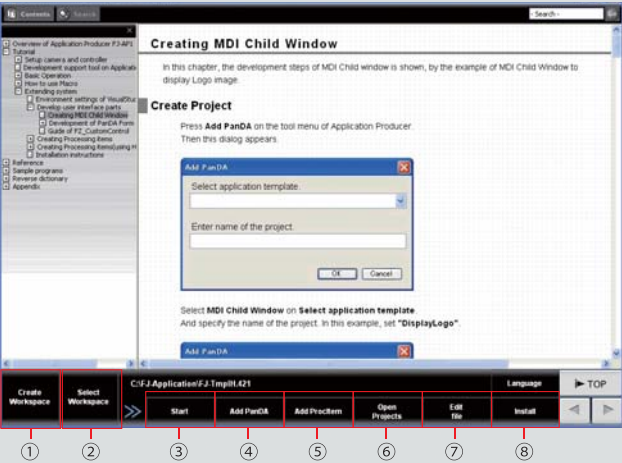
①Create workspaces.

②Select and change between workspaces.

③Start the program in the selected workspace.

④Create and add GUI objects.

⑤Create and add processing items.

⑥Open Microsoft® Visual Studio® projects.

⑦Open setup files.

⑧Create installation files.

Customization Example: GUI Customization

Select the GUI object template
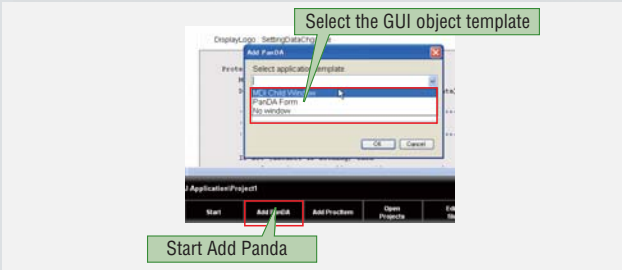
Start Add Panda

Start Add Panda and select the template that will serve as a base for customization.
Selecting an interface template as a base first greatly reduces the work that is required compared with programming interfaces from scratch.

Paste the custom controls
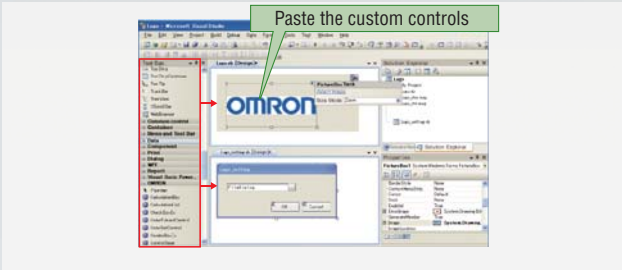
The Application Producer will automatically generate a project file from the selected template so that you can open it in Microsoft® Visual Studio.®
You can develop interfaces just by dragging FH-series custom controls and Windows-based controls.
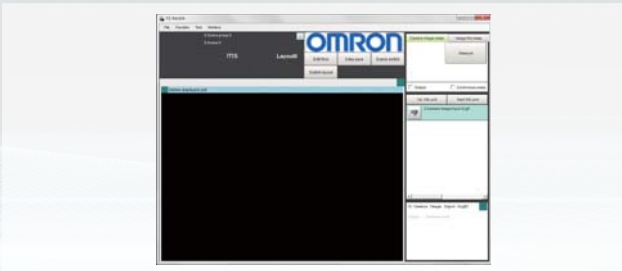
Instead of writing the program code from scratch to build an interface, you can easily build the interface simply by pasting custom controls.
You can immediately check and debug the operation of the GUI objects that you add.

MEMO

Vision System
FH-Series

Easier to Embed in Machine, Shorter Machine Cycle Times

- Calculations are easy to set for the results from four parallel tasks.
- Synchronous control of devices connected via EtherCAT is possible.
- The new Shape Search III processing item enables fast, precise, and stable measurements.
- Microsoft® .NET is supported to share machine interface with PC.
- User interface customization is supported.

System configuration

EtherCAT connections for FH series

Example of the FH Sensor Controllers (4-camera type)
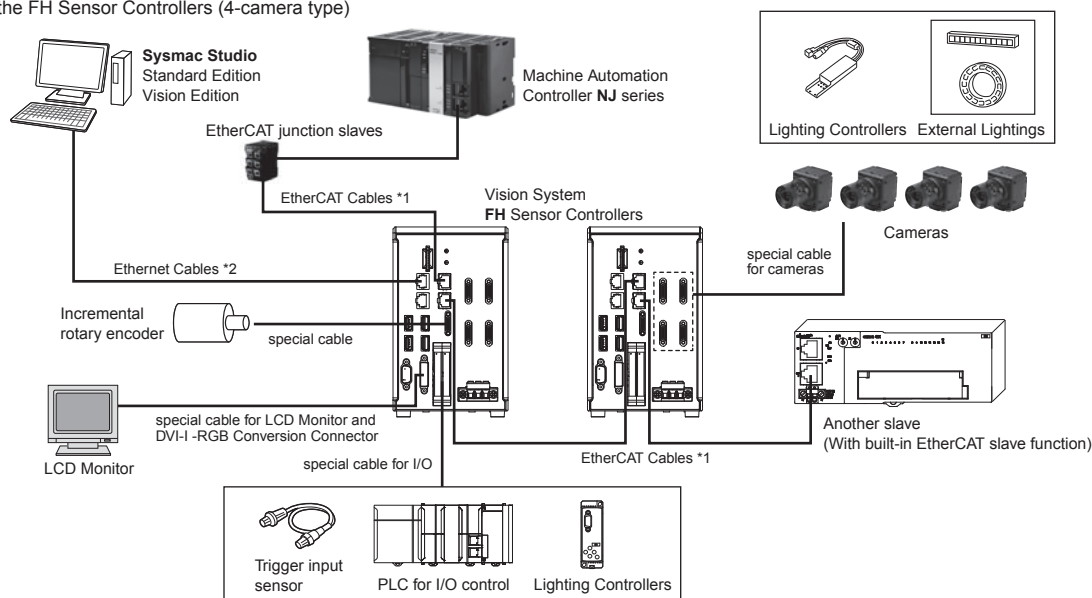
*1. To use STP (shielded twisted-pair) cable of category 5 or higher with double shielding (braiding and aluminum foil tape) for EtherCAT and RJ45 connector.
*2. To use STP (shielded twisted-pair) cable of category 5 or higher for Ethernet and RJ45 connector.

EtherNet/IP, No-protocol Ethernet and PLC Link Connections for FZ5 series

Example of the FZ5 Sensor Controllers (4-camera type)
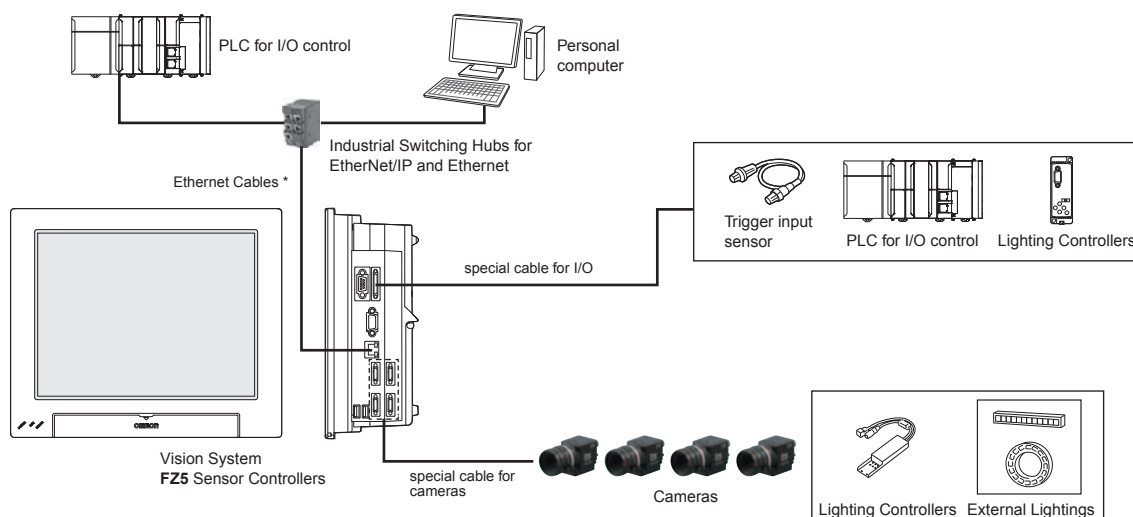
* To use Straight or cross STP (shielded twisted-pair) cable of category 5 or higher for Ethernet and RJ45 connector.

OMRON

Ordering Information

FH Series Sensor Controllers

Item		CPU	No. of cameras	Output	Model
Box-type controllers		High-speed Controllers (4 core)	2	NPN/PNP	**FH-3050**
			4	NPN/PNP	**FH-3050-10**
			8	NPN/PNP	**FH-3050-20**
		Standard Controllers (2 core)	2	NPN/PNP	**FH-1050**
			4	NPN/PNP	**FH-1050-10**
			8	NPN/PNP	**FH-1050-20**

FZ5 Series Sensor Controllers

Item		CPU	No. of cameras	Output	Model
Controllers integrated with LCD		High-speed Controllers	2	NPN	**FZ5-1100**
				PNP	**FZ5-1105**
			4	NPN	**FZ5-1100-10**
				PNP	**FZ5-1105-10**
		Standard Controllers	2	NPN	**FZ5-600**
				PNP	**FZ5-605**
			4	NPN	**FZ5-600-10**
				PNP	**FZ5-605-10**
Box-type controllers		Lite Controllers	2	NPN	**FZ5-L350**
				PNP	**FZ5-L355**
			4	NPN	**FZ5-L350-10**
				PNP	**FZ5-L355-10**
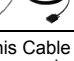
Cameras

Item		Descriptions	Color / Monochrome	Image read time	Model
High-speed CMOS Cameras (Lens required) For **FH Series only**		4 million pixels	Color	8.5 ms	**FH-SC04**
			Monochrome		**FH-SM04**
		2 million pixels	Color	4.6 ms	**FH-SC02**
			Monochrome		**FH-SM02**
		300,000 pixels	Color	3.3 ms	**FH-SC**
			Monochrome		**FH-SM**
Digital CCD Cameras (Lens required)		5 million pixels (When connecting FZ5-6□ or FZ5-L35□, up to two cameras can be connected.)	Color	62.5 ms	**FZ-SC5M2**
			Monochrome		**FZ-S5M2**
		2 million pixels	Color	33.3 ms	**FZ-SC2M**
			Monochrome		**FZ-S2M**
		300,000 pixels	Color	12.5 ms	**FZ-SC**
			Monochrome		**FZ-S**
High-speed CCD Cameras (Lens required)		300,000 pixels	Color	4.9 ms	**FZ-SHC**
			Monochrome		**FZ-SH**
Small Digital CCD Cameras (Lenses for small camera required)		300,000-pixel flat type	Color	12.5 ms	**FZ-SFC**
			Monochrome		**FZ-SF**
		300,000-pixel pen type	Color	12.5 ms	**FZ-SPC**
			Monochrome		**FZ-SP**
Intelligent Compact CMOS Cameras (Camera + Manual Focus Lens + High power Lighting)		Narrow view	Color	16.7 ms	**FZ-SQ010F**
		Standard view	Color		**FZ-SQ050F**
		Wide View (long-distance)	Color		**FZ-SQ100F**
		Wide View (short-distance)	Color		**FZ-SQ100N**
Intelligent CCD Cameras (Camera + Zoom, Autofocus Lens + Intelligent Lighting)		Wide View	Color	12.5 ms	**FZ-SLC100**
		Narrow view	Color		**FZ-SLC15**
Autofocus CCD Cameras (Camera + Zoom, Autofocus Lens)		Wide View	Color	12.5 ms	**FZ-SZC100**
		Narrow view	Color		**FZ-SZC15**

Cameras Peripheral Devices

Item	Descriptions			Model
—	External Lighting	—		**FL Series**
	Lighting Controller (Required to control external lighting from a Controller)	For FL-Series	Lighting Controller	**FL-TCC1**
	Intelligent Camera Diffusion Plate		Wide field of vision	**FZ-SLC100-DL**
			Narrow field of vision	**FZ-SLC15-DL**
	For Intelligent Compact Camera		Mounting Bracket	**FQ-XL**
			Mounting Brackets	**FQ-XL2**
			Polarizing Filter Attachment	**FQ-XF1**
—	Mounting Bracket for FZ-S☐			**FZ-S-XLC**
	Mounting Bracket for FZ-S☐2M			**FZ-S2M-XLC**
	Mounting Bracket for FZ-S5M☐2			**FZ-S5M-XLC**
	Mounting Bracket for FZ-SH☐			**FZ-SH-XLC**

Cables

Item	Descriptions	Model
	Camera Cable Cable length: 2 m, 5 m, or 10 m *2	**FZ-VS**
	Bend resistant Camera Cable Cable length: 2 m, 5 m, or 10 m *2	**FZ-VSB**
	Right-angle Camera Cable *1 Cable length: 2 m, 5 m, or 10 m *2	**FZ-VSL**
	Long-distance Camera Cable Cable length: 15 m *2	**FZ-VS2**
	Long-distance Right-angle Camera Cable Cable length: 15 m *2	**FZ-VSL2**
	Cable Extension Unit Up to two Extension Units and three Cables can be connected. (Maximum cable length: 45 m *2)	**FZ-VSJ**
	Monitor Cable Cable length: 2 m or 5 m (When you connect a LCD Monitor FZ-M08 to FH sensor controller, please use it in combination with a DVI-I -RGB Conversion Connector FH-VMRGB.)	**FZ-VM**
	DVI-I -RGB Conversion Connector For **FH Series only**	**FH-VMRGB**
	Parallel I/O Cable Cable length: 2 m or 5 m, For **FZ Series only**	**FZ-VP**
	Parallel I/O Cable for Connector-terminal Conversion Unit Cable length: 2 m or 5 m, For **FZ Series only** Connector-Terminal Block Conversion Units can be connected (Terminal Blocks Recommended Products: OMRON XW2R-J50G-T, XW2R-E50G-T, XW2R-P50G-T)	**FZ-VPX**
	Parallel I/O Cable *3 Cable length: 2 m or 5 m, For **FH Series only**	**XW2Z-S013-2/-S013-5**
	Encoder Cable for line-driver Cable length: 1.5 m, For **FH Series only**	**FH-VR**

*1 This Cable has an L-shaped connector on the Camera end.
*2 The maximum cable length depends on the Camera being connected, and the model and length of the Cable being used. For further information,please refer to the "Cameras / Cables" table.
     When a high-speed CMOS camera FH-S_02/-S_04 is used in the high speed mode of transmission speed, two camera cables are required.
*3 2 Cables are required for all I/O signals.
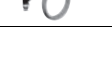
Recommended EtherCAT and EtherNet/IP Communications Cables

Use Straight STP (shielded twisted-pair) cable of category 5 or higher with double shielding (braiding and aluminum foil tape) for EtherCAT.
Use Straight or cross STP (shielded twisted-pair) cable of category 5 or higher for EtherNet/IP.

Item	Descriptions				Model
	For EtherCAT *1	Standard type Cable with Connectors on Both Ends (RJ45/RJ45) Wire Gauge and Number of Pairs: AWG27, 4-pair Cable, Cable Sheath material: LSZH *2, Cable color: Blue, Yellow, or Green, Cables length: 0.2m, 0.3m, 0.5m, 1m, 1.5m, 2m, 3m, 5m, 7.5m, 10m, 15m, 20m			**XS6W-6LSZH8SS□CM-Y** *3
		Rugged type Cable with Connectors on Both Ends (RJ45/RJ45) Wire Gauge and Number of Pairs: AWG22, 2-pair Cable Cables length: 0.3m, 0.5m, 1m, 2m, 3m, 5m, 10m, 15m			**XS5W-T421-□MD-K** *3
		Rugged type Cable with Connectors on Both Ends (M12/RJ45) Wire Gauge and Number of Pairs: AWG22, 2-pair Cable Cables length: 0.3m, 0.5m, 1m, 2m, 3m, 5m, 10m, 15m			**XS5W-T421-□MC-K** *3
		Rugged type Cable with Connectors on Both Ends (M12 L/RJ45) Wire Gauge and Number of Pairs: AWG22, 2-pair Cable Cables length: 0.3m, 0.5m, 1m, 2m, 3m, 5m, 10m, 15m			**XS5W-T422-□MC-K** *3
--	For EtherCAT *1 and EtherNet/IP	Wire Gauge and Number of Pairs: AWG24, 4-pair Cable	Cables	Hitachi Cable, Ltd.	**NETSTAR-C5E SAB 0.5 × 4P** *4
--				Kuramo Electric Co.	**KETH-SB** *4
--				SWCC Showa Cable Systems Co.	**FAE-5004** *4
--			RJ45 Connectors	Panduit Corporation	**MPS588-C** *4
--		Wire Gauge and Number of Pairs: AWG22, 2-pair Cable	Cables	Kuramo Electric Co.	**KETH-PSB-OMR** *5
--				Nihon Electric Wire&Cable Co.,Ltd.	**PNET/B** *5
			RJ45 Assembly Connector	OMRON	**XS6G-T421-1** *5
--	For EtherNet/IP	Wire Gauge and Number of Pairs: 0.5 mm, 4-pair Cable	Cables	Fujikura Ltd.	**F-LINK-E 0.5mm × 4P** *6
--			RJ45 Connectors	Panduit Corporation	**MPS588** *6

Note: Please be careful while cable processing, for EtherCAT, connectors on both ends should be shield connected and for EtherNet/IP, connectors on only one end should be shield connected.

*1 The FH series supports the EtherCAT communication. It cannot be used in FZ series.
*2 The lineup features Low Smoke Zero Halogen cables for in-cabinet use and PUR cables for out-of-cabinet use.
*3 For details, refer to Cat.No.G019.
*4 We recommend you to use above cable for EtherCAT and EtherNet/IP, and RJ45 Connector together.
*5 We recommend you to use above cable for EtherCAT and EtherNet/IP, and RJ45 Assembly Connector together.
*6 We recommend you to use above cable For EtherNet/IP and RJ45 Connectors together.

Peripheral Devices

Item	Descriptions			Model
	LCD Monitor For Box-type Controllers			**FZ-M08**
	USB Memory	2 GB		**FZ-MEM2G**
		8 GB		**FZ-MEM8G**
	SD Card **For FH Controller only**	2 GB		**HMC-SD291**
		4 GB		**HMC-SD491**
	VESA Attachment For installing the LCD integrated-type controller			**FZ-VESA**
	Desktop Controller Stand For installing the LCD integrated-type controller			**FZ-DS**
	Display/USB Switcher			**FZ-DU**
--	Mouse Recommended Products Driverless wired mouse (A mouse that requires the mouse driver to be installed is not supported.)			—
	EtherCAT junction slaves **For FH series**	3 port	Power supply voltage: 20.4 to 28.8 VDC (24 VDC -15 to 20%)	Current consumption: 0.08 A	**GX-JC03**
		6 port		Current consumption: 0.17 A	**GX-JC06**
	Industrial Switching Hubs for EtherNet/IP and Ethernet	3 port	Failure detection: None	Current consumption: 0.22 A	**W4S1-03B**
		5 port	Failure detection: None		**W4S1-05B**
		5 port	Failure detection: Supported		**W4S1-05C**

Automation Software Sysmac Studio

Please purchase a DVD and licenses the first time you purchase the Sysmac Studio. DVDs and licenses are available individually. The license does not include the DVD.

Product	Specifications	Number of Model Standards licenses	Media	Model
Sysmac Studio Standard Edition Ver.1.□□	The Sysmac Studio provides an integrated development environment to set up, program, debug, and maintain NJ-series Controllers and other Machine Automation Controllers, as well as EtherCAT slaves. Sysmac Studio runs on the following OS. Windows XP (Service Pack 3 or higher, 32-bit version) / Vista (32-bit version) / 7 (32-bit/64-bit version)	-- (Media only)	DVD *1	**SYSMAC-SE200D**
		1 license	—	**SYSMAC-SE201L**
		3 license	—	**SYSMAC-SE203L**
		10 license	—	**SYSMAC-SE210L**
		30 license	—	**SYSMAC-SE230L**
		50 license	—	**SYSMAC-SE250L**
Sysmac Studio Vision Edition Ver.1.□□ *2	Sysmac Studio Vision Edition is a limited license that provides selected functions required for FH-serise/ FQ-M-series Vision Sensor settings.	1 license	—	**SYSMAC-VE001L**

Note:
1. Site licenses are available for users who will run Sysmac Studio on multiple computers. Ask your OMRON sales representative for details.
2. Sysmac Studio version 1.07 or higher supports the FH Series. Sysmac Studio does not support the FZ5 Series.

*1 The same media is used for both the Standard Edition and the Vision Edition.
*2 With the Vision Edition, you can use only the setup functions for FH-series/FQ-M-series Vision Sensors.

Development Environment

Please purchase a DVD and licenses the first time you purchase the Sysmac Studio. DVDs and licenses are available individually. The license does not include the DVD.
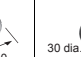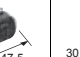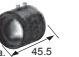
Product	Specifications	Number of Model Standards licenses	Media	Model
Application Producer	Software components that provide a development environment to further customize the standard controller features of the FH Series. System requirements: • CPU: Intel Pentium Processor (SSE2 or higher) • OS: Windows 7 Professional (32bit) or Enterprise (32bit) or Ultimate (32bit) • .NET Framework: .NET Framework 3.5 or higher • Memory: At least 2 GB RAM Available disk space: At least 2 GB • Browser: Microsoft® Internet Explorer 6.0 or later • Display: XGA (1024 × 768), True Color (32-bit) or higher • Optical drive: CD/DVD drive The following software is required to customize the software: Microsoft® Visual Studio® 2010 Professional or Microsoft® Visual Studio® 2008 Professional	— (Media only)	CD	**FH-AP1**
		1 license	—	**FH-AP1L**

Lenses

C-mount Lens for 1/3-inch image sensor (Recommend: FZ-S□/FZ-SH□/FH-S□)

Model	3Z4S-LE SV-0614V	3Z4S-LE SV-0813V	3Z4S-LE SV-1214V	3Z4S-LE SV-1614V	3Z4S-LE SV-2514V	3Z4S-LE SV-3518V	3Z4S-LE SV-5018V	3Z4S-LE SV-7527V	3Z4S-LE SV-10035V
Appearance/ Dimensions (mm)	29 dia. 30.0	28 dia. 34.0	29 dia. 29.5	29 dia. 24.0	29 dia. 24.5	29 dia. 33.5[WD:∞] to 37.5[WD:300]	32 dia. 37.0[WD:∞] to 39.4[WD:1000]	32 dia. 42.0[WD:∞] to 44.4[WD:1000]	32 dia. 43.9[WD:∞] to 46.3[WD:1000]
Focal length	6 mm	8 mm	12 mm	16 mm	25 mm	35 mm	50 mm	75 mm	100 mm
Brightness	F1.4	F1.3	F1.4	F1.4	F1.4	F1.8	F1.8	F2.7	F3.5
Filter size	M27.0 P0.5	M25.5 P0.5	M27.0 P0.5	M27.0 P0.5	M27.0 P0.5	M27.0 P0.5	M30.5 P0.5	M30.5 P0.5	M30.5 P0.5
Maximum sensor size	1/3 inch	1/3 inch	1/3 inch	1/3 inch	1/3 inch	1/3 inch	1/3 inch	1/3 inch	1/3 inch
Mount	C mount								

C-mount Lens for 2/3-inch image sensor (Recommend: FZ-S□2M/FZ-S□5M2/FH-S□02)
(3Z4S-LE SV-7525H and 3Z4S-LE SV-10028H can also be used for FH-S□04)
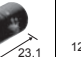
Model	3Z4S-LE SV-0614H	3Z4S-LE SV-0814H	3Z4S-LE SV-1214H	3Z4S-LE SV-1614H	3Z4S-LE SV-2514H	3Z4S-LE SV-3514H	3Z4S-LE SV-5014H	3Z4S-LE SV-7525H	3Z4S-LE SV-10028H
Appearance/ Dimensions (mm)	42 dia. 57.5	39 dia. 52.5	30 dia. 51.0	30 dia. 47.5	30 dia. 36.0	44 dia. 45.5	44 dia. 57.5	36 dia. 42.0[WD:∞] to 54.6[WD:1200]	39 dia. 66.5[WD:∞] to 71.6[WD:2000]
Focal length	6 mm	8 mm	12 mm	16 mm	25 mm	35 mm	50 mm	75 mm	100 mm
Brightness	F1.4	F1.4	F1.4	F1.4	F1.4	F1.4	F1.4	F2.5	F2.8
Filter size	M40.5 P0.5	M35.5 P0.5	M27.0 P0.5	M27.0 P0.5	M27.0 P0.5	M35.5 P0.5	M40.5 P0.5	M34.0 P0.5	M37.5 P0.5
Maximum sensor size	2/3 inch	2/3 inch	2/3 inch	2/3 inch	2/3 inch	2/3 inch	2/3 inch	1 inch	1 inch
Mount	C mount								

C-mount Lens for 1-inch image sensor (Recommend: FH-S□04)
(3Z4S-LE SV-7525H with focal length of 75 mm and 3Z4S-LE SV-10028H with focal length of 100 mm are also available.)
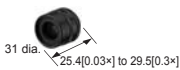
Model	3Z4S-LE VS-1214H1	3Z4S-LE VS-1614H1	3Z4S-LE VS-2514H1	3Z4S-LE VS-3514H1	3Z4S-LE VS-5018H1
Appearance/ Dimensions (mm)	38 dia. 48.0[WD:∞] to 48.5[WD:300]	38 dia. 42.5[WD:∞] to 43.3[WD:300]	38 dia. 33.5[WD:∞] to 35.6[WD:300]	38 dia. 35.0[WD:∞] to 39.1[WD:300]	44 dia. 44.5[WD:∞] to 49.5[WD:500]
Focal length	12 mm	16 mm	25 mm	35 mm	50 mm
Brightness	F1.4	F1.4	F1.4	F1.4	F1.8
Filter size	M35.5 P0.5	M30.5 P0.5	M30.5 P0.5	M30.5 P0.5	M40.5 P0.5
Maximum sensor size	1 inch	1 inch	1 inch	1 inch	1 inch
Mount	C mount				

Lenses for small camera
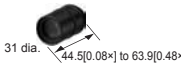
Model	FZ-LES3	FZ-LES6	FZ-LES16	FZ-LES30
Appearance/ Dimensions (mm)	12 dia. 16.4	12 dia. 19.7	12 dia. 23.1	12 dia. 25.5
Focal length	3 mm	6 mm	16 mm	30 mm
Brightness	F2.0	F2.0	F3.4	F3.4

FH-Series

Vibrations and shocks resistant C-mount Lens for 2/3-inch image sensor
(Recommend: FZ-S□/FZ-S□2M/FZ-S□5M2/FZ-SH□/FH-S□/FH-S□02)

Model	3Z4S-LE VS-MC15-□□□□□ *1									3Z4S-LE VS-MC20-□□□□□ *1								
Appearance/ Dimensions (mm)	31 dia. 25.4[0.03×] to 29.5[0.3×]									31 dia. 23.0[0.04×] to 30.5[0.4×]								
Focal length	15 mm									20 mm								
Filter size	M27.0 P0.5									M27.0 P0.5								
Optical magnification	0.03 ×			0.2 ×			0.3 ×			0.04 ×			0.25 ×			0.4 ×		
Iris Range *2	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8
Depth of field (mm)	183.1	512.7	732.4	4.8	13.4	19.2	2.3	6.5	9.2	110.8	291.2	416.0	3.4	9.0	12.8	1.5	3.9	5.6
Maximum sensor size	2/3 inch																	
Mount	C Mount																	

Model	3Z4S-LE VS-MC25N-□□□□□ *1									3Z4S-LE VS-MC30□□□□□ *1								
Appearance/ Dimensions (mm)	31 dia. 26.5[0.05×] to 38.0[0.5×]									31 dia. 24.0[0.06×] to 35.7[0.45×]								
Focal length	25 mm									30 mm								
Filter size	M27.0 P0.5									M27.0 P0.5								
Optical magnification	0.05 ×			0.25 ×			0.5 ×			0.06 ×			0.15 ×			0.45 ×		
Iris Range *2	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8
Depth of field (mm)	67.2	188.2	268.8	3.2	9.0	12.8	1.0	2.7	3.8	47.1	131.9	188.4	8.2	22.9	32.7	1.1	3.2	4.6
Maximum sensor size	2/3 inch																	
Mount	C Mount																	

Model	3Z4S-LE VS-MC35-□□□□□ *1									3Z4S-LE VS-MC50-□□□□□ *1								
Appearance/ Dimensions (mm)	31 dia. 32.0[0.26×] to 45.7[0.65×]									31 dia. 44.5[0.08×] to 63.9[0.48×]								
Focal length	35 mm									50 mm								
Filter size	M27.0 P0.5									M27.0 P0.5								
Optical magnification	0.26 ×			0.3 ×			0.65 ×			0.08 ×			0.2 ×			0.48 ×		
Iris Range *2	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8
Depth of field (mm)	2.8	8.4	11.9	2.2	6.5	9.2	0.6	1.7	2.5	33.8	75.6	108.0	6.0	13.4	19.2	1.3	2.9	4.1
Maximum sensor size	2/3 inch																	
Mount	C Mount																	

Model	3Z4S-LE VS-MC75-□□□□□ *1								
Appearance/ Dimensions (mm)	31 dia. 70.0[0.14×] to 105.5[0.62×]								
Focal length	75 mm								
Filter size	M27.0 P0.5								
Optical magnification	0.14 ×			0.2 ×			0.62 ×		
Iris Range *2	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8	Maximum aperture	F5.6	F8
Depth of field (mm)	17.7	26.1	37.2	9.1	13.4	19.2	1.3	1.9	2.7
Maximum sensor size	2/3 inch								
Mount	C Mount								

*1 Insert the iris range into □□□□□ in the model number as follows.
F=aperture: blank
F=5.6: FN056
F=8: FN080
*2 F-number can be selected from maximum aperture, 5.6, and 8.0.

Extension Tubes

Lenses	For C mount Lenses *	For Small Digital CCD Cameras
Model	**3Z4S-LE SV-EXR**	**FZ-LESR**
Contents	Set of 7 tubes (40 mm, 20 mm, 10 mm, 5 mm, 2.0 mm, 1.0 mm, and 0.5 mm) Maximum outer diameter: 30 mm dia.	Set of 3 tubes (15 mm, 10 mm, 5 mm) Maximum outer diameter: 12 mm dia.

* Do not use the 0.5-mm, 1.0-mm, and 2.0-mm Extension Tubes attached to each other. Since these Extension Tubes are placed over the threaded section of the Lens or other Extension Tube, the connection may loosen when more than one 0.5-mm, 1.0-mm or 2.0-mm Extension Tube are used together.
Reinforcement is required to protect against vibration when Extension Tubes exceeding 30 mm are used.

Ratings and Specifications (Sensor Controllers)

FH Sensor Controllers

Type			High-speed Controllers (4 core)			Standard Controllers (2 core)		
Model		NPN	FH-3050	FH-3050-10	FH-3050-20	FH-1050	FH-1050-10	FH-1050-20
		PNP						
Main functions	Controller type		Box-type controllers					
	High-grade Processing items		No					
	No. of Cameras		2	4	8	2	4	8
	Connected Camera		Can be connected to all cameras. (FZ-S series/FH-S series)					
	Processing resolution (FZ-S)	When connected to a intelligent compact camera	752 (H) × 480 (V)					
		When connected to a 300,000-pixel camera	640 (H) × 480 (V)					
		When connected to a 2 million-pixel camera	1600 (H) × 1200 (V)					
		When connected to a 5 million-pixel camera	2448 (H) × 2044 (V)					
	Processing resolution (FH-S)	When connected to a 300,000-pixel camera	640 (H) × 480 (V)					
		When connected to a 2 million-pixel camera	2040 (H) × 1088 (V)					
		When connected to a 4 million-pixel camera	2040 (H) × 2048 (V)					
	No. of scenes		128					
	Number of logged images *1	When connected to a intelligent compact camera	Connected to 1 camera(Color): 232, Connected to 2 camera(Color): 116 Connected to 3 camera(Color): 77, Connected to 4 camera(Color): 58 Connected to 5 camera(Color): 46, Connected to 6 camera(Color): 38 Connected to 7 camera(Color): 33, Connected to 8 camera(Color): 29					
		When connected to a 300,000-pixel camera (FZ-S/FH-S)	Connected to 1 camera(Color): 270, Connected to 1 camera(Monochrome): 272 Connected to 2 camera(Color): 135, Connected to 2 camera(Monochrome): 136 Connected to 3 camera(Color/Monochrome): 90 Connected to 4 camera(Color): 67, Connected to 4 camera(Monochrome): 68 Connected to 5 camera(Color/Monochrome): 54 Connected to 6 camera(Color/Monochrome): 45 Connected to 7 camera(Color/Monochrome): 38 Connected to 8 camera(Color): 33, Connected to 8 camera(Monochrome): 34					
		When connected to a 2 million-pixel camera (FH-S)	Connected to 1 camera(Color/Monochrome): 37, Connected to 2 camera(Color/Monochrome): 18 Connected to 3 camera(Color/Monochrome): 12, Connected to 4 camera(Color/Monochrome): 9 Connected to 5 camera(Color/Monochrome): 7, Connected to 6 camera(Color/Monochrome): 6 Connected to 7 camera(Color/Monochrome): 5, Connected to 8 camera(Color/Monochrome): 4					
		When connected to a 2 million-pixel camera (FZ-S)	Connected to 1 camera(Color/Monochrome): 43, Connected to 2 camera(Color/Monochrome): 21 Connected to 3 camera(Color/Monochrome): 14, Connected to 4 camera(Color/Monochrome): 10 Connected to 5 camera(Color/Monochrome): 8, Connected to 6 camera(Color/Monochrome): 7 Connected to 7 camera(Color/Monochrome): 6, Connected to 8 camera(Color/Monochrome): 5					
		When connected to a 4 million-pixel camera (FH-S)	Connected to 1 camera(Color/Monochrome): 20, Connected to 2 camera(Color/Monochrome): 10 Connected to 3 camera(Color/Monochrome): 6, Connected to 4 camera(Color/Monochrome): 5 Connected to 5 camera(Color/Monochrome): 4, Connected to 6 camera(Color/Monochrome): 3 Connected to 7 camera(Color/Monochrome): 2, Connected to 8 camera(Color/Monochrome): 2					
		When connected to a 5 million-pixel camera (FZ-S)	Connected to 1 camera(Color/Monochrome): 16, Connected to 2 camera(Color/Monochrome): 8 Connected to 3 camera(Color/Monochrome): 5, Connected to 4 camera(Color/Monochrome): 4 Connected to 5 camera(Color/Monochrome): 3, Connected to 6 camera(Color/Monochrome): 2 Connected to 7 camera(Color/Monochrome): 2, Connected to 8 camera(Color/Monochrome): 2					
	Operation		Mouse or similar device					
	Settings		Create series of processing steps by editing the flowchart (Help messages provided).					
External interface	Serial communications		RS-232C: 1 CH					
	EtherNet communications		No-protocol (TCP/UDP) 1000BASE-T					
			1 port	2 port	2 port	1 port	2port	2port
	EtherNet/IP communications		Ethernet port baud rate: 1 Gbps (1000 BASE-T)					
	EtherCAT communications		EtherCAT protocol (100BASE-TX)					
	Parallel I/O		(In the 2-line random trigger mode) 17 inputs (STEP0/ENCTRIG_Z0, STEP1/ENCTRIG_Z1, ENCTRIG_A0 to 1, ENCTRIG_B0 to 1, DSA0 to 1, DI0 to 7, DI_LINE0) 37 outputs (RUN0 to 1, READY0 to 1, BUSY0 to 1, OR0 to 1, ERROR0 to 1, GATE0 to 1, STGOUT0/SHTOUT0, STGOUT1/SHTOUT1, STGOUT2 to 7, DO0 to 15, ACK) (In the 5-line to 8-line random trigger mode) 19 inputs, STEP0 to 7, DI_LINE0 to 2, DI0 to 7) 34 outputs (READY0 to 7, BUSY0 to 7, OR0 to 7, ACK, ERROR, STGOUT/SHTOUT0 to 7)					
	Encoder interface		RS422-A line driver level. Phase A/B: single-phase 4MHz (multiplying phase difference of 1MHz by 4 times), Phase Z: 1MHz					
	Monitor interface		DVI-I output IF × 1ch					
	USB interface		4 channels (supports USB 1.1 and 2.0)					
	SD card interface		SDHC card of Class4 or higher rating is recommended.					
Ratings	Power supply voltage		20.4 to 26.4 VDC					
	Current consumption (at 24.0 VDC) *2	When connected to a intelligent compact camera, intelligent or autofocus camera — Connected to 2 cameras	5.0 A max.	5.4 A max.	6.4 A max.	4.7 A max.	5.0 A max.	5.9 A max.
		Connected to 4 cameras	–	7.0 A max.	8.1 A max.	–	6.5 A max.	7.5 A max.
		Connected to 8 cameras	–	–	11.5 A max.	–	–	10.9 A max.
		When connected to a 300,000-pixel camera, 2 million-pixel camera, 4 million-pixel camera or 5 million-pixel camera — Connected to 2 cameras	4.1 A max.	4.2 A max.	5.2 A max.	3.6 A max.	3.7 A max.	4.5 A max.
		Connected to 4 cameras	–	4.8 A max.	5.6 A max.	–	4.3 A max.	5.0 A max.
		Connected to 8 cameras	–	–	6.8 A max.	–	–	6.2 A max.
	Insulation resistance		Between DC power supply and controller FG: 20 MΩ or higher (rated voltage 250 V)					
Operation Environment	Noise Immunity	Fast transient burst — DC Power Supply	Direct infusion: 2 KV Pulse rising: 5 ns Pulse width: 50 ns Burst continuation time: 15 ms/0.75 ms Period: 300 ms Application time: 1 min					
		I/O line	Cramp: 1 KV Pulse rising: 5 ns Pulse width: 50 ns Burst continuation time: 15 ms/0.75 ms Period: 300 ms Application time: 1 min					
	Ambient temperature range		Operating: 0 to 50 °C Storage: -20 to 65 °C (with no icing or condensation)					
	Ambient humidity range		Operating and storage: 35% to 85% (with no condensation)					
	Ambient atmosphere		No corrosive gases					
	Grounding		Type D grounding (100Ω or less grounding resistance) Conventional type 3 grounding					
	Degree of protection		IEC60529 IP20					
Dimensions	Dimensions		190 × 115 × 182.5 mm					
	Weight		Approx. 3.2 kg	Approx. 3.4 kg	Approx. 3.4 kg	Approx. 3.2 kg	Approx. 3.4 kg	Approx. 3.4 kg
	Case materials		Cover: zinc-plated steel plate, side plate: aluminum (A6063)					
Accessories			Controller (1) / user manual (one Japanese and one English versions) / Instruction Installation Manual (1) / Power supply terminal block connector (1) / Ferrite core (2, FH-3050 and FH-1050), 4 (FH-3050-10 and FH-1050-10), and 8 (FH-3050-20 and FH-1050-20)					

*1 The image logging capacity changes when multiple cameras of different types are connected at the same time.
*2 The current consumption when the maximum number of cameras supported by each controller are connected.
If a strobe controller model is connected to a lamp, the current consumption is as high as when an intelligent camera is connected.

FZ5 Sensor Controllers

Type		High-speed Controllers		Standard Controllers		Lite Controllers	
Model	NPN	FZ5-1100	FZ5-1100-10	FZ5-600	FZ5-600-10	FZ5-L350	FZ5-L350-10
	PNP	FZ5-1105	FZ5-1105-10	FZ5-605	FZ5-605-10	FZ5-L355	FZ5-L355-10
Controller type		Controllers integrated with LCD				Box-type controllers	
High-grade Processing items		No					
No. of Cameras		2	4	2	4	2	4
Connected Camera		Can be connected to FZ-S series. (Can not be connected to FH-S series.)		Can be connected to FZ-S series. (Can not be connected to FH-S series. When connecting 5 million-pixel cameras, up to two cameras can be connected.)			
Processing resolution	When connected to a intelligent compact camera	752 (H) × 480 (V)					
	When connected to a 300,000-pixel camera	640 (H) × 480 (V)					
	When connected to a 2 million-pixel camera	1600 (H) × 1200 (V)					
	When connected to a 5 million-pixel camera	2448 (H) × 2044 (V)					
No. of scenes		32					
Number of logged images *1	When connected to a intelligent compact camera — Connected to 1 camera	232		214			
	Connected to 2 cameras	116		107			
	Connected to 3 cameras	77		71			
	Connected to 4 cameras	58		53			
	When connected to a 300,000-pixel camera — Connected to 1 camera	Color camera: 270, Monochrome Camera: 272		Color camera: 250, Monochrome Camera: 252			
	Connected to 2 cameras	Color camera: 135, Monochrome Camera: 136		Color camera: 125, Monochrome Camera: 126			
	Connected to 3 cameras	Color camera: 90, Monochrome Camera: 90		Color camera: 83, Monochrome Camera: 84			
	Connected to 4 cameras	Color camera: 67, Monochrome Camera: 68		Color camera: 62, Monochrome Camera: 63			
	When connected to a 2 million-pixel camera — Connected to 1 camera	Color camera: 43, Monochrome Camera: 43		Color camera: 40, Monochrome Camera: 40			
	Connected to 2 cameras	Color camera: 21, Monochrome Camera: 21		Color camera: 20, Monochrome Camera: 20			
	Connected to 3 cameras	Color camera: 14, Monochrome Camera: 14		Color camera: 13, Monochrome Camera: 13			
	Connected to 4 cameras	Color camera: 10, Monochrome Camera: 10		Color camera: 10, Monochrome Camera: 10			
	When connected to a 5 million-pixel camera — Connected to 1 camera	Color camera: 16, Monochrome Camera: 16		Color camera: 11, Monochrome Camera: 11			
	Connected to 2 cameras	Color camera: 8, Monochrome Camera: 8		Color camera: 5, Monochrome Camera: 5			
	Connected to 3 cameras	Color camera: 5, Monochrome Camera: 5		—			
	Connected to 4 cameras	Color camera: 4, Monochrome Camera: 4		—			
Operation		Touch pen, mouse, etc.				Mouse or similar device	
Settings		Create series of processing steps by editing the flowchart (Help messages provided).					
Serial communications		RS-232C/422A : 1 CH				RS-232: 1CH	
EtherNet communications		Ethernet 100BASE-TX/10BASE-T				Ethernet 1000BASE-T/100BASE-TX/10BASE-T	
EtherNet/IP communications		Ethernet port baud rate: 100 Mbps (100Base-TX)					
Parallel I/O		(When used in Multi-line random-trigger mode) 17 inputs (RESET, STEP0/ENCTRIG_Z0, STEP1/ENCTRIG_Z1, DSA0 to 1, ENCTRIG_A0 to 1, ENCTRIG_B0 to 1, DI0 to 7), 29 outputs (RUN/BUSY1, BUSY0, GATE0 to 1, OR0 to 1, READY0 to 1, ERROR, STGOUT0 to 3, DO0 to 15) (When used in other mode) 13 inputs (RESET, STEP0/ENCTRIG_Z0, DSA0, ENCTRIG_A0, ENCTRIG_B0, DI0 to 7), 26 outputs (RUN, BUSY0, GATE0, OR0, READY0, ERROR, STGOUT0 to 3, DO0 to 15) * STGOUT 2 to 3 only for camera 4 ch type		13 inputs (RESET, STEP0/ENCTRIG_Z0, DSA0, ENCTRIG_A0, ENCTRIG_B0, DI0 to 7), 26 outputs (RUN, BUSY0, GATE0, OR0, READY0, ERROR, STGOUT0 to 3, DO0 to 15) * STGOUT 2 to 3 only for camera 4 ch type		11 inputs (RESET, STEP, DSA, and DI 0 to 7), 26 outputs (RUN, BUSY, GATE, OR, READY, ERROR, STGOUT 0 to 3, and DO 0 to 15) * STGOUT 2 to 3 only for camera 4 ch type	
Monitor interface		Integrated Controller and LCD 12.1 inch TFT color LCD (Resolution: XGA 1,024 × 768 dots)				Analog RGB video output, 1 channel (Resolution: XGA 1,024 × 768 dots)	
USB interface		4 channels (supports USB 1.1 and 2.0)				2CH (supports USB1.1/2.0)	
Power supply voltage *2		20.4 to 26.4 VDC					
Current consumption (at 24.0 VDC) *3	When connected to a intelligent compact camera / When connected to a intelligent or autofocus camera	5.0 A max.	7.5 A max.	5.0 A max.	7.5 A max.	4.0 A max.	5.5 A max.
	When connected to a 300,000-pixel camera / When connected to a 2 million-pixel camera / When connected to a 5 million-pixel camera	3.7 A max.	4.9 A max.	3.7 A max.	4.9 A max.	2.6 A max.	2.9 A max.
Ambient temperature range		Operating: 0 to 45 °C for low cooling fan speeds, 0 to 50 °C for high cooling fan speeds. Storage: -20 to 65 °C (with no icing or condensation)				Operating: 0 to 45 °C, 0 to 50 °C. Storage: -20 to 65 °C (with no icing or condensation)	
Ambient humidity range		Operating and storage: 35% to 85% (with no condensation)					
Weight		Approx. 3.2 kg	Approx. 3.4 kg	Approx. 3.2 kg	Approx. 3.4 kg	Approx. 1.8 kg	
Accessories		Touch pen (one, inside the front panel), Instruction Manual, 6 mounting brackets				Instruction Manual	

*1 The image logging capacity changes when multiple cameras of different types are connected at the same time.
*2 Do not ground the positive terminal of the 24-VDC power supply to a Lite Controller.
    If the positive terminal is grounded, electrical shock may occur when an SG (0-V) part, such as the case of the Controller or Camera, is touched.
*3 The current consumption when the maximum number of cameras supported by each controller are connected.
    If a strobe controller model is connected to a lamp, the current consumption is as high as when an intelligent camera is connected.

Ratings and Specifications (Cameras)

High-speed CMOS cameras

Model	FH-SM	FH-SC	FH-SM02	FH-SC02	FH-SM04	FH-SC04
Image elements	1/3-inch CMOS image elements		2/3-inch CMOS image elements		1-inch CMOS image elements	
Color/Monochrome	Monochrome	Color	Monochrome	Color	Monochrome	Color
Effective pixels	640 (H) × 480 (V)		2040 (H) × 1088 (V)		2040 (H) × 2048 (V)	
Pixel size	7.4 (μm) × 7.4 (μm)		5.5 (μm) × 5.5 (μm)		5.5 (μm) × 5.5 (μm)	
Shutter function	Electronic shutter; Shutter speeds can be set from 20 μs to 100 ms.		Electronic shutter; Shutter speeds can be set from 25 μs to 100 ms.			
Partial function	1 to 480 lines	2 to 480 lines	1 to 1088 lines	2 to 1088 lines	1 to 2048 lines	2 to 2048 lines
Frame rate (image read time)	308 fps (3.3 ms)		219 fps (4.6 ms) *		118 fps (8.5 ms) *	
Lens mounting	C mount					
Field of vision, installation distance	Selecting a lens according to the field of vision and installation distance					
Ambient temperature range	Operating: 0 to 40 °C, Storage: -25 to 65 °C (with no icing or condensation)					
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)					
Weight	Approx.105 g		Approx.110 g			
Accessories	Instruction manual					

* For high speed frame rate, 2 pieces of FZ-VS-_M cables are required.

Digital CCD Cameras

Model	FZ-S	FZ-SC	FZ-S2M	FZ-SC2M	FZ-S5M2	FZ-SC5M2
Image elements	Interline transfer reading all pixels, 1/3-inch CCD image elements		Interline transfer reading all pixels, 1/1.8-inch CCD image elements		Interline transfer reading all pixels, 2/3-inch CCD image elements	
Color/Monochrome	Monochrome	Color	Monochrome	Color	Monochrome	Color
Effective pixels	640 (H) × 480 (V)		1600 (H) × 1200 (V)		2448 (H) × 2044 (V)	
Pixel size	7.4 (μm) × 7.4 (μm)		4.4 (μm) × 4.4 (μm)		3.45 (μm) × 3.45 (μm)	
Shutter function	Electronic shutter; select shutter speeds from 20 μs to 100 ms					
Partial function	12 to 480 lines		12 to 1200 lines		12 to 2044 lines	
Frame rate (image read time)	80 fps (12.5 ms)		30 fps (33.3 ms)		16 fps (62.5 ms)	
Lens mounting	C mount					
Field of vision, installation distance	Selecting a lens according to the field of vision and installation distance					
Ambient temperature range	Operating: 0 to 50 °C Storage: -25 to 65 °C (with no icing or condensation)		Operating: 0 to 40 °C Storage: -25 to 65 °C (with no icing or condensation)			
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)					
Weight	Approx. 55 g		Approx. 76 g		Approx.140 g	
Accessories	Instruction manual					

Small CCD Digital Cameras

Model	FZ-SF	FZ-SFC	FZ-SP	FZ-SPC
Image elements	Interline transfer reading all pixels, 1/3-inch CCD image elements			
Color/Monochrome	Monochrome	Color	Monochrome	Color
Effective pixels	640 (H) × 480 (V)			
Pixel size	7.4 (μm) × 7.4 (μm)			
Shutter function	Electronic shutter; select shutter speeds from 20 μm to 100 ms			
Partial function	12 to 480 lines			
Frame rate (image read time)	80 fps (12.5ms)			
Lens mounting	Special mount (M10.5 P0.5)			
Field of vision, installation distance	Selecting a lens according to the field of vision and installation distance			
Ambient temperature range	Operating: 0 to 50 °C (camera amp) 0 to 45 °C (camera head) Storage: -25 to 65 °C (with no icing or condensation)			
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)			
Weight	Approx. 150 g			
Accessories	Instruction manual, installation bracket, Four mounting brackets (M2)		Instruction manual	

FH-Series

High-speed CCD Cameras

Model	FZ-SH	FZ-SHC
Image elements	Interline transfer reading all pixels, 1/3-inch CCD image elements	
Color/Monochrome	Monochrome	Color
Effective pixels	640 (H) × 480 (V)	
Pixel size	7.4 (μm) × 7.4 (μm)	
Shutter function	Electronic shutter; select shutter speeds from 1/10 to 1/50,000 s	
Partial function	12 to 480 lines	
Frame rate (image read time)	204 fps (4.9ms)	
Field of vision, installation distance	Selecting a lens according to the field of vision and installation distance	
Ambient temperature range	Operating: 0 to 40 °C Storage: -25 to 65 °C (with no icing or condensation)	
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)	
Weight	Approx. 105 g	
Accessories	Instruction manual	

Intelligent Compact CMOS Cameras

Model	FZ-SQ010F	FZ-SQ050F	FZ-SQ100F	FZ-SQ100N
Image elements	1/3-inch CMOS image elements			
Color/Monochrome	Color			
Effective pixels	752 (H) × 480 (V)			
Pixel size	6.0 (μm) × 6.0 (μm)			
Shutter function	1/250 to 1/32,258			
Partial function	8 to 752 lines			
Frame rate (image read time)	60 fps			
Field of vision	7.5 × 4.7 to 13 × 8.2 mm	13 × 8.2 to 53 × 33 mm	53 × 33 to 240 × 153 mm	29 × 18 to 300 × 191 mm
Installation distance	38 to 60 mm	56 to 215 mm	220 to 970 mm	32 to 380 mm
LED class *	Class 2			
Ambient temperature range	Operating: 0 to 50 °C Storage: -25 to 65 °C			
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)			
Weight	Approx. 150 g		Approx. 140 g	
Accessories	Mounting bracket (FQ-XL), polarizing filter attachment (FQ-XF1), instruction manual and warning label			

* Applicable standards: IEC62471-2

Intelligent CCD Cameras, Autofocus CCD Cameras

Model	FZ-SLC100	FZ-SLC15	FZ-SZC100	FZ-SZC15
Image elements	Interline transfer reading all pixels, 1/3-inch CCD image elements			
Color/Monochrome	Color			
Effective pixels	640 (H) × 480 (V)			
Pixel size	7.4 (μm) × 7.4 (μm)			
Shutter function	Electronic shutter; select shutter speeds from 1/10 to 1/50,000 s			
Partial function	12 to 480 lines			
Frame rate (image read time)	80 fps (12.5 ms)			
Field of vision *2	13 to 100 mm *1	2.9 to 14.9 mm *1	13 to 100 mm *1	2.9 to 14.9 mm *1
Installation distance	70 to 190 mm *1	35 to 55 mm *1	77.5 to 197.5 mm *1	47.5 to 67.5 mm
LED class *3 (lighting)	Class 2		—	
Ambient temperature range	Operating: 0 to 50 °C Storage: -25 to 65 °C (with no icing or condensation)			
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)			
Weight	Approx. 670 g	Approx. 700 g	Approx. 500 g	
Accessories	Instruction Sheet and hexagonal wrench			

*1 Tolerance: ±5% max.
*2 The length of the visual field is the lengths along the Y axis.
*3 Applicable standards: IEC62471-2

Ratings and Specifications (LCD Monitor, Cable)

LCD Monitor

Model	FZ-M08
Size	8.4 inches
Type	Liquid crystal color TFT
Resolution	1,024 × 768 dots
Input signal	Analog RGB video input, 1 channel
Power supply voltage	21.6 to 26.4 VDC
Current consumption	Approx. 0.7 A max.
Ambient temperature range	Operating: 0 to 50 °C; Storage: -25 to 65 °C (with no icing or condensation)
Ambient humidity range	Operating and storage: 35 to 85% (with no condensation)
Weight	Approx. 1.2 kg
Accessories	Instruction Sheet and 4 mounting brackets

Camera Cables

Model	FZ-VS (2 m)	FZ-VSB (2 m)	FZ-VSL (2 m)
Shock resistiveness (durability)	10 to 150 Hz single amplitude 0.15 mm 3 directions, 8 strokes, 4 times		
Ambient temperature range	Operation and storage: 0 to 65 °C (with no icing or condensation)		
Ambient humidity range	Operation and storage: 40 to 70%RH (with no condensation)		
Ambient atmosphere	No corrosive gases		
Material	Cable sheath, connector: PVC		
Minimum bending radius	69 mm	69 mm	69 mm
Weight	Approx. 170 g	Approx. 220 g	Approx. 170 g

Monitor Cable

Model	FZ-VM
Vibration resistiveness	10 to 150 Hz single amplitude 0.15 mm 3 directions, 8 strokes, 4 times
Ambient temperature range	Operation: 0 to 50 °C; Storage: -20 to 65 °C (with no icing or condensation)
Ambient humidity range	Operation and storage: 35 to 85%RH (with no condensation)
Ambient atmosphere	No corrosive gases
Material	Cable sheath: heat-resistant PVC Connector: PVC
Minimum bending radius	75 mm
Weight	Approx. 170 g

Cable Extension Unit

Model	FZ-VSJ
Power supply voltage *1	11.5 to 13.5 VDC
Current con-sumption *2	1.5 A max.
Ambient temperature range	Operating: 0 to 50 °C; Storage: -25 to 65 °C (with no icing or condensation)
Ambient humidity range	Operating and storage: 35 to 85% (with no condensation)
Maximum Units connectable	2 Units per Camera
Weight	Approx. 240 g
Accessories	Instruction Sheet and 4 mounting screws

*1 A 12-VDC power supply must be provided to the Cable Extension Unit when connecting the Intelligent Camera, the Autofocus Camera, the Intelligent Compact Camera, the Strobe Controller, or the Lighting Controller.
*2 The current consumption shows when connecting the Cable Extension Unit to an external power supply.

Long-distance Camera Cables

Model	FZ-VS2 (15 m)	FZ-VSL2 (15 m)
Shock resistiveness (durability)	10 to 150 Hz single amplitude 0.15 mm 3 directions, 8 strokes, 4 times	
Ambient temperature range	Operation and storage: 0 to 65 °C (with no icing or condensation)	
Ambient humidity range	Operation and storage: 40 to 70%RH (with no condensation)	
Ambient atmosphere	No corrosive gases	
Material	Cable sheath, connector: PVC	
Minimum bending radius	93 mm	
Weight	Approx. 1600 g	

Parallel Cable

Model	FZ-VP	FZ-VPX
Vibration resistiveness	10 to 150 Hz single amplitude 0.15 mm 3 directions, 8 strokes, 4 times	
Ambient temperature range	Operation: 0 to 50 °C; Storage: -20 to 65 °C (with no icing or condensation)	
Ambient humidity range	Operation and storage: 35 to 85%RH (with no condensation)	
Ambient atmosphere	No corrosive gases	
Material	Cable sheath: heat-resistant PVC Connector: resin	
Minimum bending radius	75 mm	
Weight	Approx. 160 g	Approx. 180 g

Note: FZ-VP/FZ-VPX is only for the FZ series. The FH series can use XW2Z-S013-2/-S013-5.

Encoder Cable

Model	FH-VR
Vibration resistiveness	10 to 150 Hz single amplitude 0.1 mm 3 directions, 8 strokes, 10 times
Ambient temperature range	Operation: 0 to 50 °C; Storage: -10 to 60 °C (with no icing or condensation)
Ambient humidity range	Operation and storage: 35 to 85%RH (with no condensation)
Ambient atmosphere	No corrosive gases
Material	Cable Jacket: Heat, oil and flame resistant PVC Connector: polycarbonate resin
Minimum bending radius	65 mm
Weight	Approx. 104 g

Cameras / Cables Connection Table

Type of camera	Model	Cable length	High-speed CMOS cameras *				
			300,000-pixel	2 million-pixel		4 million-pixel	
			FH-SM/SC	FH-SM02/SC02		FH-SM04/SC04	
			—	High speed mode of transmission speed select	Standard mode of transmission speed select	High speed mode of transmission speed select	Standard mode of transmission speed select
Camera Cables Right-angle camera cables	FZ-VS FZ-VSL	2 m	Yes	Yes	Yes	Yes	Yes
		5 m	Yes	Yes	Yes	Yes	Yes
		10 m	Yes	No	Yes	No	Yes
Bend resistant camera cables	FZ-VSB	2 m	Yes	Yes	Yes	Yes	Yes
		5 m	Yes	Yes	Yes	Yes	Yes
		10 m	Yes	No	Yes	No	Yes
Long-distance camera cable Long-distance right-angle camera cable	FZ-VS2 FZVSL2	15 m	Yes	No	Yes	No	Yes

* High-speed CMOS camera is only for the FH series.

Type of camera	Model	Cable length	Digital CCD cameras			Small digital CCD cameras Pen type / flat type	High-speed CCD cameras	Intelligent compact CMOS cameras	Intelligent CCD cameras Autofocus CCD cameras
			300,000-pixel	2 million-pixel	5 million-pixel				
			FZ-S/SC	FZ-S2M/SC2M	FZ-S5M2/ SC5M2	FZ-SF/SFC FZ-SP/SPC	FZ-SH/SHC	FZ-SQ☐	FZ-SLC☐ FZ-SZC☐
Camera Cables Right-angle camera cables	FZ-VS FZ-VSL	2 m	Yes	Yes	Yes	Yes	Yes	Yes	Yes
		5 m	Yes	Yes	Yes	Yes	Yes	Yes	Yes
		10 m	Yes	Yes	No	Yes	Yes	Yes	No
Bend resistant camera cables	FZ-VSB	2 m	Yes	Yes	Yes	Yes	Yes	Yes	Yes
		5 m	Yes	Yes	Yes	Yes	Yes	Yes	Yes
		10 m	Yes	Yes	No	Yes	Yes	Yes	No
Long-distance camera cable Long-distance right-angle camera cable	FZ-VS2 FZVSL2	15 m	Yes	Yes	No	Yes	Yes	Yes	No

EtherCAT Communications Specifications

Item		Specifications
Communications standard		IEC61158 Type 12
Physical layer		100 BASE-TX (IEEE802.3)
Modulation		Base band
Baud rate		100 Mbps
Topology		Depends on the specifications of the EtherCAT master.
Transmission Media		Twisted-pair cable of category 5 or higher (double-shielded straight cable with aluminum tape and braiding)
Transmission Distance		Distance between nodes: 100 m or less
Node address setting		00 to 9
External connection terminals		RJ45 × 2 (shielded) IN: EtherCAT input data, OUT: EtherCAT output data
Send/receive PDO data sizes	Input	56 to 280 bytes/line (including input data, status, and unused areas) Up to 8 lines can be set. *
	Output	28 bytes/line (including output data and unused areas) Up to 8 lines can be set. *
Mailbox data size	Input	512 bytes
	Output	512 bytes
Mailbox		Emergency messages, SDO requests, and SDO information
Refreshing methods		I/O-synchronized refreshing (DC)

* This depends on the upper limit of the master.

Version Information

FH Series and Programming Devices

FH Series	Required Programming Device	
	Sysmac Studio Standard Edition/Vision Edition	
	Ver.1.06	Ver.1.07 or higher
FH-3050 (-☐) FH-1050 (-☐)	Not supported	Supported

Note: 1. The auto-update to Sysmac Studio version 1.07 will be available soon.
2. Sysmac Studio does not support the FZ5 Series.

Components and Functions

Example of the FH Sensor Controllers
BOX type
(4-camera type)
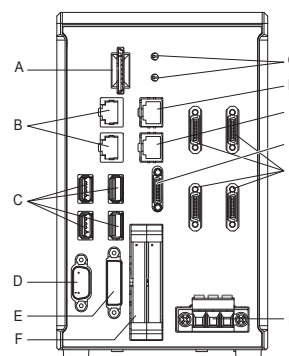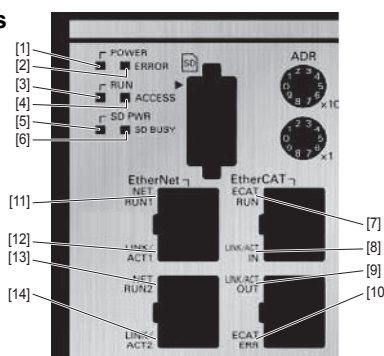
	Name	Description
[1]	POWER LED	Lit while power is ON.
[2]	ERROR LED	Lit when an error has occurred.
[3]	RUN LED	Lit while the controller is in Measurement Mode.
[4]	ACCESS LED	Lit while the memory is accessed.
[5]	SD POWER LED	Lit while power is supplied to the SD card and the card is usable.
[6]	SD BUSY LED	Blinks while the SD memory card is accessed.
[7]	EtherCAT RUN LED	Lit while EtherCAT communications are usable.
[8]	EtherCAT LINK/ACT IN LED	Lit when connected with an EtherCAT device, and blinks while performing communications.
[9]	EtherCAT LINK/ACT OUT LED	Lit when connected with an EtherCAT device, and blinks while performing communications.
[10]	EtherCAT ERR LED	Lit when EtherCAT communications have become abnormal.
[11]	EtherNet NET RUN1 LED	Lit while EtherNet communications are usable.
[12]	EtherNet NET LINK/ACK1 LED	Lit when connected with an EtherNet device, and blinks while performing communications.
[13]	EtherNet NET RUN2 LED	Lit when EtherNet communications are usable.
[14]	EtherNet NET LINK/ACK2 LED	Lit when connected with an EtherNet device, and blinks while performing communications.

	Name	Description
A	SD memory card installation connector	Install the SD memory card. Do not plug or unplug the SD card during measurement operation. Otherwise measurement time may be affected or data may be destroyed.
B	EtherNet connector	Connect an EtherNet device.
C	USB connector	Connect a USB device. Do not plug or unplug it during measurement operation. Otherwise measurement time may be affected or data may be destroyed.
D	RS-232C connector	Connect an external device such as a programmable controller.
E	DVI-I connector	Connect a monitor.
F	I/O connector (control lines, data lines)	Connect the controller to external devices such as a sync sensor and PLC.
G	EtherCAT address setup volume	Used to set a node address (00 to 99) as an EtherCAT communication device.
H	EtherCAT communication connector (IN)	Connect the opposed EtherCAT device.
I	EtherCAT communication connector (OUT)	Connect the opposed EtherCAT device.
J	Encoder connector	Connect an encoder.
K	Camera connector	Connect cameras.
L	Power supply terminal connector	Connect a DC power supply. Wire the controller independently on other devices. Wire the ground line. Be sure to ground the controller alone. Perform wiring using the attached power supply connector.

Example of the FZ5 Sensor Controllers
LCD-integrated type
(4-camera type)

Left-side view   Front view   Right-side view
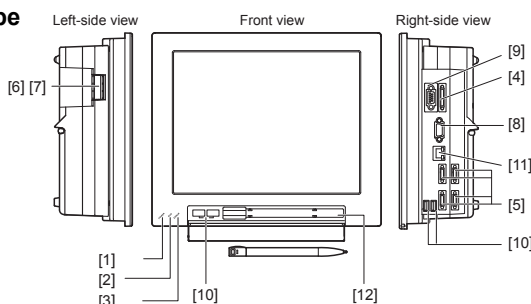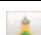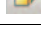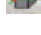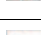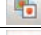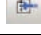
Example of the FZ5-Lite Sensor Controllers
LCD-integrated type
(4-camera type)

	Name	Description
[1]	POWER LED	Lit while power is ON.
[2]	RUN LED	Lit while the controller is in Run Mode.
[3]	ERROR LED	Lit when an error has occurred.
[4]	I/O connector (control lines, data lines)	Connect the controller to external devices such as a sync sensor and PLC.
[5]	Camera connector	Connect cameras.
[6]	Power	Connect a DC power supply. Wire the power supply unit independently of other devices. After wiring, replace the terminal cover.
[7]	Ground terminal	Connect the ground wire. Make sure that the controller is grounded with a separate ground wire.
[8]	Monitor connector (analog RGB)	Connect a monitor. (Provided with Lite controller type only)
[9]	RS-232C/RS-422 connector	Connect an external device such as a personal computer or PLC.
[10]	USB connector	Connect a track ball, mouse and USB memory. A total of four USB ports are provided and any of them can be used. However, when connecting two or more USB memories, do not connect them to adjacent ports. Doing so may cause the USB memories to come into contact, resulting in malfunction or damage.
[11]	EtherNet connector	Connect the controller to a personal computer.
[12]	Touch pen (holder)	A touch pen is stored. (Provided with the LCD integrated type only)

Group	Icon	Processing Item		Corresponding Page in the Catalog
Inspections / Measurement		Search	Used to identify the shapes and calculate the position of measurement objects.	P16
		Flexible Search	Recognizing the shapes of workpieces with variation and detecting their positions.	P16
		Sensitive Search	Search a small difference by dividing the search model in detail, and calculating the correlation.	P16
		ECM Search	Used to search the similar part of model form input image. Detect the evaluation value and position.	P16
		EC Circle Search	Extract circles using "round " shape information and get position, radius and quantity in high preciseness.	P16
		Shape Search II	Used to search the similar part of model from input image regardless of environmental changes. Detect the evaluation value and position.	P16
		Shape Search III	Robust detection of positions is possible at high-speed and with high precision incorporating environmental fluctuations, such as differences in individual shapes of the workpieces, pose fluctuations, noise superimposition and shielding.	P16
		EC Corner	This processing item measures a corner position (corner) of a workpiece.	P16
		Ec Cross	The center position of a crosshair shape is measured using the lines created by the edge information on each side of the crosshair.	P16
		Classification	Used when various kinds of products on the assembly line need to be sorted and identified.	P17
		Edge Position	Measure position of measurement objects according to the color change in measurement area.	P16
		Edge Pitch	Detect edges by color change in measurement area. Used for calculating number of pins of IC and connectors.	P16
		Scan Edge Position	Measure peak/bottom edge position of workpieces according to the color change in separated measurement area.	P16
		Scan Edge Width	Measure max/min/average width of workpieces according to the color change in separated measurement area.	P16
		Circular Scan Edge Position	Measure center axis, diameter and radius of circular workpieces.	P16
		Circular Scan Edge Width	Measure center axis, width and thickness of ring workpieces.	P16
		Intersection	Calculate approximate lines from the edge information on two sides of a square workpiece to measure the angle formed at the intersection of the two lines.	P16
		Color Data	Used for detecting presence and mixed varieties of products by using color average and deviation.	P17
		Gravity and Area	Used to measure area, center of gravity of workpices by extracting the color to be measured.	P17
		Labeling	Used to measure number, area and gravity of workpieces by extracting registered color.	P17
		Label Data	Selecting one region of extracted Labeling, and get that measurement. Area and Gravity position can be got and judged.	
		Defect	Used for appearance measurement of plain-color measurement objects such as defects, stains and burrs.	P17
		Precise Defect	Check the defect on the object. Parameters for extraction defect can be set precisely.	P17
		Fine Matching	Difference can be detected by overlapping and comparing (matching) registered fine images with input images.	P16
		Character Inspect	Recognize character according correlation search with model image registered in [Model Dictionary].	P17
		Date Verification	Reading character string is verified with internal data.	P17
		Model Dictionary	Register character pattern as dictionary. The pattern is used in [Character Inspection].	
		2DCode *2	Recognize 2D code and display where the code quality is poor.	P17
		Barcode *1	Recognize barcode, verify and output decoded characters.	P17
		Circle Angle	Used for calculating angle of inclination of circular measurement objects.	P17
		Glue Bead Inspection	You can inspect coating of a specified color for gaps or runoffs along the coating path.	P17
Image Capturing		Camera Image Input	To input images from cameras. And set up the conditions to input images from cameras.	
		Camera Image Input FH	This is a processing item specific to the FH Sensor Controller to input images from high-speed cameras.	

Group	Icon	Processing Item	Corresponding Page in the Catalog
Image Capturing	Camera Image Input HDR	Create high-dynamic range images by acquiring several images with different conditions.	
	Camera Image Input HDRLite	HDR function for FZ-SQ☐ Intelligent Compact Cameras.	
	Camera Switch	To switch the cameras used for measurement. Not input images from cameras again.	
	Measurement Image Switching	To switch the images used for measurement. Not input images from camera again.	
Correcting images	Position Compensation	Used when positions are differed. Correct measurement is performed by correcting position of input images.	P18
	Filtering	Used for processing images input from cameras in order to make them easier to be measured.	P18
	Backgrond Suppression	To enhance contrast of images by extracting color in specified brightness.	P18
	Brightness Correct Filter	Track brightness change of entire screen and remove gradual brightness change such as uneven brightness.	P18
	Color Gray Filter	Color image is converted into monochrome images to emphasize specific color.	P18
	Extract Color Filter	Convert color image to color extracted image or binary image.	P18
	Anti Color Shading	To remove the irregular color/pattern by uniformizing max.2 specified colors.	P18
	Stripes Removal Filter II	Remove the background pattern of vertical, horizontal and diagonal stripes.	P18
	Polar Transformation	Rectify the image by polar transformation. Useful for OCR or pattern inspection printed on circle.	P18
	Trapezoidal Correction	Rectify the trapezoidal deformed image.	P18
	Machine Simulator	How the alignment marks would move on the image when each stage or robot axis is controlled can be checked.	
	Image Subtraction	The registered model image and measurement image are compared and only the different pixels are extracted and converted to an image.	
	Advanced filter	Process the images acquired from cameras in order to make them easier to measure. This processing item consolidates existing image conversion filtering into one processing item and adds extra functions.	P19
	Panorama	Combine multiple image to create one big image.	P18
Assisting inspections / measurement	Macro	Advanced arithmetic processing can be easily incorporated into workflow as macro processing items.	P20
	Macro Calculation	This function is convenient when the user wants to calculate a value using an original calculation formula or change the set value or system data of a processing item.	P20
	Calculation	Used when using the judge results and measured values of ProcItem which are registered in processing units.	
	Line Regression	Used for calculating regression line from plural measurement coodinate.	
	Circle Regression	Used for calculating regression circle from plural measurement coordinate.	
	Precise Calibration	Used for calibration corresponding to trapezoidal distortion and lens distortion.	P15
	User Data	Used for setting of the data that can be used as common constants and variables in scene group data.	P21
	Set Unit Data	Used to change the ProcItem data (setting parameters,etc.) that has been set up in a scene.	
	Get Unit Data	Used to get one data (measured results, setting parameters,etc.) of ProcItem that has been set up in a scene.	
	Set Unit Figure	Used for re-setting the figure data (model, measurement area) registered in an unit.	
	Get Unit Figure	Used for get the figure data (model, measurement area) registered in an unit.	
	Trend Monitor	Used for displaying the information about results on the monitor, facilitating to avoid NG and analyze causes.	P21
	Image Logging	Used for saving the measurement images to the memory and USB memory.	
	Image Conversion Logging	Used for saving the measurement images in JPEG and BMP format.	
	Data Logging	Used for saving the measurement data to the memory and USB memory.	
	Elapsed Time	Used for calculating the elapsed time since the measurement trigger input.	
	Wait	Processing is stopped only at the set time. The standby time is set by the unit of [ms].	

Group	Icon	Processing Item		Corresponding Page in the Catalog
Assisting inspections / measurement		Focus	Focus setting is supported.	P15
		Iris	Focus and aperture setting is supported.	P15
		Parallelize	A part of the measurement flow is divided into two or more tasks and processed in parallel to shorten the measurement time. This processing item is placed at the top of processing to be performed in parallel.	
		Parallelize Task	A part of the measurement flow is divided into two or more tasks and processed in parallel to shorten the measurement time. This processing item is placed immediately before processing to be performed in parallel between Parallelize and Parallelize End.	
		Statistics	Used when you need to calculate an average of multiple measurement results.	
		Reference Calib Data	Calibration data and distortion compensation data held under other processing items can be referenced.	
		Position Data Calculation	The specified position angle is calculated from the measured positions.	P14
		Stage Data	Sets and stores data related to stages.	
		Robot Data	Sets and stores data related to robots.	
		Vision Master Calibration	This processing item automatically calculates the entire axis movement amount of the control equipment necessary for calibration.	P15
		PLC Mastoer Calibration	Calibration data is created using a communication command from PLC.	P15
		Convert Position Data	The position angle after the specified axis movement is calculated.	P14
		Movement Single Position	The axis movement that is required to match the measured position angle to the reference position angle is calculated.	P14
		Movement Multi Points	The axis movements that are required to match the measured position angles to the corresponding reference position angles are calculated.	P14
		Detection Point	Obtains position/angle information by referring to the coordinate values measured with the Measurement Processing Unit.	
		Camera Calibration	By setting the camera calibration, the measurement result can be converted and output as actual dimensions.	P15
		Data Save	The set data can be saved in the controller main unit or as scene data. The data is held even after the FH/FZ power is turned off.	

Group	Icon	Processing Item		Corresponding Page in the Catalog
Branching processing		Conditional Branch	Used where more than two kinds of products on the production line need to detected separately.	
		End	This ProcItem must be set up as the last processing unit of a branch.	
		DI Branch	Same as ProcItem "Branch". But you can change the targets of conditional branching via external inputs.	
		Control Flow Normal	Set the measurement flow processing into the wait state in which the specific no-protocol command can be executed.	
		Control Flow PLC Link	Set the measurement flow processing into the wait state in which the specific PLC Link command can be executed.	
		Control Flow Parallel	Set the measurement flow processing into the wait state in which the specific parallel command can be executed.	
		Control Flow Fieldbus	Set the measurement flow processing into the wait state in which the specific Fieldbus command can be executed.	
		Selective Branch	Easily branch to multiple destinations.	
Outputting results		Data Output	Used when you need to output data to the external devices such as PLC or PC via serial ports.	
		Parallel Data Output	Used when you need to output data to the external devices such as PLC or PC via parallel ports.	
		Parallel Judgement Output	Used when you need to output judgement results to the external devices such as PLC or PC via parallel ports.	
		Fieldbus Data Output	Outputs data to an external device, such as a Programmable Controller, through a fieldbus interface.	
Displaying results on the monitor		Result Display	Used for displaying the texts or the figures in the camera image.	
		Display Image File	Display selected image file.	
		Display Last NG Image	Display the last NG images.	

*1 Bar Codes that can be read : JAN/EAN/UPC (including add-on codes), Code 39, Codabar (NW-7), ITF (Interleaved 2 of 5), Code 93, Code 128, GS1-128, GS1 DataBar (RSS-14 / RSS Limited / RSS Expanded), Pharmacode
*2 2D Codes that can be read : Data Matrix (ECC200), QR Code

Dimensions

(Unit: mm)

Series Sensor Controllers

FH-series Box-type
FH-3050/-3050-10/-3050-20
FH-1050/-1050-10/-1050-20

Four, M4 mounting holes with a depth of 4.5 mm

The 2-camera type has only one Ethernet connectors.

The 2-camera type has only two camera connectors, and the 8-camera type has eight camera connectores.

Four, M4 mounting holes with a depth of 4.5 mm

Four, M3 mounting holes with a depth of 4.5 mm
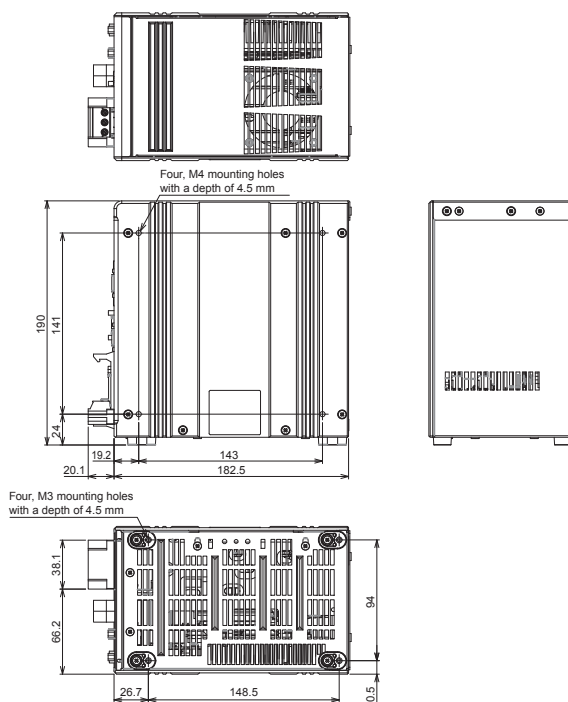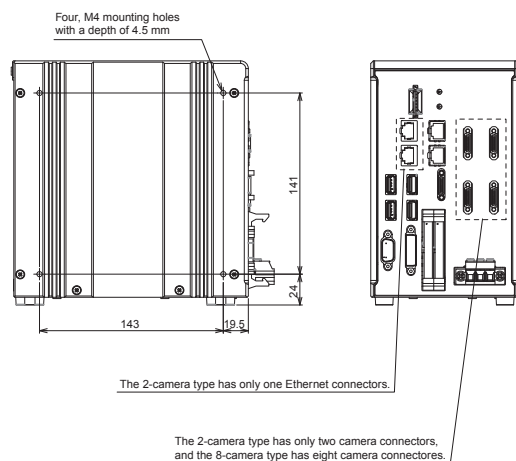
FH-Series

FZ5-series LCD-integrated type
FZ5-1100/-1105/-1100-10/1105-10
FZ5-600/-605/-600-10/-605-10

120   120

20

Four, M3 mounting holes with
a depth of 6 mm

(7)

130

12.8   (28.4)   10

246

110

33

(163.5)

68

260

7

6   296   (6)

308   104

20

120   120

* The size of the 2-camera
type is 83.
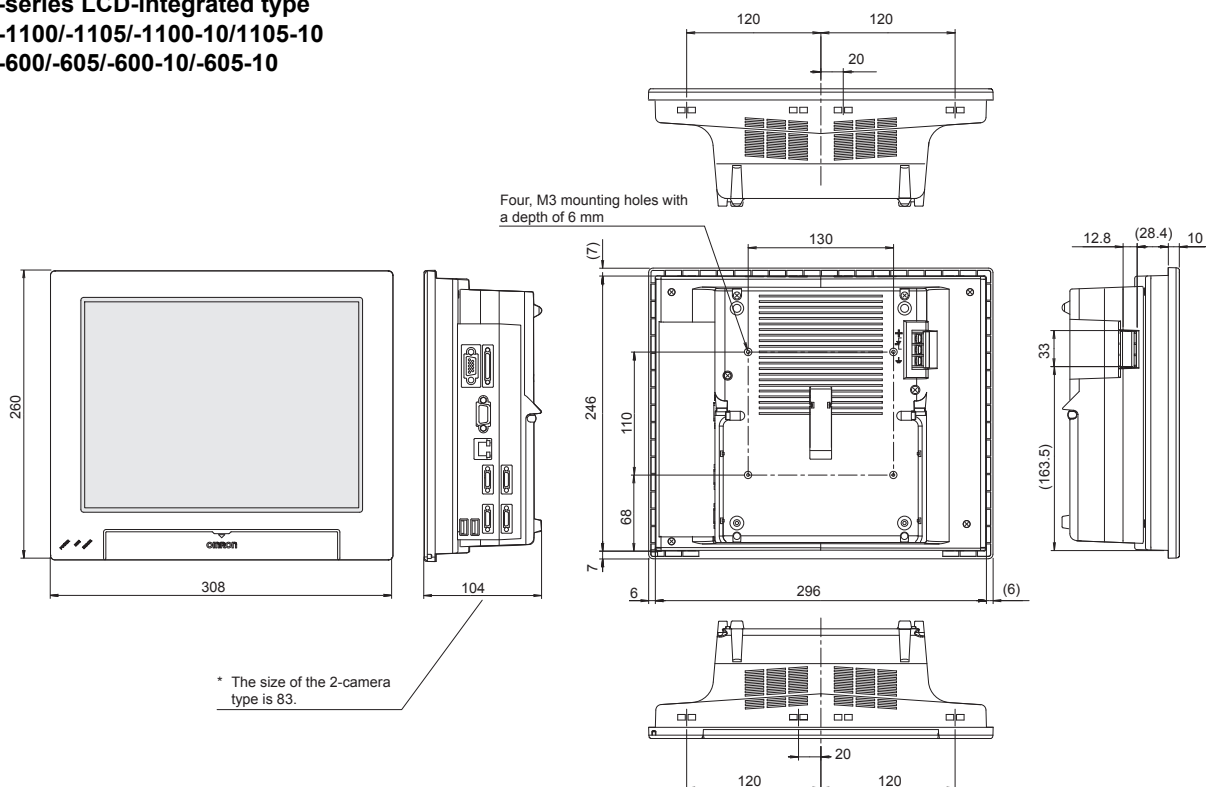
FZ5-series Lite Box-type
FZ5-L350/-L355/-L350-10/-L355-10

182.3

80

197

12

* The 2-camera type has only two
camera connectors on its right side.
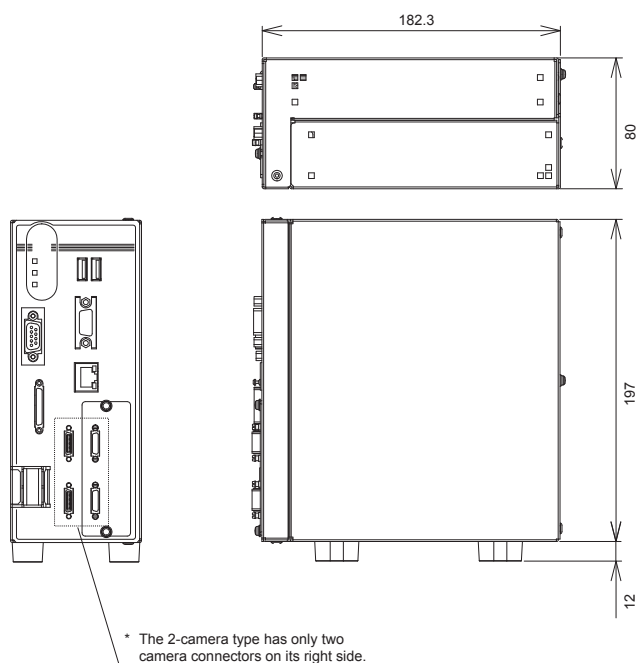
Cameras

High-speed CMOS Camera

300,000-pixel camera

FH-SC
FH-SM
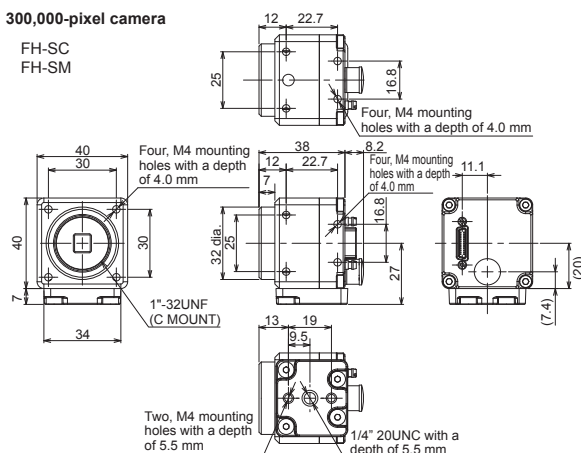
Four, M4 mounting holes with a depth of 4.0 mm

Four, M4 mounting holes with a depth of 4.0 mm

1"-32UNF (C MOUNT)

Two, M4 mounting holes with a depth of 5.5 mm

1/4" 20UNC with a depth of 5.5 mm

2 million-pixel camera   4 million-pixel camera

FH-SC02   FH-SC04
FH-SM02   FH-SM04

Four, M4 mounting holes with a depth of 4.0 mm

Four, M4 mounting holes with a depth of 4.0 mm

Four, M4 mounting holes with a depth of 4.0 mm

1"-32UNF (C MOUNT)

Two, M4 mounting holes with a depth of 5.5 mm

1/4" 20UNC with a depth of 5.5 mm
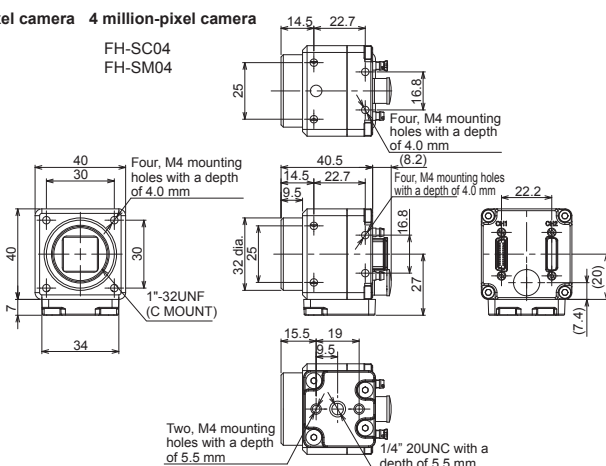
Digital CCD Cameras

300,000-pixel camera

FZ-S
FZ-SC

Three, M2 mounting holes with a depth of 3.0 mm

Three, M2 mounting holes with a depth of 3.0mm (both sides)

1"-32UN-2A (C mount)

Two, M4 mounting holes with a depth of 5.5 mm

1/4" 20UNC with a depth of 5.5 mm
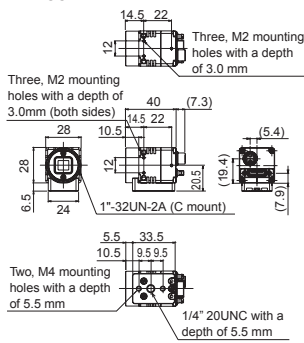
2 million-pixel camera

FZ-S2M
FZ-SC2M

Three, M2 mounting holes with a depth of 3.0 mm

1"-32UN-2A (C MOUNT)

Three, M2 mounting holes with a depth of 3.0mm (both sides)

Two, M4 mounting holes with a depth of 5.5 mm

1/4" 20UNC with a depth of 5.5 mm
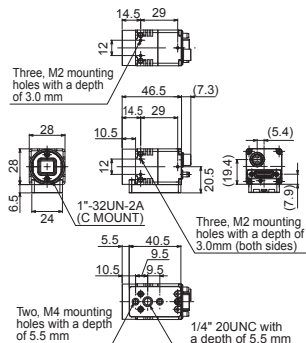
5 million-pixel camera

FZ-S5M2
FZ-SC5M2

$2^{+0.01}_{0}$ Mounting holes with a depth of 2.5 mm (4 directions)

Four M4 mounting holes with a depth of 4 mm (4 directions)

2 dia. mounting holes with a depth of 2.5 mm (4 directions)

Four-R3

1"-32UNC-2A (C mount)

Mounting Holes

Two, M4 mounting holes with a depth of 5.5 mm

1/4" 20UNC with a depth of 5.5 mm

High-speed CCD Camera

FZ-SH
FZ-SHC

Four M4 mounting holes with a depth of 4 mm (4 commonness)

Four-R3

1"-32UNF (C mount)

Two, M4 mounting holes with a depth of 5.5 mm

1/4" 20UNC with a depth of 5.5 mm

Small digital CCD cameras

Camera head

Flat camera
FZ-SF
FZ-SFC

Two-4.3 dia.

(From ccd surface)

Four-4.3 dia.

3 dia.

16 pin round connector
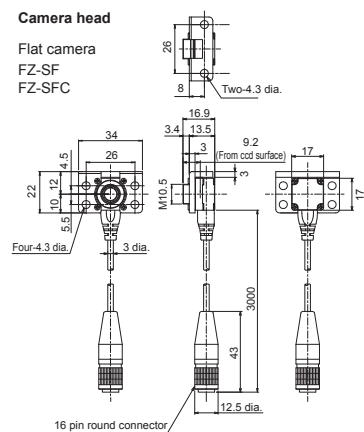
Pen-shaped camera

FZ-SP
FZ-SPC

Four, M1.7 mounting holes with a depth of 1.5 mm

Eight, M1.7 mounting holes with a depth of 1.5 mm

(From ccd surface)

16 pin round connector

Two, M3 mounting holes with a depth of 4 mm
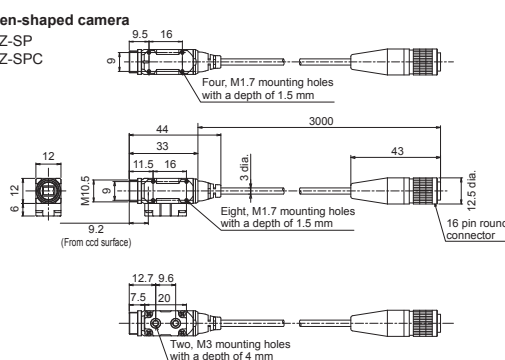
Camera amplifier

Can be used for both flat cameras and pen-shaped cameras

Three, M2 mounting holes with a depth of 3.0 mm

Three, M2 mounting holes with a depth of 3.0 mm

Two, M4 mounting holes with a depth of 5.5 mm

1/4" 20UNC with a depth of 5.5 mm
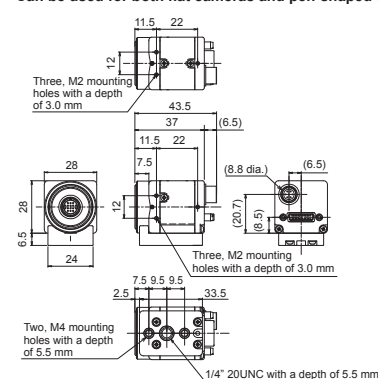
Intelligent Compact CMOS Cameras

Narrow view / Standard
FZ-SQ010F
FZ-SQ050F

*1. The mounting brackets can be connected to either side.
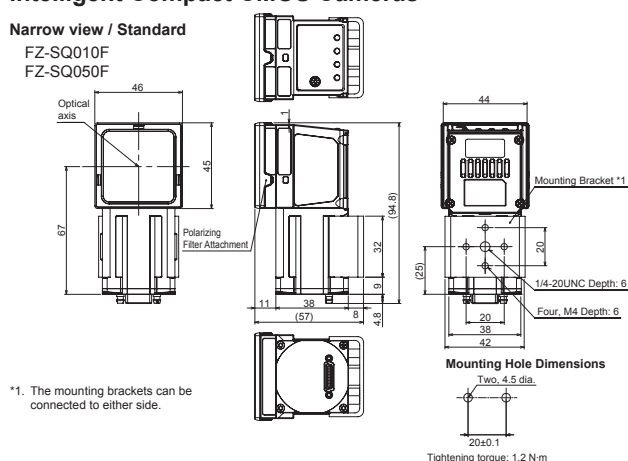
Wide View
FZ-SQ100F (long-distance)
FZ-SQ100N (short-distance)

*1. The mounting brackets can be connected to either side.
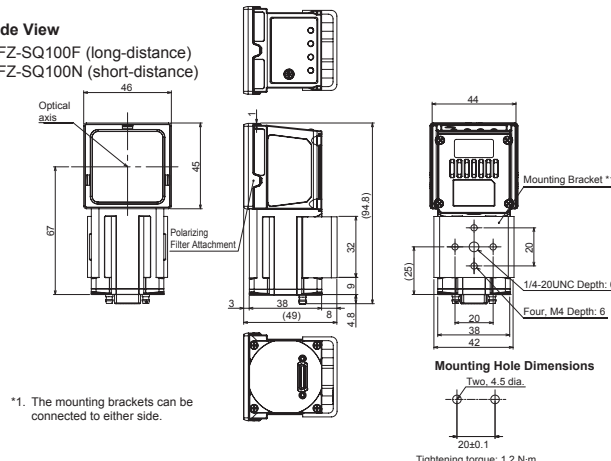
Intelligent CCD Camera

FZ-SLC15

FZ-SLC100
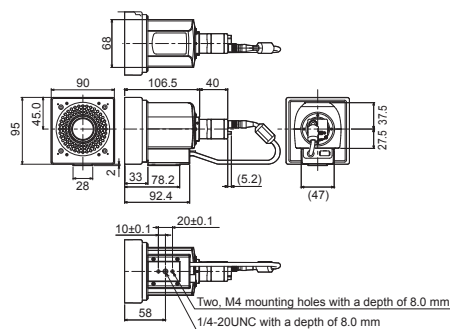
Autofocus CCD Camera

FZ-SZC15
FZ-SZC100
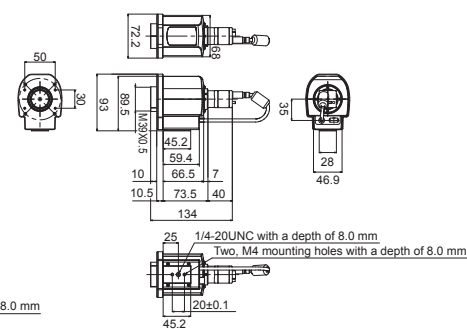
Cables

Camera Cable

Camera Cable
FZ-VS

2 to 26-pin square connector

Long-distance Camera Cable
FZ-VS2

26-pin rectangular connector
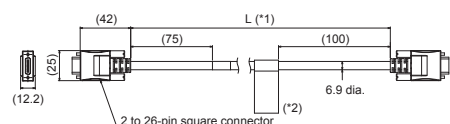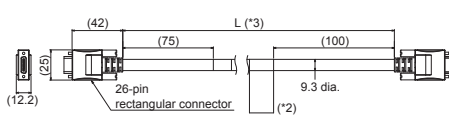
Bend resistant Cable
FZ-VSB
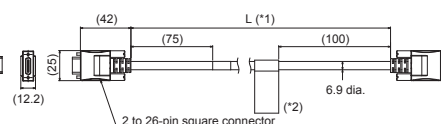
2 to 26-pin square connector

Long-distance Right-angle Camera Cable
FZ-VSL2

26-pin square connector
26-pin square connector

Right-angle Camera Cable
FZ-VSL

26-pin square connector
26-pin square connector
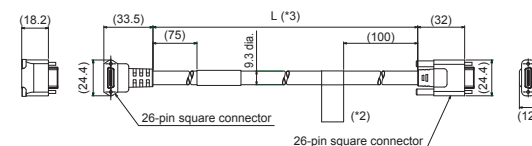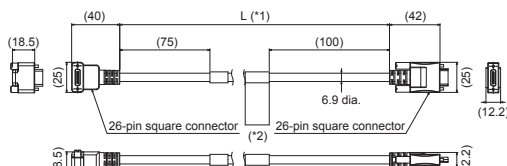
*1. Cable is available in 2m/5m/10m.
*2. Each camera cables has polarity. Please ensure that the name plate side of the cable is connected to the controller.
*3. Cable is available in 15m.

Parallel Cable

FZ-VP

50-pin square connector

*1. cable is available in 2m/5m.

FZ-VPX

50-pin square connector
50-pin square connector
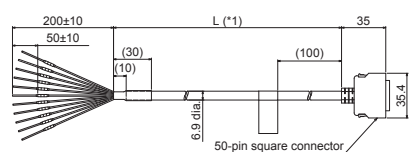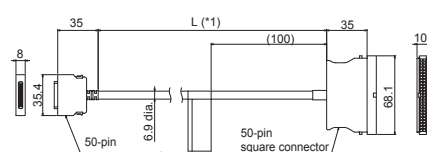
*1. cable is available in 2m/5m.

Monitor Cable

FZ-VM

2 to 15-pin square connector
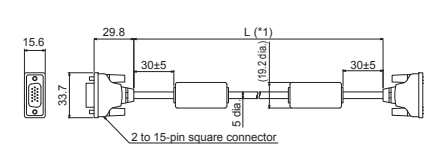
*1. cable is available in 2m/5m.

Encoder Cable

FH-VR
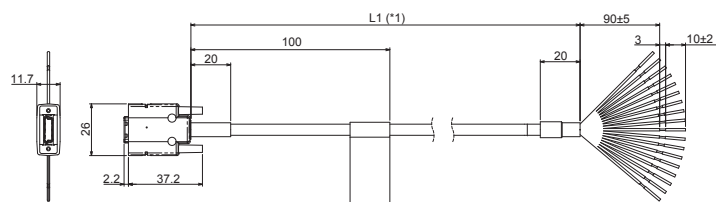
*1. Cable is available in 1.5 m.

LCD Monitor

FZ-M08
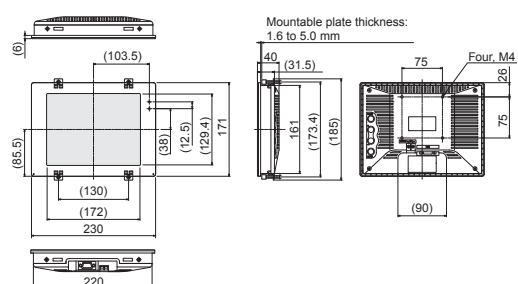
Camera Cable Extension Unit

FZ-VSJ
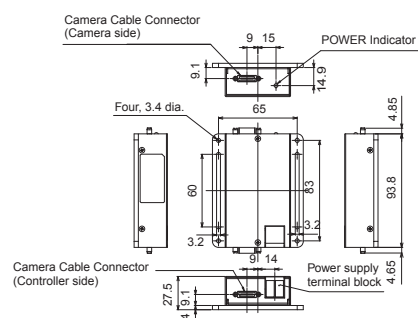
Extension Tubes for Small Camera

FZ-LESR

Extension tubes 5 mm

Extension tubes 10 mm

Extension tubes 15 mm
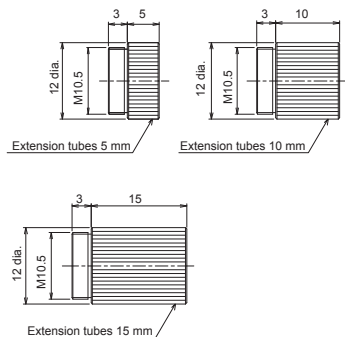
Lens for Small Camera

FZ-LES Series

Diaphragm adjustment knob

Diaphragm look screw (M1.4)
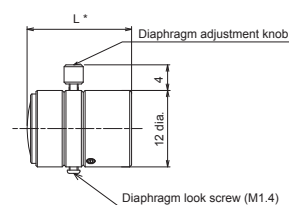
* Overall length is available in 16.4mm/19.7mm/23.1mm/25.5mm.

FH-Series

Optical Chart

High-speed CMOS Camera FH-S☐04, 4 million-pixel

3Z4S-LE

- VS-1214H1
- VS-1614H1
- VS-2514H1
- VS-3514H1
- VS-5018H1
- SV-7525H
- SV-10028H

High-speed CMOS Camera FH-S☐02, 2 million-pixel

3Z4S-LE

- SV-0614H
- SV-0814H
- SV-1214H
- SV-1614H
- SV-2514H
- SV-3514H
- SV-5014H
- SV-7525H
- SV-10028H

High-speed CMOS Camera FH-S☐, High-speed CCD Camera FZ-SH☐, Digital CCD Camera FZ-S☐
300,000-pixel

3Z4S-LE

- SV-0614V
- SV-0813V
- SV-1214V
- SV-1614V
- SV-2514V
- SV-3518V
- SV-5018V
- SV-7527V
- SV-10035V

OMRON

Digital CCD Camera FZ-S□5M2, 5 million-pixel

Chart with axes "Camera distance (mm)" (vertical, 30 to 10,000) and "Field of vision (mm)" (horizontal, 5 to 1,000).

3Z4S-LE

- SV-0614H
- SV-0814H
- SV-1214H
- SV-1614H
- SV-2514H
- SV-3514H
- SV-5014H
- SV-7525H
- SV-10028H

Digital CCD Camera FZ-S□2M, 2 million-pixel

Chart with axes "Camera distance (mm)" (vertical, 30 to 10,000) and "Field of vision (mm)" (horizontal, 3 to 1,000).

3Z4S-LE

- SV-0614H
- SV-0814H
- SV-1214H
- SV-1614H
- SV-2514H
- SV-3514H
- SV-5014H
- SV-7525H
- SV-10028H

Small Digital CCD Cameras FZ-SF□, FZ-SP□, 300,000-pixel

Chart with axes "WD * (mm)" (vertical, 10 to 10000) and "Field of vision (mm)" (horizontal, 1 to 1000).

- FZ-LES30
- FZ-LES16
- FZ-LES6
- FZ-LES3
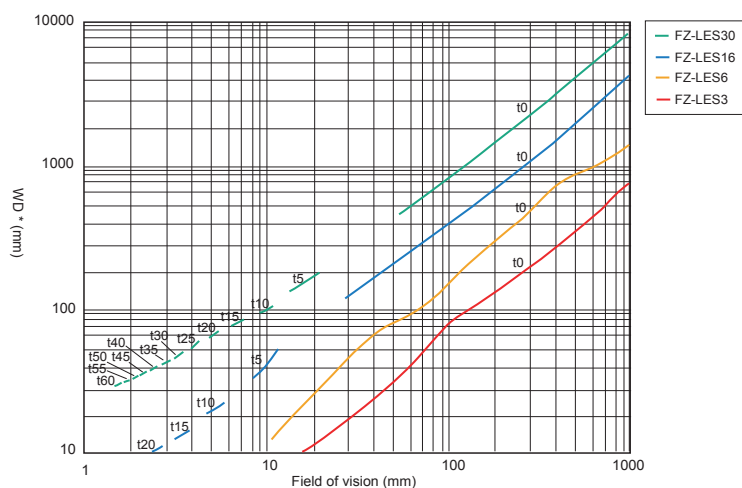
* The vertical axis represents WD, not installation distance.

FH-Series

High-speed CMOS Camera FH-S□02, 2 million-pixel (Vibrations and shocks resistant)
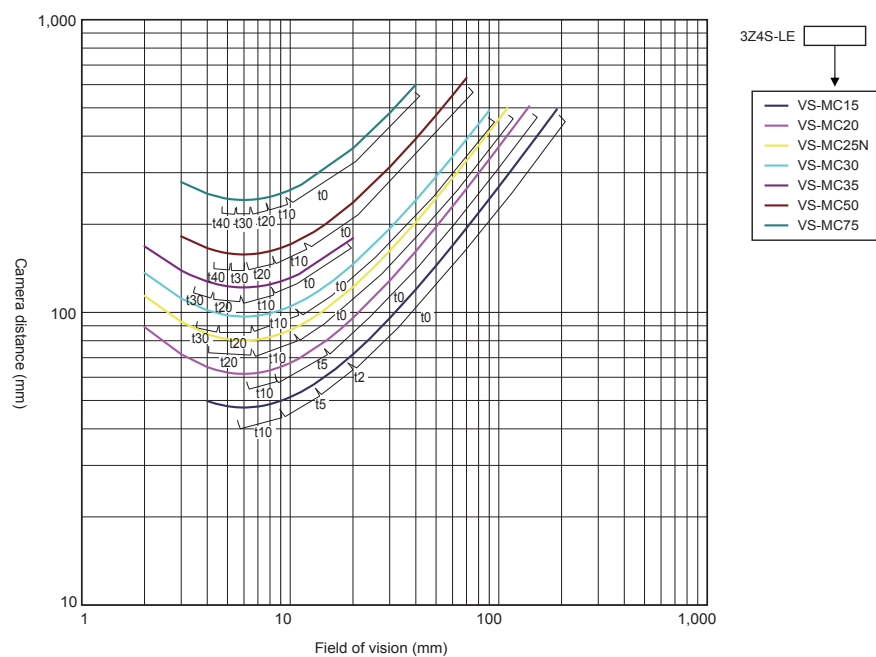
High-speed CMOS Camera FH-S□, High-speed CCD Camera FZ-SH□, Digital CCD Camera FZ-S□
300,000-pixel (Vibrations and shocks resistant)
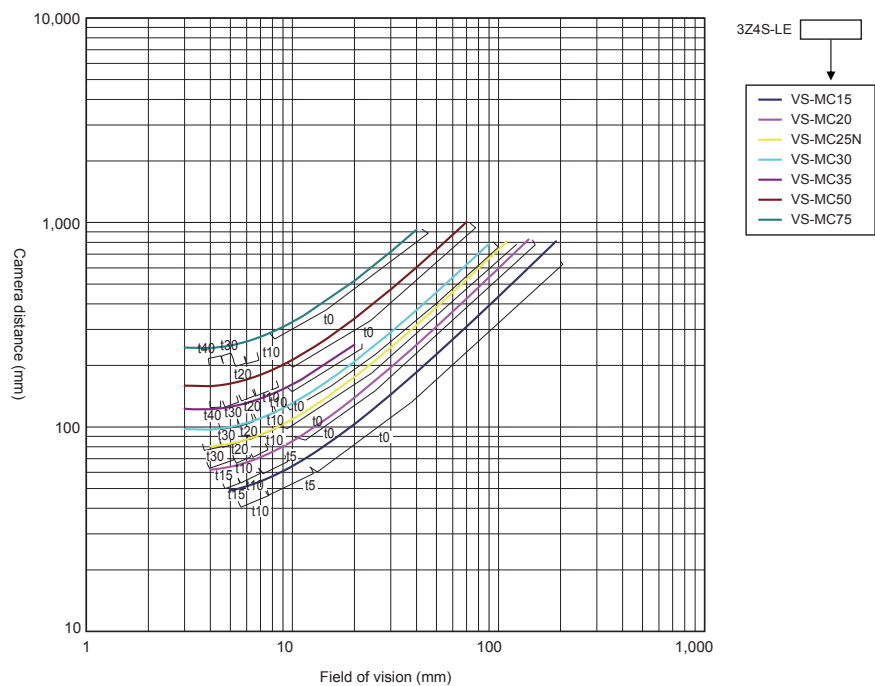
Digital CCD Camera FZ-S□5M2, 5 million-pixel
(Vibrations and shocks resistant)
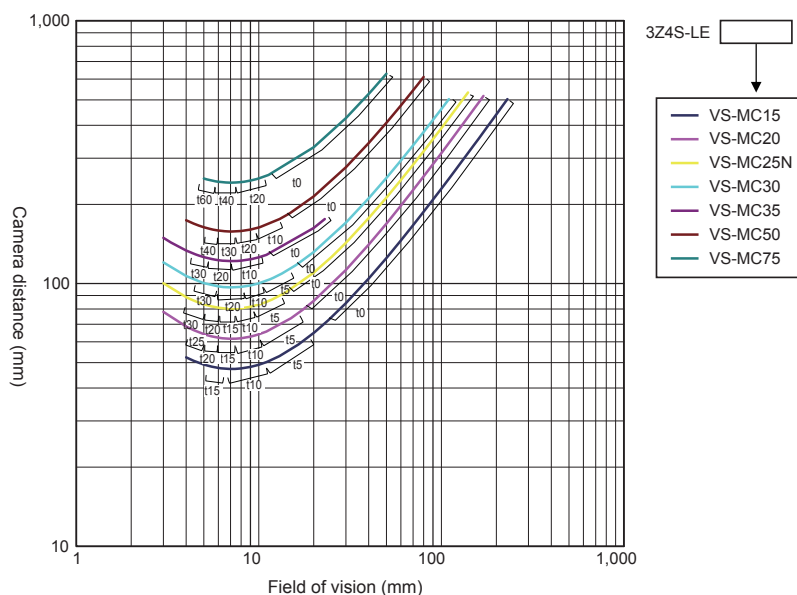
3Z4S-LE

- VS-MC15
- VS-MC20
- VS-MC25N
- VS-MC30
- VS-MC35
- VS-MC50
- VS-MC75

Camera distance (mm)

Field of vision (mm)

Digital CCD Camera FZ-S□2M, 2 million-pixel
(Vibrations and shocks resistant)

3Z4S-LE

- VS-MC15
- VS-MC20
- VS-MC25N
- VS-MC30
- VS-MC35
- VS-MC50
- VS-MC75

Camera distance (mm)
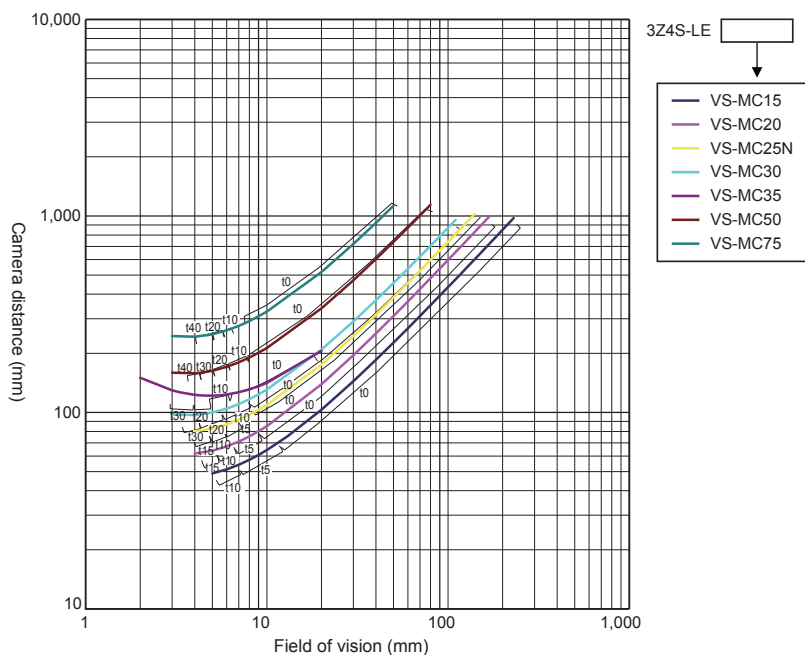
Field of vision (mm)

Meaning of Optical Chart

The X axis of the optical chart shows the field of vision (mm) (*1),
and the Y axis of the optical chart shows the camera installation distance (mm) (*2).

Camera

Extension Tube thickness: t □ (mm)

Lens

Camera distance (mm)

WD (mm)

Field of vision (mm)

Y
Field of vision
X
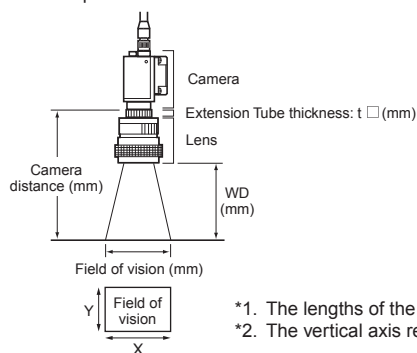
*1. The lengths of the fields of vision given in the optical charts are the lengths of the Y axis.
*2. The vertical axis represents WD for small cameras.

FH-Series

Intelligent CCD Cameras, Autofocus CCD Cameras

• Narrow View
FZ-SLC15

Field of vision 13.8 to 14.9
2.9 to 3.1
13.8 to 14.9
2.9 to 3.1
0
35 to 55

FZ-SZC15

Field of vision 13.8 to 14.9
2.9 to 3.1
13.8 to 14.9
2.9 to 3.1
0
47.5 to 67.5

• Wide View
FZ-SLC100

Field of vision 29 to 100
12.6 to 52
29 to 100
12.6 to 52
190
0
70 to

FZ-SZC100

Field of vision 29 to 100
12.6 to 52
29 to 100
12.6 to 52
197.5
0
77.5 to
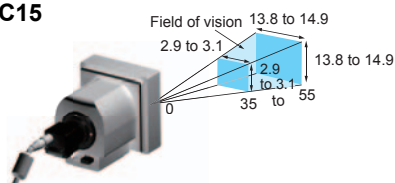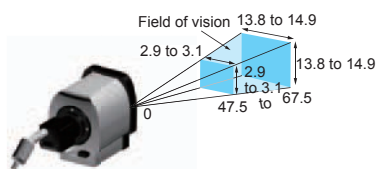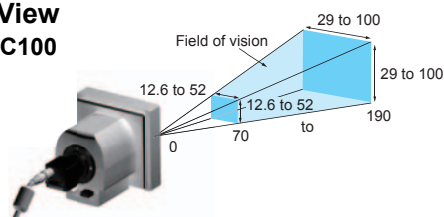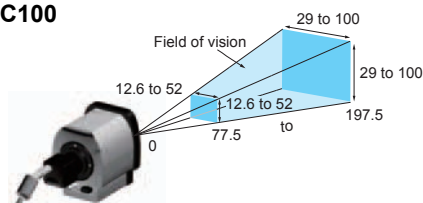
* Field of Vision of Intelligent Cameras and Autofocus Cameras
  The images displayed on the monitor will be rectangular images of 640×480 pixels.
  The valid processing area for measurements is the 480×480-pixel area in the middle.
  The above figures show the dimensions of the middle 480×480 pixels.

Intelligent Compact Cameras

• Narrow View
FZ-SQ010F

Field of vision 13
7.5
8.2
4.7
38 to 60
0

• Standard
FZ-SQ050F

Field of vision 53
13
33
8.2
215
56 to
0

• Wide View (Long-distance)
FZ-SQ100F

Field of vision 240
53
153
33
970
220 to
0
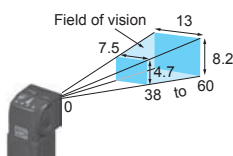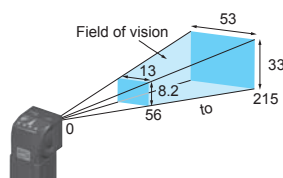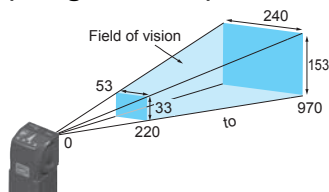
• Wide View (Short-distance)
FZ-SQ100N

Field of vision 300
29
191
18
380
32 to
0
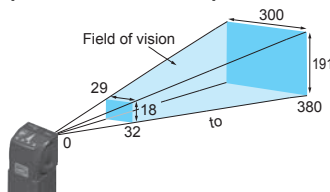
Related Manuals

Man.No.	Model number	Manual
Z340	FH/FZ5	Vision System FH/FZ5 Series User's Manual
Z341	FH/FZ5	Vision System FH/FZ5 Series Processinng Item Function Reference Manual
Z342	FH/FZ5	Vision System FH/FZ5 Series User's Manual for Communications Settings
Z343	FH	Vision System FH Series Operation Manual for Sysmac Studio

Diversified Technologies/MCTRAM 2 West Main Street 3rd Floor Victor NY 14564 585-461-2110 www.diversifiedtech.net

Automation Control Systems
• Machine Automation Controllers (MAC) • Programmable Controllers (PLC)
• Operator interfaces (HMI) • Distributed I/O • Software

Drives & Motion Controls
• Servo & AC Drives • Motion Controllers & Encoders

Temperature & Process Controllers
• Single and Multi-loop Controllers

Sensors & Vision
• Proximity Sensors • Photoelectric Sensors • Fiber-Optic Sensors
• Amplified Photomicrosensors • Measurement Sensors
• Ultrasonic Sensors • Vision Sensors

Industrial Components
• RFID/Code Readers • Relays • Pushbuttons & Indicators
• Limit and Basic Switches • Timers • Counters • Metering Devices
• Power Supplies

Safety
• Laser Scanners • Safety Mats • Edges and Bumpers • Programmable Safety
Controllers • Light Curtains • Safety Relays • Safety Interlock Switches